


T. 144 R. 30 M. 5th Coordinates: X _____ Y _____

E 1/4 24 Corner common to sections 24 and 19-144-29

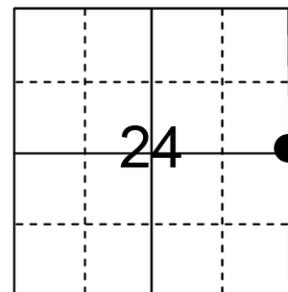

24

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument Post

Original Evidence Found

Year of search 1907 by Curo
Monument found _____
Survey Rec. #124, Bk A, pg 249

Bearing Trees

Species	<u>Sugar Maple</u>	<u>Sugar Maple</u>	_____
Diameter	<u>6"</u>	<u>4"</u>	_____
Bearing	<u>N 50° E</u>	<u>S 58° W</u>	_____
Distance	<u>17 links</u>	<u>25 links</u>	_____

Original Bearing Trees Found

Species	<u>Maple</u>	<u>Maple</u>	_____
Diameter	<u>6"</u>	<u>4"</u>	_____
Bearing	<u>N 50° E</u>	<u>S 58° W</u>	_____
Distance	<u>17 links</u>	<u>25 links</u>	_____

Subsequent Corner Restoration

Year surveyed 1/1907 By J.W. Curo, LS 1428, Co. Survey
Location filed: Survey Record #124, Book A, page 249
Monument: Set a wood stake from recovered original witness trees.

Evidence of Subsequent Corner Restoration

Year of search 6/1926 By E.G. Harrington, US Cad. Eng.
Location filed: MN Historical Soc. notes page 11 1/4
Monument: Found decayed wood stake S24 | S19 set 1"x 36" iron pipe with brass cap in place of wood stake and notes witnesses as follows. 1926

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects

Species	<u>Maple snag</u>	<u>Maple stump</u>	<u>Elm</u>	<u>Maple</u>
Diameter	<u>14"(GLO)</u>	<u>14"(GLO)</u>	<u>16"</u>	<u>7"</u>
Bearing	<u>S 61°30' W</u>	<u>N 48° E</u>	<u>S 68° E</u>	<u>N 28°30' E</u>
Distance	<u>25 links</u>	<u>17 links</u>	<u>31 links</u>	<u>23 links</u>

Subsequent Corner Restoration

Year surveyed 12/1930 By A.R. Boeruer, Estimator, CCC
Location filed: Form 874-9
Monument: Found iron stake brass cap up 10" in good condition and witnesses as follows.
13" Elm, S 76° E, 18'(1926)
9" Maple, N 36° W, 14'

Evidence of Subsequent Corner Restoration Found

Year of search 6/1991 By C.R. Krause, USFS
Location filed: USFS T144R29 Book 1, page 11
Monument: Found iron with brass cap up 12" in good condition, 40' E. of woods trail and witnesses.
Elm snag, S 68° E, 20.5'(1926) standing dead
Maple, N 28° W, 15.2'(1926) decaying wind fall
17" Maple, N 47° E, 56.55' scribed 1/4 S19 BT
14" Maple, S 33° E, 7.25' scribed 1/4 S19 BT
13" Maple, N 80° W, 56.75'scribed 1/4 S24 BT

5/1936, Unknown
Form 874-9
Indicates a new stake, Balsom(sic) 3" and Maple stub on Sec. 19, Maple 10" on Sec. 24.

12/2001, T.L. Freeman, LS 21367
Certificates of Survey for Hollard, #1418
Indicates a Brass Capped monument found.

6/1976, C.R. Krause, USFS
USFS T144R29 Book 1, page 11
Found iron with brass cap up 12", and witnesses as follows.
19" Elm, S 68° E, 20.5'(1926) scribe overgrown
12" Maple, N 28° W, 15.2'(1926) scribe overgrown
12" Maple, S 30° E, 6.5' FSLP

1/2002, T.L. Freeman, LS 21367
Certificates of Survey for Hollard, #1455
Indicates a Brass Capped monument found.

10/1988, R.A. Mustonen, LS 11946
Certificate of Survey, #1110
Indicates a GLO Brass Capped monument found.

2/2004, T.L. Freeman, LS 21367
Plat of ROCK SPRINGS, Doc. #A000490115
Section subdivision indicates GLO Brass Cap monument found.

10/2004, T.L. Freeman, LS 21367
Plat of PAROBK ESTATES, Doc. #A000490865
Indicates a monument found.

T. 144 R. 30 M. 5th Coordinates: X _____ Y _____

E 1/4 24 Corner common to sections 24 and 19-144-29

Subsequent Corner Restoration

Evidence of Subsequent Corner Restoration Found

Year surveyed 5/2015 By T.L. Freeman, LS 21367

Year of search _____ By _____

Location filed: Certificates of Survey for Dietz, #7483

Location filed:

Monument: Indicates a monument found.

Monument:

