


T. 144 R. 31 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_

NE 10 Corner common to sections 2, 3, 10, 11

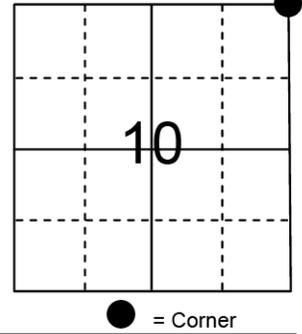

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ by \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees

Species	<u>White Birch</u>	<u>White Birch</u>	<u>White Birch</u>	<u>White Birch</u>
Diameter	<u>4"</u>	<u>4"</u>	<u>4"</u>	<u>4"</u>
Bearing	<u>N 6° W</u>	<u>N 10° E</u>	<u>S 36° E</u>	<u>S 81° W</u>
Distance	<u>103 links</u>	<u>132 links</u>	<u>21 links</u>	<u>20 links</u>

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 3/1914 By J.W. Curo, LS 1428  
Location filed: Survey Record #302, Book B, page 318-319  
Monument: Set spike at prorated position and notes I we could find the MC on S. side of Moss Lake, this corner would probably be placed 42'+/-, N. but MC is gone.

Evidence of Subsequent Corner Restoration

Year of search 1/1917 By E.B. Horst, LS 376  
Location filed: Curo Book 68, image 179, 183 and 185  
Monument: Found 1/2"x 12" spike and BT stumps by Curo, new witnesses, image 183 set 1 3/4"x 36" capped pipe, pictorial on image 185.

Bearing Trees, Reference Objects

Species	<u>Norway Pine</u>	<u>Norway Pine</u>	_____	_____
Diameter	<u>Stump</u>	<u>Stump</u>	_____	_____
Bearing	<u>N 10°30' E</u>	<u>S 61°10' E</u>	_____	_____
Distance	<u>17.08'</u>	<u>22.41'</u>	_____	_____

Bearing Trees, Reference Objects

Species	<u>Jack Pine</u>	<u>Norway Pine</u>	<u>Norway Pine</u>	_____
Diameter	<u>6"</u>	<u>16"</u>	<u>18"</u>	_____
Bearing	<u>N 40° W</u>	<u>S 21° W</u>	<u>S 43° E</u>	_____
Distance	<u>103.20'</u>	<u>138.80'</u>	<u>101.90'</u>	_____

Subsequent Corner Restoration

Year surveyed 10/1930 By H.D. Craig, U.S. Surveyor, GLO  
Location filed: MN Hist. Soc., notes page 70 T144N R31W  
Monument: Set 2"x 3' iron pipe with brass cap S 3 | S 2  
at proportionate measurement N-S and by S10 | S11  
original line blazes for E-W and witnessed. 1930  
10" White Pine, N 32°55' E, 341 links(225.06')  
10" Norway Pine, S 82° E, 285 links(188.10')  
16" Norway Pine, S 37 1/2° W, 228 links(150.48')  
16" Norway Pine, N 12 3/4° W, 174 links(114.84')

Evidence of Subsequent Corner Restoration Found

Year of search 4/1991 By G. Brama, USFS  
Location filed: T144N R31W Field Book 1, page 53  
Monument: Found iron pipe with brass cap up 3", a Cass County galvanized cap iron pipe is S 81° W, 24.7' and witnesses.  
White Pine stump, N 33° E, 225.1'(1930)  
18" Norway Pine, S 82° E, 188.1'(1930)  
Norway Pine stump, S 38° W, 150.5'(1930)burned,"BT"visible  
24" Norway Pine, N 13° W, 114.8'(1930)  
Steel Sign Post, West, 3.0'

2/1934, J.A. Gjelhaug, Eng. CCC  
USFS Form 874-9  
Found Brass capped 1 1/2" iron pipe, up 6" and lists witnesses as follows.  
12" Norway Pine, S 37° W, 227 1/2 links(150.15')  
10" Norway Pine, N 13° W, 172 3/4 links(114.02')  
12" White Pine, N 32° E, 340 links(224.4')  
10" Norway Pine, S 83 1/2° E, 283 1/2 links(187.11')  
6" Jack Pine, South, 30 links(19.8') Metal location poster

