


T. 144 R. 31 M. 5th Coordinates: X _____ Y _____
N 1/4 11 Corner common to sections 2, 11

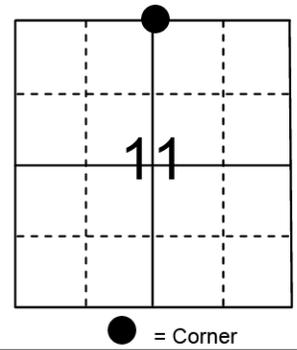

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed <u>1875</u>	Year of search <u>1914</u> by <u>Curo</u>
Original monument <u>Post</u>	Monument found _____
	Survey Rec #302, Bk B, pg 318

Bearing Trees	
Species	<u>Norway Pine</u> <u>Jack Pine</u>
Diameter	<u>12"</u> <u>5"</u>
Bearing	<u>S 4° E</u> <u>N 3° E</u>
Distance	<u>385 links</u> <u>179 links</u>

Original Bearing Trees Found	
Species	<u>Norway Pine</u>
Diameter	<u>tall stub</u>
Bearing	<u>S 4° E</u>
Distance	<u>254.10'</u>

Subsequent Corner Restoration

Year surveyed 3/1914 By J.W. Curo, LS 1428
 Location filed: Survey Record #302, Book B, page 316, 318
 Monument: Set small hub and nail from GLO witness, lists NE witness as N 30° E, 171 links, this is wrong, new witnesses as follows.

Evidence of Subsequent Corner Restoration

Year of search 1/1917 By E.B. Horst, LS 376
 Location filed: Curo Book 68, image 178, 179, 183 and 185
 Monument: Set large spike at position established by Curo from GLO witnesses, SE BT is plainly marked, notes Curo witnesses, makes new witnesses in case a road is built, image 183 set 1 3/4"x 36" capped pipe, pictorial on image 185.

Bearing Trees, Reference Objects	
Species	<u>Jack Pine</u> <u>J. Pine stump</u>
Diameter	<u>10"</u> <u>12"</u>
Bearing	<u>N 60° W</u> <u>S 4° E</u>
Distance	<u>11.10'</u> <u>32.50'</u>

Bearing Trees, Reference Objects	
Species	<u>Jack Pine</u> <u>Jack Pine</u>
Diameter	<u>9"</u> <u>6"</u>
Bearing	<u>N 16° E</u> <u>S 28°30' E</u>
Distance	<u>34.80'</u> <u>38.40'</u>

Subsequent Corner Restoration

Year surveyed 3/1921 By E.B. Horst, LS 376, Deputy
 Location filed: Survey Record #461, Book B, page 431 and Curo
 Monument: Found 1"x 36" capped I.M.
 Curo Book 68, image 198, set by me from US BT, next to tree, evidently pulled by some one for malicious purpose, run S.

10/1930, H.D. Craig, U.S. Surveyor, GLO
 Minnesota Historical Society, notes page 71 1/4 S 2
 Set 1"x 3' iron pipe with brass cap in place of S 11
 a Cass County 1" iron pipe found at corner and 1930
 reset on N. side, lists witnesses as follows.
 18" N. Pine stump, S 3 1/4° E, 385 links(254.10') GLO
 10" Jack Pine, S 66° E, 21 links(13.86')
 15" Norway Pine, N 39 3/4° W, 40 links(26.44')

4/1934, J.A. Gjelhaug, Eng. CCC
 USFS Form 874-9
 Found Brass capped 1" iron pipe, up 8" and lists witnesses, probably from 1930 as follows.
 14" Norway Pine, N 40° W, 39 1/2 links(26.07')
 10" Jack Pine, S 66° E, 20 1/2 links(13.53')

Evidence of Subsequent Corner Restoration Found

Year of search 4/1991 By G. Brama, USFS
 Location filed: T144N R31W Field Book 1, page 52
 Monument: Found GLO brass cap
 up 6", County capped iron pipe on N. side and witnessed.
 N. Pine stump, S 3° E, 254.10'(GLO) badly burnt
 23" Norway Pine, N 37° W, 26.4'(1930) scribe visible, burnt
 23" Norway Pine, S 17° E, 45.05'
 20" Norway Pine, N 13° E, 51.14'
 8" Jack Pine, N 88° W, 1033' FSLP, W. side of trail

