


Index No. J 9

CASS COUNTY LAND CORNER RECORD

T. 144 R. 31 M. 5TH Coordinates: X 399684.99 Y 279041.27
NE 17 Corner common to sections 8, 9, 16, 17

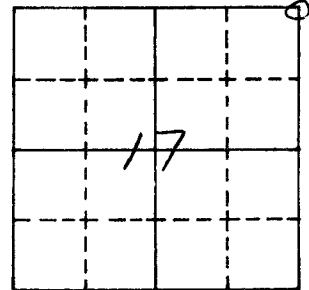

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
 Original monument Post

Bearing Trees		Bearing Trees	
Species <u>Cedar</u>	<u>Cedar</u>	<u>Cedar</u>	<u>Cedar</u>
Diameter <u>6"</u>	<u>6"</u>	<u>8"</u>	<u>6"</u>
Bearing <u>N 8 W</u>	<u>S 45 W</u>	<u>S 28 E</u>	<u>N 28 E</u>
Distance <u>6 LKS</u>	<u>33 LKS</u>	<u>5 LKS</u>	<u>14 LKS</u>

Original Evidence Found

Year of search _____ By _____
 Monument found _____

Original Bearing Trees Found

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

O = Corner

Subsequent Corner Restoration

Year surveyed 1900 By JAMES MIDDLETON
 Location filed COUNTY BOOK B P 579
 Monument SET 4" CEDAR HUB FROM OLD GOVT. PTS: 8" CEDAR S 28 E 5 LKS, 6" CEDAR N 28 E 14 AND Co. Rd SURFACE PTS: 12" CEDAR N 66-05E 33.35', 10" CEDAR N 47-31 W 33.65', 9" CEDAR 545-35 W 43.94'

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Evidence of Subsequent Corner Restoration

Year of search 1930 By GLO
Set concrete mon. 24" long 6" Dia w/ brass cap 6" below road surface 3 LKS S. of E-W Rd on fill
T 144 N R 31 W S 8 59 517 516
1930

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
<u>Cedar</u>	<u>8"</u>	<u>N 19 1/2 E</u>	<u>144 LKS</u>
<u>Cedar</u>	<u>6"</u>	<u>S 49 E</u>	<u>141 1/2 LKS</u>
<u>Cedar</u>	<u>8"</u>	<u>S 11 1/4 W</u>	<u>118 LKS</u>
<u>Cedar</u>	<u>9"</u>	<u>N 36 3/4 W</u>	<u>138 1/2 LKS</u>

J-9

Subsequent Corner Restoration

Year surveyed 1925 By Miss. Hury Dept.
 Location filed R/W map in Recorder's Office - Walker to Cass Lake
 Monument conc. mon. i brass cap 782.2' E. of C

4/2002 file #2002.009 CCSO found 1/2" OOP, down 0.5', 9'± S. of E Co. Rd. #144, this pipe is 1.5' SE of position established by GLO witnesses. The GLO position is witnessed as follows:

- 12" Cedar N 38° W, 91.41' ± (GLO)
- 16" Cedar N 36° E, 73.29'
- 10" Cedar S 48° E, 93.44' ± (GLO)
- 10" Cedar S 14° W, 77.9 (GLO down)
- *distance to double head nail

June 1918, Twp rd order shows no survey

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Remonumentation certificate prepared _____
 Filed at _____

By _____
 Date _____