


T. 144 R. 31 M. 5th Coordinates: X _____ Y _____

N 1/4 24 Corner common to sections 13, 24

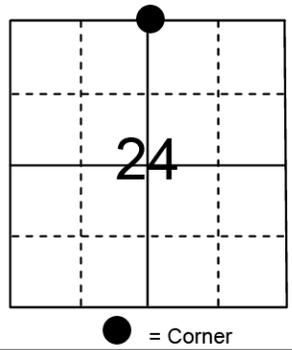

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search 1930 by Craig
Monument found Tamarack stake
Resurvey notes page 31

Bearing Trees

Species	<u>Norway Pine</u>	<u>Norway Pine</u>	_____
Diameter	<u>24"</u>	<u>24"</u>	_____
Bearing	<u>N 56° E</u>	<u>S 5° E</u>	_____
Distance	<u>25 links</u>	<u>38 links</u>	_____

Original Bearing Trees Found

Species	<u>N. Pine stump</u>	<u>N. Pine stump</u>	_____
Diameter	<u>24", 4' high</u>	<u>22", 3' high</u>	_____
Bearing	<u>N 49° E</u>	<u>S 4° W</u>	_____
Distance	<u>25 links</u>	<u>38 links</u>	_____

Subsequent Corner Restoration

Year surveyed 11/1925 By C.B. Stots, Cruiser, CCC
Location filed: USFS Form 874-9
Monument: Squared stake
in good condition, up 3', at E. edge of swamp, 4 chains NE to House, stoves and debris at corner and lists witnesses as follows.

Evidence of Subsequent Corner Restoration

Year of search 9/1930 By H.D. Craig, U.S. Surveyor, GLO
Location filed: MN Historical Society, notes page 32 1/4 S 13
S 24
from remains of original post or bearing trees, up 6" 1930
and states No trees suitable for new bearing trees available.

Bearing Trees, Reference Objects

Species	<u>R. Pine snag</u>	<u>R. Pine snag</u>	_____
Diameter	<u>25"</u>	<u>24"</u>	_____
Bearing	<u>N 50° E</u>	<u>S 5° W</u>	_____
Distance	<u>15'</u>	<u>30'</u>	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 2/1984 By C.R. Krause, USFS
Location filed: USFS Field Book 1, page 26
Monument: Found GLO brass cap iron pipe
up 6", at edge of N-S swamp, Jack Pine ridge, E. of corner and witnesses as follows.
Pine stub, N 49° E, 16.5'(GLO) 5' high
10" Jack Pine, N 45° E, 20.60' scribed
11" Jack Pine, S 83° E, 72.15' scribed
9" Jack Pine, S 44° E, 67.50' scribed
Steel Sign Post, South, 4.0'
Steel Sign Post, East, 4.7'

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

