


T. 144 R. 31 M. 5th Coordinates: X _____ Y _____
E 1/4 31 Corner common to sections 31, 32

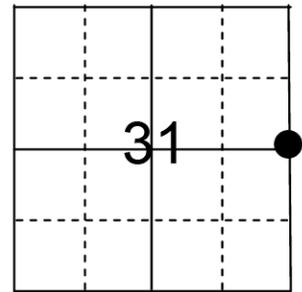

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search 1905 by Curo
Monument found Stake
Survey Rec. #471, Bk C, pg 487

Bearing Trees

Species Aspen Aspen
Diameter 4" 4"
Bearing N 55° W S 62° E
Distance 3 links 10 links

Original Bearing Trees Found

Species Aspen Aspen
Diameter 4" 4"
Bearing N 55° W S 62° E
Distance 3 links 10 links

Subsequent Corner Restoration

Year surveyed 2/1905 By J.W. Curo, LS 1428
Location filed: Road Calendar Book A, page 58 and Road
Monument:
Road Calendar Book B, page 37, Wilkinson County Road,
indicates the road runs W. and E. from the corner.

Evidence of Subsequent Corner Restoration

Year of search 2/1905 By J.W. Curo, LS 1428
Location filed: Survey Record #471, Book C, page 487 and Curo
Monument: Set 4"x4" tam. post
Curo Book 87, page 15, found this stake and old B.T.'s and
marked new witnesses as follows.

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Bearing Trees, Reference Objects

Species Tamarack W. Pine
Diameter 7" 6"
Bearing S 39° E N 56°45' E
Distance 64.75' 57.50'

Subsequent Corner Restoration

Year surveyed 1/1915 By N.D. Gorman, Deputy Co Surv
Location filed: Survey Record #471, Book C, page 487 and Curo
Monument: Found 2" iron pipe
Curo Book 87, pages 14, 15, 44 and 45, at 2640 true 1/4 Cor.
sets N. 8.40' and E. 10.15' and post gone, we find both new
B.T.s, standing which check perfectly with stone which was
buried in place of the stake.

Evidence of Subsequent Corner Restoration Found

Year of search 10/1973 By J.R. Worcester, CCHD
Location filed: SAP 11-666-01
Monument: Found 2" iron pipe
at station 53+21.8 and witnessed.
30" W. Pine, NW, 155.7'
30" W. Pine, NNW, 169.7'
8" Spruce, NNE, 98.5'

11/1915, F.N. Molyneux, Assistant Engineer
Survey Record #471, Bk C, page 492 and Curo Bk 87, pg. 64
Set iron monuments at subdivision corners of Sec. 32.

7/1978, CCHD
SAP 11-666-01
Reset spike at station 53+21.8 and witnessed.
30" W. Pine, NNW, 169.7'(1973)
8" Spruce, NNE, 98.5'(1973)
40" W. Pine, NW, 141.9'

12/1915, J.W. Curo, LS 1428, Cass County Surveyor
Survey of Section 32, Curo's Contract No. 3
Indicates 2.25"x 4' I.M., Known corner from old bearing trees.

5/2018, CCHD/SO
#2018.003
Found 2.25" ODIP w/plumber cap, flush, on centerline CSAH
#66 witnessed and removed monument prior to reconstruction.
36" Pine stump, N 22° W, 169.7'(1973) center of stump
12" Spruce, N 12° E, 98.45'(1973) brass nail/disc, up 1.3', E side
18" Spruce, S 61° W, 71.44' duplex nail, up 1.0', S. side
Power Pole, N 14° W, 56.23' duplex nail, up 1.0', E. side

5/1931, Hal D. Craig, U.S. Surveyor
Dependent Resurvey of a Portion T 144 N, R 31 W 1/4
Found Cass Co. galv. iron pipe, 2.5" w/iron cap, S31 | S32
6" below road, intersection of graded roads E., W. 1931
and S. and witnessed as follows.
14" W. Pine, N 30 1/4° E, 142 links(93.72')
14" W. Pine, N 47° W, 237 links(156.42')
NE Cor House, S 55 1/2° W, 250 links(165.00') Finn's House

T. 144 R. 31 M. 5th Coordinates: X _____ Y _____

E 1/4 31 Corner common to sections _____

Subsequent Corner Restoration

Evidence of Subsequent Corner Restoration Found

Year surveyed 9/2018 By CCHD/SO

Year of search _____ By _____

Location filed: #2018.003

Location filed:

Monument: Reset 2.25" ODIP w/plumber cap
down 0.05', on new centerline CSAH #66.

Monument:

