


T. 144 R. 31 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
C 1/4 Corner common to sections 32

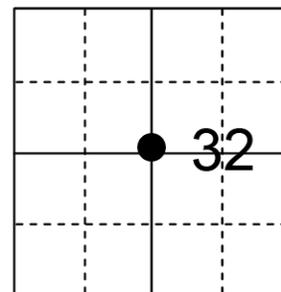

EXISTING SURVEYS

Original Government Survey

Year surveyed 1905  
Original monument Unknown

Road Calendar Bk A, page 58 and Road Calendar Bk B page 37

Bearing Trees

Species Wilkinson County Road Ends at the corner.  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Original Evidence Found

Year of search \_\_\_\_\_ by \_\_\_\_\_  
Monument found \_\_\_\_\_

Original Bearing Trees Found

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Subsequent Corner Restoration

Year surveyed 1/1915 By N.D. Gorman, Deputy Co Surv  
Location filed: Survey Record #471, Book C, page 490 and Curo  
Monument: Set spike  
Curo Book 87, pages 39 and 40, at 2672.60' E. of 1/4 cor. Sec.  
31-32, true C. 1/4 sets S.13.46', drive spike in S. side of the  
County road.

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Evidence of Subsequent Corner Restoration

Year of search 1/1915 By J.W. Curo, LS 1428  
Location filed: Survey of Section 32, Curo's Contract No. 3  
Monument: 2 1/4"x 4' I.M.  
Indicates corner established by this survey.

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Subsequent Corner Restoration

Year surveyed 5/1931 By Hal D. Craig, U.S. Surveyor  
Location filed: Dependent Resurvey of Portion T 144 N, R 31 W  
Monument: Set 6"x 24"concrete monument with brass tablet  
20" in ground and witnessed as follows. C 1/4  
6" N. Pine, N 2°15' E, 257 links(169.62') S32  
8" N. Pine, N 43° E, 169 links(111.54') 1931

Circa 1932, MnDOT  
Right of Way map, MnDOT web site, file 5-3\_002  
1Indicates concrete monument and brass cap and 2" iron pipe  
and cap 383.5' W. of centerline Highway #371.

10/1976, J.R. Worcester, CCHD  
Road Plan S.A.P. 11-666-01,  
Indicates assumed corner at centerline and fence line to N. at  
station 79+91.3.

9/2018, CCHD/SO  
#2018.003  
Set 1x32" alum. Co. Mon., down 0.05', from recovered 1915  
corners, 0.5', N. of new centerline CSAH #66, 3'+/-, E. of fence  
line N. and witnessed as follows  
12" W. Pine, S 38° E, 63.20' duplex nail, up 1.0', W. side  
8" W. Pine, S 26° W, 66.82' duplex nail, up 1.0', W. side  
Power Pole, N 48° W, 86.43' duplex nail, up 1.0', S. side

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Location filed:  
Monument:

