


T. 145 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
E 1/4 2 Corner common to sections 1, 2

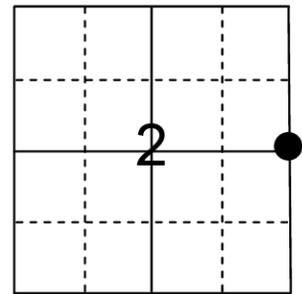

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874  
Original monument Post

Original Evidence Found

Year of search 1933 by GLO  
Monument found BT

Resurvey Notes

Bearing Trees

Species Blk. Pine Y. Pine  
Diameter 10" 14"  
Bearing S 35° W N 11° E  
Distance 63 links 84 links

Original Bearing Trees Found

Species Norway Pine Jack Pine  
Diameter 20" 12" snag  
Bearing N 11° E S 35° W  
Distance 84 links 63 links

Subsequent Corner Restoration

Year surveyed 6/1933 By W.W. Bandy, Surveyor  
Location filed: Resurvey Notes 1/4  
Monument: Set 1"x 3' iron post with brass cap S 2 | S 1  
From GLO witnesses 1933

Evidence of Subsequent Corner Restoration

Year of search 3/1937 By H. Hennes, CCC  
Location filed: Form 874  
Monument: Metal cap  
up 3" in good condition.

Bearing Trees, Reference Objects

Species White Pine Norway Pine  
Diameter 10" 10"  
Bearing S 80 1/2° E N 77 1/2° W  
Distance 38 links 93 links

Bearing Trees, Reference Objects

Species N. Pine W. Pine  
Diameter 12" 12"  
Bearing S 80° E N 78° W  
Distance 94 links 38 links

Subsequent Corner Restoration

Year surveyed 5/1966 By J. Ekstrom, USFS  
Location filed: USFS Book 1, page 62  
Monument: Found GLO iron with brass cap  
and witnesses.  
20" N. Pine, N 11° E, 55.44' (GLO)  
Pine stump, N 78° W, 61.38' (1933)  
12" N. Pine, N 41° W, 55.2'  
20" W. Pine, N 77° W, 25.2'  
Steel Sign Post, South, 6.9'

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Location filed: \_\_\_\_\_  
Monument: \_\_\_\_\_

