


T. 145 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 15 Corner common to sections 10, 11, 14, 15

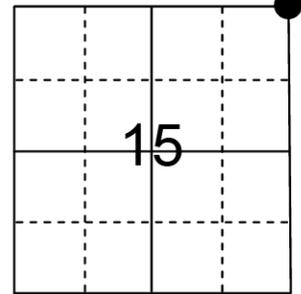

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ by \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees

Species	Black Pine	Black Pine	Black Pine	Black Pine
Diameter	5"	5"	2.5"	3"
Bearing	S 70° W	N 44° W	N 10° E	S 84° E
Distance	30 links	82 links	130 links	20 links

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1928 By J.A. Donery, Forest Ranger  
Location filed: CCC notes USFS  
Monument:  
No evidence found.

Evidence of Subsequent Corner Restoration

Year of search 6/1933 By W.W. Bandy, Surveyor  
Location filed: Resurvey Notes T145 N R30W  
Monument: Set 6" conc cylinder with brass tablet S 10 | S 11  
at proportionate position, on old blazed lines. S 15 | S 14  
1933

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Bearing Trees, Reference Objects

Species	Poplar	Jack Pine	Jack Pine	Jack Pine
Diameter	8"	5"	10"	7"
Bearing	N 24 1/4° E	S 66 1/2° E	S 21° W	N 81 3/4° W
Distance	110 links	26 links	37 links	120 links

Subsequent Corner Restoration

Year surveyed 5/1936 By CCC  
Location filed: Form 870  
Monument: None found

Evidence of Subsequent Corner Restoration Found

Year of search 4/2010 By Kadrmass, Lee & Jackson  
Location filed: Certificate of Location  
Monument: Found GLO concrete with brass cap  
up 1.0' and the 2003 witnesses.

5/1966, M. Hansey, USFS  
USFS Book 1, page 76  
Found GLO concrete with brass cap  
12" Poplar, N 24° E, 72.60' (1933)  
10" Jack Pine, S 66° E, 17.16' (1933)  
16" Jack Pine, S 21° W, 24.42' (1933)  
Jack Pine, N 82° W, 79.20' (1933) Blown down  
9" Jack Pine, N 84° W, 55.5'

4/2014, R. Wamre, LS 45334  
Certificate of Location, Doc. #A000601707  
Filed on the above information.


X/2003, CCHD/SO  
#2001.002

Found GLO concrete with brass cap, up 0.2' and witnessed.  
Jack Pine snag, S 66° E, 17.1' (1933) 10' tall snag  
Jack Pine snag, S 24° W, 24.5' (1933) 30' tall snag  
Jack Pine snag, N 84° W, 55.5' (1966) 30' tall snag  
6" White Oak, N 20° W, 31.00' 16d duplex nail, up 1.0', W. side  
8" Jack Pine, N 12° W, 46.40' 16d duplex nail, up 1.0', W. side  
6" White Oak, S 62° W, 26.74' 16d duplex nail, up 1.0', N. side

Index No. 517

CASS COUNTY LAND CORNER RECORD

T. 145 R. 30 M. 5TH Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 15 Corner common to sections 10, 11, 14, 15

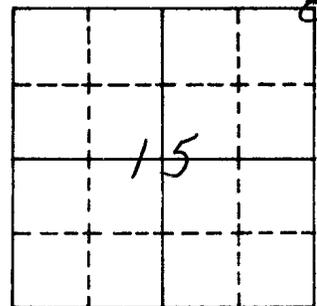

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

Species	Bearing Trees			
	<u>Bl. Pine</u>	<u>Bl. Pine</u>	<u>Bl. Pine</u>	<u>Bl. Pine</u>
Diameter	<u>5"</u>	<u>5"</u>	<u>2 1/2"</u>	<u>3"</u>
Bearing	<u>S70W</u>	<u>N44W</u>	<u>N10E</u>	<u>S84E</u>
Distance	<u>30LKS</u>	<u>82LKS</u>	<u>130LKS</u>	<u>20LKS</u>

Original Bearing Trees Found				
Species	Diameter	Bearing	Distance	
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

O = Corner

Subsequent Corner Restoration

Year surveyed 1933 By GLO  
Location filed Sec. of State  
Monument Set concrete Mon. 24" long 6" dia w/ brass cap on old blazed lines  
T145N R30W  
510/511  
515/514  
1933

Evidence of Subsequent Corner Restoration  
Year of search 1966 By William Okerman  
Found GLO monument in good condition

Species	Bearing Trees, Reference Objects			
	<u>Poplar</u>	<u>J. Pine</u>	<u>J. Pine</u>	<u>J. Pine</u>
Diameter	<u>8"</u>	<u>5"</u>	<u>10"</u>	<u>7"</u>
Bearing	<u>N24 1/2 E</u>	<u>S66 1/2 E</u>	<u>S21W</u>	<u>N81 3/4 W</u>
Distance	<u>110LKS</u>	<u>26LKS</u>	<u>37LKS</u>	<u>120LKS</u>

Bearing Trees, Reference Objects				
Species	Diameter	Bearing	Distance	
<u>Jack Pine</u>	<u>9"</u>	<u>N84W</u>	<u>55.5'</u>	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 5/1/03 By CCSO  
Location filed \_\_\_\_\_  
Monument Found Brass cap in concrete cylinder, up 0.2'  
8" J. Pine N12°W 46.40' dbl hd nail  
6" W. Oak N20°W 31.00' dbl hd nail  
30' tall Pine snag N84°W 55.5'  
6" W. Oak S62°W 26.74' dbl hd nail  
30' tall Pine snag S24°W 24.5'  
10' tall Pine snag S66°E 17.1'

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
CERTIFICATE - BILL OKERMAN - 1966

Remonumentation certificate prepared \_\_\_\_\_ By \_\_\_\_\_  
Filed at \_\_\_\_\_ Date \_\_\_\_\_