


T. 145 R. 30 M. 5th Coordinates: X _____ Y _____
N 1/4 13 Corner common to sections 12, 13

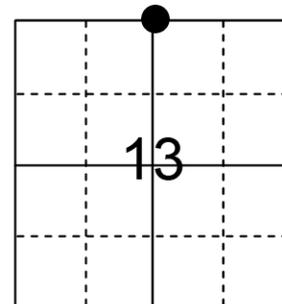

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874
Original monument Post

Original Evidence Found

Year of search 1933 by GLO
Monument found _____

Resurvey Notes

Bearing Trees

Species Black Pine Black Pine
Diameter 4" 3"
Bearing N 52° E S 13° W
Distance 52 links 46 links

Original Bearing Trees Found

Species Jack Pine Jack Pine
Diameter 8" snag 8" snag
Bearing N 52° E S 13° W
Distance 52 links 46 links

Subsequent Corner Restoration

Year surveyed 1928 By J.A. Donery, Forest Ranger
Location filed: CCC Notes, USFS
Monument: 3" stake scribed 1/4 S

Evidence of Subsequent Corner Restoration

Year of search 6/1933 By W.W. Bandy, Surveyor
Location filed: Resurvey Notes
Monument: Set 1" OD iron pipe with brass cap
from remains of original witnesses. 1/4 S 12
S 13
1933

Bearing Trees, Reference Objects

Species Jack Pine Jack Pine
Diameter _____
Bearing NE SW
Distance 15 paces 9 paces

Bearing Trees, Reference Objects

Species Norway Pine Norway Pine
Diameter 11" 11"
Bearing N 49 3/4° W S 45 3/4° E
Distance 71 links 82 links

Subsequent Corner Restoration

Year surveyed 12/1963 By R.H. McDonald, USFS
Location filed: USFS Book 1, page 51
Monument: Found GLO iron pipe with brass cap
17" Red Pine, N 50° W, 46.86' (1933)
19" Red Pine, S 46° E, 52.12' (1933)
Steel Sign Post, West, 3.9'

3/1992, G. Brama, USFS
USFS Book 1, page 51
Found GLO iron pipe with brass cap, up 10", 75'+/-, N. of trail,
found the 1933 witnesses and added.
11" Norway Pine, N 40° E, 9.85' 60d spike
Steel Sign Post, South, 3.0'

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____


4/2010, Kadrmas, Lee & Jackson
Certificate of Location
Found GLO iron pipe with brass cap, up 0.8' in good condition.
24" Norway Pine, N 11° E, 48.84' (1933)
8" Jack Pine, N 89° E, 28.21' spike in N. side
6" Red Pine, S 15° W, 18.91' spike in E. side
10" Red Pine, S 87° W, 16.24' spike in N. side
Steel Sign Post, South, 2.55' (1996)

4/2014, R. Wamre, LS 45334
Certificate of Location, Doc. #A000601386
Filed on the above information.

Index No. J 23

CASS COUNTY LAND CORNER RECORD

T. 145 R. 30 M. 5TH Coordinates: X _____ Y _____
N¹/₄ 13 Corner common to sections 12, 13

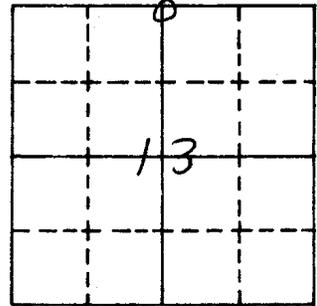

EXISTING SURVEYS

Original Government Survey

Year surveyed 1879
Original monument lost

Original Evidence Found

Year of search _____ By _____
Monument found _____

Bearing Trees

Species Bl. Pine Bl. Pine
Diameter 4" 3"
Bearing N52E S13W
Distance 524S 464S

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 1933 By GLO
Location filed Sec of State
Monument Find snags of both Bl. Pines - set 1x36"
1 1/2" white brass cap
1/4 512
1/4 513
1933

Evidence of Subsequent Corner Restoration

Year of search 1963 By William Okerman
Found GLO monument in good condition.

Bearing Trees, Reference Objects

Species N. Pine N. Pine
Diameter 11" 11"
Bearing N49 3/4 W S45 1/4 E
Distance 714S 824S

Bearing Trees, Reference Objects

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
CERTIFICATE - BILL OKERMAN - 1963

Remonumentation certificate prepared _____

By _____

Filed at _____

Date _____