


T. 145 R. 31 M. 5th Coordinates: X _____ Y _____
E 1/4 8 Corner common to sections 8, 9

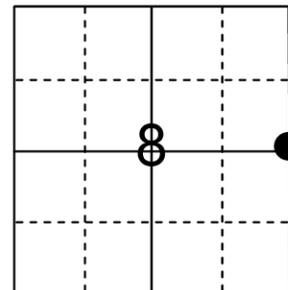

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search 1906 by Curo
Monument found BT's
Survey Rec #138, Bk A, pg. 277

Bearing Trees

Species Jack Pine Jack Pine
Diameter 8" 6"
Bearing N 72° W S 71° E
Distance 62 links 68 links

Original Bearing Trees Found

Species J. Pine J. Pine
Diameter _____
Bearing N 72° W S 71° E
Distance 62 links 68 links

Subsequent Corner Restoration

Year surveyed 8/1906 By J.W. Curo, LS 1428
Location filed: Survey Record #138, Book A, page 277
Monument: Set Stake from 2 old bearing trees.

Evidence of Subsequent Corner Restoration

Year of search 2/1908 By J.W. Curo, LS 1428
Location filed: Road Calender A, page 45
Monument: Found 2 GLO trees.

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing N 61°25' E N 69°52' W
Distance _____

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 3/1910 By J.D. Middleton
Location filed: Survey Record #362, Book B, page 574
Monument: Found Jack Pine hub Set from GLO witnesses, new witnesses as follow.
6" J. Pine stub, S 82°16' E, 46.38'
4"Cedar hub, S 49°15' W, 37.49'

11/1913, H.S. Todd and J.W. Curo, LS 1428
Survey Record #538, Book D, page 152 and Curo Book 74, page 82 and 83, states previously established by Curo, find the old rotted point, which we pull up and put in 1.5"x 4' Iron pipe, with cap and anchor rod. New wire fence begins 33' W.

1/1914, J.W. Curo, LS 1428
Plat of PINE GROVE CEMETERY, Doc. PLAT21
Section subdivision indicates monument at corner.

4/1921, Village of Cass Lake
Supplemental Plat of PINE GROVE CEMETERY, Doc. 66378
Section subdivision indicates monument at corner.

Evidence of Subsequent Corner Restoration Found

Year of search 10/1993 By R.W. Murray, LS 15483
Location filed: Certificate of Location
Monument: Found 1.5" ODIP with cap, bent replaced monument with Mn/DOT CIM, flush, 2'+/-, E. of centerline of Co. Rd. #149 and witnessed.
9" N. Pine, N 42° W, 84.65' pole barn spike, S. side
18" N. Pine, East, 81.55' pole barn spike, N. side

6/1996,
MN/DOT R/W Plat No. 11-16, Doc. #377902
Indicates MN/DOT Cast Iron monument at corner.

3/2001, CCHD/SO
#2001.008
Found CIM, 2.2' E. of centerline Co. Rd. #149, 1993 witnesses P. Pole, S 23° W, 99.71' duplex nail, up 1.0', E. side

3/2001, CCHD/SO
#2001.008
Found CIM, 2.2' E. of centerline Co. Rd. #149, 1993 witnesses 11" N. Pine, N 42° W, 84.65'(1993) pole spike, up 0.2', W. side
22" N. Pine, East, 81.55'(1993) pole spike, up 0.5', N. side
10" J. Pine, N 32° E, 68.00' duplex nail, up 1.0', E. side

