

CORNER RESTORATION

T148N R29W 5th PM.

#2

KA

FIELD BOOK


82.0012

CORNER RESTORATION T148N R29W 5th PM #2

DISTANCES FROM SIDE STAKES FOR CROSS-SECTIONING

Roadway of any Width. Side Slopes 1½ to 1.

In the figure below: opposite 7 under "Cut or Fill" and under .3 read 11.0, the distance out from the side stake at left. Also, opposite 11 under "Cut or Fill" and under .1 read 16.7, the distance out from the side stake at right.

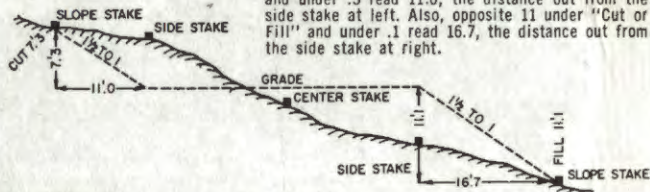

Cut or Fill	Distance out from Side or Shoulder Stake										Cut or Fill
	0'	.1	.2	.3	.4	.5	.6	.7	.8	.9	
0	0.0	0.2	0.3	0.5	0.6	0.8	0.9	1.1	1.2	1.4	0
1	1.5	1.7	1.8	2.0	2.1	2.3	2.4	2.6	2.7	2.9	1
2	3.0	3.2	3.3	3.5	3.6	3.8	3.9	4.1	4.2	4.4	2
3	4.5	4.7	4.8	5.0	5.1	5.3	5.4	5.6	5.7	5.9	3
4	6.0	6.2	6.3	6.5	6.6	6.8	6.9	7.1	7.2	7.4	4
5	7.5	7.7	7.8	8.0	8.1	8.3	8.4	8.6	8.7	8.9	5
6	9.0	9.2	9.3	9.5	9.6	9.8	9.9	10.1	10.2	10.4	6
7	10.5	10.7	10.8	11.0	11.1	11.3	11.4	11.6	11.7	11.9	7
8	12.0	12.2	12.3	12.5	12.6	12.8	12.9	13.1	13.2	13.4	8
9	13.5	13.7	13.8	14.0	14.1	14.3	14.4	14.6	14.7	14.9	9
10	15.0	15.2	15.3	15.5	15.6	15.8	15.9	16.1	16.2	16.4	10
11	16.5	16.7	16.8	17.0	17.1	17.3	17.4	17.6	17.7	17.9	11
12	18.0	18.2	18.3	18.5	18.6	18.8	18.9	19.1	19.2	19.4	12
13	19.5	19.7	19.8	20.0	20.1	20.3	20.4	20.6	20.7	20.9	13
14	21.0	21.2	21.3	21.5	21.6	21.8	21.9	22.1	22.2	22.4	14
15	22.5	22.7	22.8	23.0	23.1	23.3	23.4	23.6	23.7	23.9	15
16	24.0	24.2	24.3	24.5	24.6	24.8	24.9	25.1	25.2	25.4	16
17	25.5	25.7	25.8	26.0	26.1	26.3	26.4	26.6	26.7	26.9	17
18	27.0	27.2	27.3	27.5	27.6	27.8	27.9	28.1	28.2	28.4	18
19	28.5	28.7	28.8	29.0	29.1	29.3	29.4	29.6	29.7	29.9	19
20	30.0	30.2	30.3	30.5	30.6	30.8	30.9	31.1	31.2	31.4	20
21	31.5	31.7	31.8	32.0	32.1	32.3	32.4	32.6	32.7	32.9	21
22	33.0	33.2	33.3	33.5	33.6	33.8	33.9	34.1	34.2	34.4	22
23	34.5	34.7	34.8	35.0	35.1	35.3	35.4	35.6	35.7	35.9	23
24	36.0	36.2	36.3	36.5	36.6	36.8	36.9	37.1	37.2	37.4	24
25	37.5	37.7	37.8	38.0	38.1	38.3	38.4	38.6	38.7	38.9	25
26	39.0	39.2	39.3	39.5	39.6	39.8	39.9	40.1	40.2	40.4	26
27	40.5	40.7	40.8	41.0	41.1	41.3	41.4	41.6	41.7	41.9	27
28	42.0	42.2	42.3	42.5	42.6	42.8	42.9	43.1	43.2	43.4	28
29	43.5	43.7	43.8	44.0	44.1	44.3	44.4	44.6	44.7	44.9	29
30	45.0	45.2	45.3	45.5	45.6	45.8	45.9	46.1	46.2	46.4	30
31	46.5	46.7	46.8	47.0	47.1	47.3	47.4	47.6	47.7	47.9	31
32	48.0	48.2	48.3	48.5	48.6	48.8	48.9	49.1	49.2	49.4	32
33	49.5	49.7	49.8	50.0	50.1	50.3	50.4	50.6	50.7	50.9	33
34	51.0	51.2	51.3	51.5	51.6	51.8	51.9	52.1	52.2	52.4	34
35	52.5	52.7	52.8	53.0	53.1	53.3	53.4	53.6	53.7	53.9	35
36	54.0	54.2	54.3	54.5	54.6	54.8	54.9	55.1	55.2	55.4	36
37	55.5	55.7	55.8	56.0	56.1	56.3	56.4	56.6	56.7	56.9	37
38	57.0	57.2	57.3	57.5	57.6	57.8	57.9	58.1	58.2	58.4	38
39	58.5	58.7	58.8	59.0	59.1	59.3	59.4	59.6	59.7	59.9	39
40	60.0	60.2	60.3	60.5	60.6	60.8	60.9	61.1	61.2	61.4	40



The paper in this book is made of 50% high grade rag stock with a WATER RESISTING surface sizing.

USFS

T148N R29W 5th PM

Book #2 of 2

42			33		32				38
41	6	5	13	4	27	3		2	1 37
40	1		11	12	24	25	26		36
39	7	2	8	14	9	23	10	11	12
38	49	30	10	15	21		22		35
37	18	48	17	16	16	20	15	14	13
36	3				18				
35	19		20	17	21		22	23	24
34		4	47	19					34
33	30	5	29	46	28		27	26	25
32	7	6	9	45	43				32
31	31	8	32	44	33		34	35	36
30						55	54	53	28 29 30

147-29

Notes of Original Govt. Survey 1893

By George Ralph - US Deputy Surveyor

STARTED April 1 1893

COMPLETED April 10 1893

1
Quarter Corner Bet. Sec's. 6³/₇
Notes of Orig. Govt. survey 1893
Set wood post

Tam. 14 S60E 5 lks. 3.3'

Tam. 16 S80W 12 lks. 7.9'

CCC NOTES IN FIELD BOOK #99 Pg. 6

4/22/40 By H. HOARD

FOUND OLD SCRIBED COR. POST

SET 2"X4"X48" BALSAM STAKE

Fd. PINE STUB 14 NZW 77 LKS. = 50.82'

" PINE STUB 15 N14W 99 LKS. = 65.34'

" " FS POSTER

HOARD BELIEVES THEY ARE COUNTY BT'S.

DISTANCE BY CCC'S FROM SECTION COR.

TO SECTIONS 1-6-7-12 AS 54.68 CHS. OR

3608.88' AT A BEARING OF N86°30'E

12-8-94 TIM W. G. ROBERTSON - GUY CARLSON
ITASCA COUNTY MADE SEARCH FOR ANY
EVIDENCE OF POST OR PINE STUBS BY
HOARD - THEY STATE AREA HAS BEEN
LOGGED AND BURNED AND THEY FOUND
ONLY TAM. + CEDAR STUMPS + STUBS
NO SCRIBING ~~NO~~ NO OLD TAG
THEY RAN LINE AT N86°30'E A DISTANCE
OF 3608' FROM SEC. COR. 1-6-7-12
ON RANGE LINE.

2

Quarter Corner Bet. Sec's. 7³/₈
Notes of Orig. Gov't. survey 1893
Set wood post

Tam. 3 S28W 19 lks. 12.5'

Tam. 3 S68W 12 lks. 7.9'

3

Quarter Corner Bet. Sec's. 18-19
Notes of Orig. Gov't. survey 1893
Set wood post

Tam. 8 N5W 47 ks. 31.0'

Tam. 4 S62E 21 ks. 13.9'

ITASCA COUNTY HAS POSITION FOR THIS CORNER
FROM TRAVERSE AROUND SEC. 18

4 ~~V-5~~ R-5

Section Corner to Sections 19-20-29-30
Notes of Orig. Govt. survey 1893 (April)
Set wood post

Tam. 4 S88W 12 lks. 7.9' ✓
Fd. no evidence

1991 Tam. 6 N61E 20 lks. 13.2' ✓
Fd. Blk spruce windfall N61E 13.2 scribe visible

Tam. 8 N51W 49 lks. 32.3' ✓
Fd. no evidence

1991 Tam. 4 S75E 30 lks. 19.8' ✓
Rotted stump S75E @ 19.8 Placed 60d spike

NOTES BY J.A. GJELHAUG RLS 11-28-39

FOUND EVIDENCE OF ALL ORIG. BT'S.

SET 5" X 5" X 48" TAM. POST
NOW 6" BLK. SPRUCE
PUT FSLP'S ON SPRUCE 5" SIDE 14 LKS AND
NOW 7" BLK. SPRUCE
SPRUCE 6" S35W 9 LKS.

Fd. BASE OF GJELHAUG'S POST FROZEN IN SWAMP

Fd. FSLP'S ON SPRUCE DESCRIBED ABOVE - SNOW IS
VERY DEEP SO WE DON'T SEARCH VERY LONG FOR BT'S.
WILL SEARCH WHEN WE MONUMENT CORNER.

1-11-78 CRK

SET 3" X 6" TAM POST BESIDE POST POINT FOUND ^{Found} 1991

10/24/91 Orama, Notzka, Robertson

Found Gjelhaug's tags and post along with post point.
Post 5x5 + x? Decayed, scribe marks still visible.

10/24/91

Set a U.S.F.S 2 1/2" x 48" galv. iron pipe with
brass cap mkd. Brass cap set 10" above swamp
in place of old post point found. T 148 N R 29 W
8' steel sign post north 30' } Proper
8' steel sign post west 2.85' } Signs
Attached: 519 | 520
530 | 529

1991

Mkd. New BT's 0 RLS No 14677
Blk. spruce 7" S28W 6.26' Mkd 530 BT Gjelhaug's
TAG

Blk. Spruce 7" N59E 24.94' Mkd. 520 BT All BT's
60d spike
& Tags

Blk. Spruce 5" S54E 12.80' Mkd 529 BT

Blk. Spruce 5" N45W 22.30' Mkd 519 BT

Corner falls in a Blk. Spruce swamp.

5 T-5 ✓

Quarter Corner Bet. Sec's. 29-30

Notes of Orig. Govt. survey 1893

Set wood post

Spruce 12 N45E 12 lks. 7.9'

1991 - Fd. no evidence

Balsam 8 N42W 12 lks. 7.9'

1991 - Fd. no evidence

NOTES BY J.A. GJELHAUG RLS 11-27-39

Fd. WOOD POST AND BOTH ORIG. BT'S. DOWN AND ROTTEN

SET ASH POST 4"X4"X48" AND MARKED NEW BT'S.

BALSAM 8 S28W 8 LKS.

1991 - Fd as 15" Balsam wind fall

FSLP BIRCH 8 S71W 20 LKS

1991 - Fd no evidence. Falls in new spruce plantation

Fd. TOP 24" OF SQUARD ASH POST LEANING AGAINST

BALSAM BT - SKIDDER HAS RUN JUST TO NORTH

SIDE OF ABOVE BALSAM THIS AM AND DESTURBED

AREA - BELIEVE HE MAY HAVE KNOCKED DOWN

BIRCH BT - WHILE MAKING SKIDDING TRAIL

WILL SEARCH MORE WHEN WE MONUMENT CORNER

SET BALSAM PICKET AT CORNER LOCATION

1-10-78 CRK

PUT FSLP ON 6" ELM ON NORTH SIDE OF E-W WOODS RD.

992' SOUTH OF ABOVE 1/4 COR. - LINE BLAZED ALSO

OLD PROBABLY BY CCC'S.

10/25/91 BRAMA, Wotzka, Robertson Cloudy, 32°F At. snow

Found 1939 Balsam 15" "S3" scribe visible.

Tag found from Gjelhaug dated 11/28/39 8 lks N28E to 1/4 cor.

Found no evidence of old post.

Set a 2 1/2" X 36" galv. iron pipe (conc. filled)

with brass cap mkd. Brass cap set 1.0' above grd.

T148N R29W

8' steel sign post west 5.67' } Proper
8' steel sign post north 5.94' } Signs Attached

1991

New BT'S MKD According:

RLS 14677

Ash 10" N17E 32.37 60D spike

CEDAR 20" N69E 68.72' 60D spike

Aspen 5" S44E 21.34' 60D spike

6 V-5 V-5
Section Corner to Sections 29-30-31-32
Notes of Orig. Govt. survey 1893
Set wood post

Aspen 7 N22E 6 lks. 4.0'

1939-Fd. 16" Aspen N38E 13 lks.

Aspen 10 S60E 20 lks. 13.2'

1939-Fd 5" Aspen S44E 19 lks.

Aspen 8 S83W 19 lks. 12.5'

1991-Fd. no evidence

Aspen 10 N31W 17 lks. 11.2'

1991-Fd. no evidence

11/27/39 - H. Hoard found 2 orig. BT'S and
a good condition 4" x 4" x 48" wood post.

He mkd. two new BT'S.

Aspen 6" N44°W 15 lks. Placed poster

10/26/1991-Fd. no evidence. Area badly disturb by logging.

Aspen 10" N44E 11 lks

10/26/1991-Fd. no evidence. Area badly disturb by logging.

He placed a Poster (F.S.L.P.) on Aspen 8" N72E 21 lks.

10/26/91 Fd. very rusted F.S.L.P. laying on ground

near a very well rotted stump

Duff Johnson on 12/30/66 found a scribed
section corner stake, but found no metal tag
or bearing tree. He says "stake is probably
work of ecc days." (see his corner card) continue

Duff placed a metal tag on northeast
side of 5" aspen, N53E, ten feet to scribed stake

10/25/91 Brama, Watzka, Robertson.

Search for this corner. Found a old and rusty
sectional type F.S.L.P. with 1 nail hole
at base of a Ash windfall. Nail hole is in the
center of the tag but on one edge. Found no other
evidence.

10/26/91 Brama

Found a Alum. tag placed by D. Johnson on a
well rotted Aspen windfall. Tag says scribed
post N53E 10'. Found old red ribbon and
charred remains of wood at N53E 10' from
Aspen St.P. Fd. no post. This area has been
completely logged off about 15 years ago.

Fd. old rusty tag at N72E 13.86' from old ribbon.
laying on ground by very well rotted st.p.

Set a 2 1/2" x 48" galv. iron pipe with brass cap
mkd. Brass cap set 18" above ground. Placed
one round rock on SE side of pipe. T148N R29W
Placed 8' steel sign^{posts} north 5.4', S30 | S29
S53W 10'0 and N72E 13.86' as reference S31 | S32
objects. No trees to mkd. Old ecc tag 1991
laying at base of sign post N72E 13.86'. U.S.F.S.

Placed a F.S.L.P. on 2" Aspen S37W 3.85' from
corner. Other old rusty tag fd. on 10/25 is N85W 24.0'
Beaver pond 30' east of corner.

V-3
7 Quarter Corner Bet. Sec's. 30-31
Notes of Orig. Govt. survey 1893
Set wood post

Birch 10 North 2 lks. 1.3'

Basswood 14 S84E 9 lks. 5.9'

10/31/91 BRAMA, Wotzka, Robertson

Scaled off of aerial photo and looked for this corner. Found a county spruce plantation. The SW corner of this plantation is where this corner falls. Found 2 or 3 large white pine in a sheared wind row near search area. South of spruce plantation has been logged some also. Large basswood and elm stumps south of plantation, fd. no. corner evidence.

3/1/95 David B. Rose Jr.

Found a cedar post 4" x 3" above ground.

Post badly fire scared and rotten.

Found a W. Pine 22" N20E 32.5 lks from post. He states "Probably BT, fire burnt, scribing off".

8

X-5

Quarter Corner Bet. Sec's 30-32

Notes of Orig. Govt. survey 1893

Set wood post

Tam. 3 N37W 171ks. 11.2'
 10/29/91 Fd. remains of a stump N37W 11.2' Also found post point 3.5" diam by stp. 600 spike placed

Tam. 4 S35E 371ks. 24.4'

Fd no evidence

CCC's Hoard 11/27/39

Found old corner. BT gone

Placed posters on: Spruce 8" S20W 161ks. 19.6'

Spruce 5" N20E 391ks. 25.74'

1991 - Found TAM 7" N30E 25.74' with tags ^{2654'}
 Bearing from 1/4 to sec. cor. north is north 40.21 chgs

Duff Johnson

Found scribed stake. He placed a tag on 5"

Tam on the SW side. S20W, 391ks to a very
 old two sided stake. Hoard placed tag
 on same tree in 1939. ^{Painted} Blue line north + east

10/29/91 BRAMA 30°F Snow P.M.

By scaling off of photo walked into this
 corner and found Alum. tag by O. Johnson

12/14/66 on 7" TAM. Old rusty tag
 ON NE side of same tree. Duff's tag says
 S20W 391ks to scribe stake. This tam.
 has scar where scribe would be facing corner.

10/29/91 Found old post point at S20W 25.74'
 from tam. with tags well rotted top of
 post laying along side point. Placed 600 in point
 Fd. a windfall BIK Spruce 7" at S29W but
 no scar or tag.

MKd BT

TAM 7" N73E at 39.85 MKd. 1/4 S32 BT

This corner is 50' from high grd N70E and
 75' S20W to high grd. In small alder swamp.

10/30/91 BRAMA, Robertson, Bruce

Set a 2 1/2" x 48" galv. iron pipe with brass cap
 mkd. Brass cap set 16" above ground.

Monument was set where old ^{post} point. T148N R29W
 was found the day before. Placed 1/4 S31 S32
 old point on south side of monument

MKd. New BT'S:

W. OAK 14" N80W 83.98 MKd 1/4 S31 BT 600

Tam 13" N14W 69.88' MKd 1/4 S31 BT 600

8' steel sign posts north 5.53'

8' steel sign posts east 5.73'

9

V-7

Quarter Corner Bet. Sec's. 29-32
Notes of Orig. Govt. survey 1893

Set wood post

Cedar 10 N28W 8 lks. 5.3' Fd. beaver blaze on piece of wood
11/4/91 - Fd. large cedar stp. & windfall stub
Aspen 4 S42W 22 lks. 14.5'

No evidence

Duff Johnson found ^{18"} Cedar stub (4' high) northwest of stake ^{by} 3'. Found metal tag on the cedar stub. Found a scribed stake. He placed a metal corner tag on south side of 8" balsam, 6' south to old 2 sided stake. Blue line painted west & south (See corner card V-7)

10/30/91 BRAMA, Wotzka, Robertson

Fd. cedar stump and pieces of a 5" high stub laying on the ground. Fd. a small galv. nail in stub. Fd. old & rusty township tag laying near cedar stump. Found 22' long rotted post (2 flat sides) laying 4' east of stump. Appears that a skidder made a logging road right along side cedar stump. Old tag, top of post and cedar pieces were all laying in the same general area like they were push there. Fd. Duff's balsam as a stub. Fd. 1 nail in a piece of the balsam. Fd. no alum. tag at this time. (Duff's tag)

1-11-78 CK

Fd. CEDAR - DEAD - SCRIBE ROTTED OUT - TAKEN TO THIS TREE BY LOCAL LOGGER HERB KLASSEN

11/4/91 Krause & BRAMA

Fd. deep double hack marks on the inside of a piece of cedar from original cedar with blaze. Fd. remains of wood in discolorization of soil going down into the ground where old post stood. From well rotted post point to Cedar is N22W 5.3'.

Set a 2 1/2" x 48" galv. iron pipe with brass cap mkd. over old post point. Brass cap set 1' above ground.

Placed 8' steel signpost 4' west of ^{1/4} 529
" " " " " 4' south ^{proper signs at} 532
1991
USFS

Mkd. New BT's:

Ash 9" N88E 34.91' 1/4 532 BT 600

Ash 4" N8E 14.78' 1/4 529 BT 600

Ash 9" N16W ^{old} 40.40' 1/4 529 BT 600


Placed 2" x 2" Cedar post on north side of mon. Corner falls in NE corner of a spruce plantation. Old fire break & 4-wheeler trail goes next to corner

10

Quarter Corner Bet. Sec's. 8-17
Notes of Orig. Govt. survey 1893
Set wood post

J. Pine 6 N75W 15 lks. 9.9'

J. Pine 6 S88E 28 lks. 18.5'

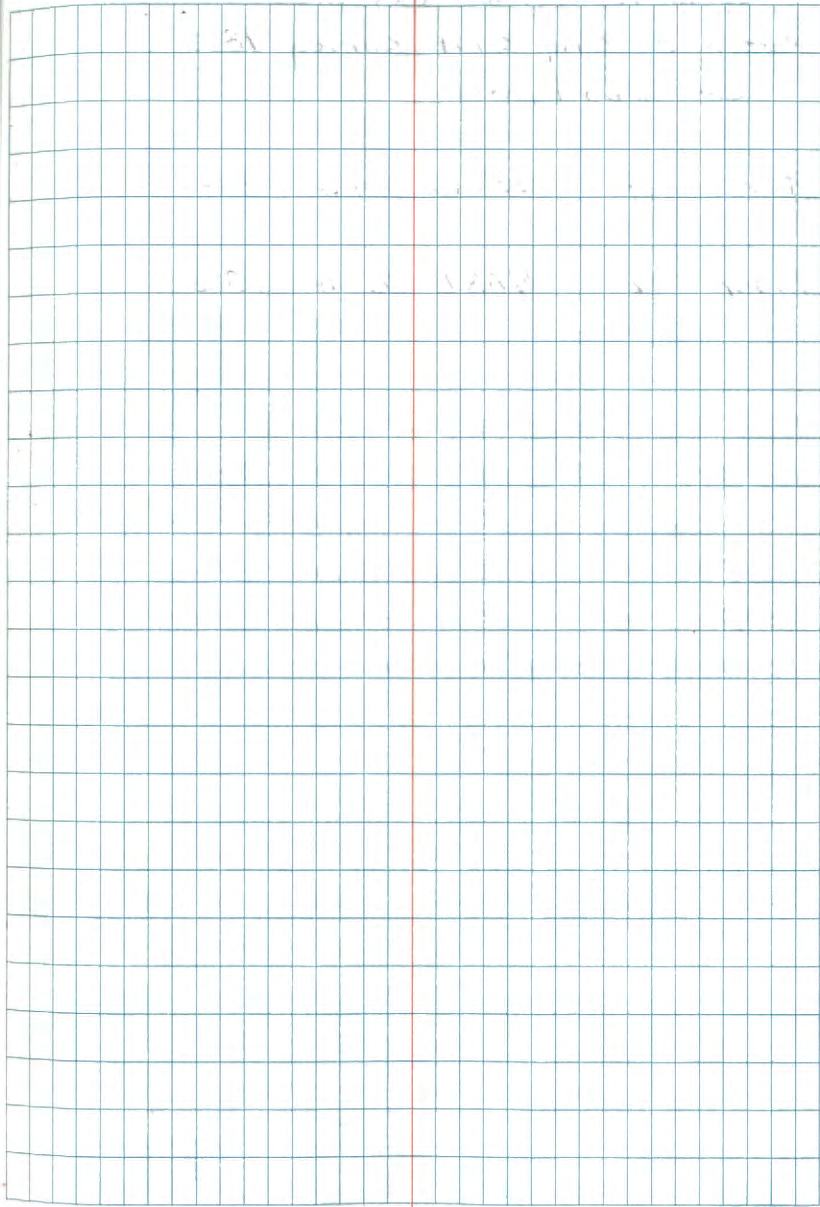

11

Quarter Corner Bet. Sec's. 5-8
Notes of Orig. Govt. survey 1893
Set wood post

Birch 3 S52W 4 lks. 2.6'

Aspen 6 N68E 16 lks. 10.6'

874 CCC NOTES BY H. HOARD 11-16-39

Fd. POST 50" HIGH - GOOD CONDITION

Fd. COUNTY BT'S. - SCRIBED 1/4 S8 BT

ASPEN 8 N35W 78 LKS. = 51.48'

ASPEN 6 S29W 84 LKS. = 55.14'

PLACED TAG ON 6" POST AT CORNER

12

Section Corner to Sections 4-5-8-9
Notes of Orig. Govt. Survey 1893
Set wood post

J. Pine 11 N75E 26 lks. 17.2'

N. Pine 6 S45W 52 lks. 34.3'

N. Pine 12 N78W 36 lks. 23.8'

N. Pine 9 S39E 27 lks. 17.8'

COUNTY ROAD SURVEY (NO DATE) PLAT ON RECORD
AT ITASCA COUNTY COURTHOUSE ROAD #149
TYPE OF MONUMENT NOT STATED

N. PINE 6 S45E 87.2'

N. PINE 8 S22W 49.3'

874 CCC NOTES BY H. HOARD 11-16-39

COR. IN CENTER OF ROAD

Fd. COUNTY B.T.S.

J. PINE 6 S40W 93 lks. = 61.38' NOW SWAG 2000

J. PINE 6 S51E 61 lks. = 40.26'

PLACED FSLP ON 6 POST AT COR.

11-5-76 CK

CHAINED DISTANCE FROM EAST E¹/₂ 2643.0'
W¹/₂ 2641.3' - TOTAL = 5284.3'

Fd. CCC CEDAR POST ON NORTH SIDE OF
E+W ROAD WITH SHOTUP TAG - PUT NEW
TAG ON BACK SIDE OF CEDAR POST
APPROX. SEC. COR. IS 18' SOUTH OF POST
SET SPIKE IN CENTER OF E+W ROAD AT
CHAINED DISTANCE FROM EAST 5284.3'

8-28-08 R. MAIN

Fd IRON IN CENTER OF FR 2201 AND GAS. ITASCA
COUNTY HAVE TIES TO THIS CORNER. CCC WOOD
POST NOW LAYING DOWN, IRON 1" DIA 4" UNDER ROAD

Co R. PINE 10" N E

Co R. PINE 11" N W

Co J. PINE 10" S E

NOW STANDING DEAD

13

Quarter Bet. Sec's. 4-5
Notes of Orig. Govt. Survey 1893
Set woodpost

Tam. 6 N73W 91ks. 5.9'

Tam. 3 S61E 61ks. 4.0'

81

14

Quarter Corner Bet. Sec's. 8-9
Notes of Orig. Govt. survey 1893
Set wood post

Aspen 7 S25W 9 lks. 5.9'

Aspen 6 S34E 18 lks. 11.9'

15 Section Corner to Sections 8-9-16-17
Set wood post

Tam. 9 S49E 331ks. 21.8'

Tam. 10 N34E 341ks. 22.4'

Aspen 5 N70W 601ks. 39.6'

Aspen 6 S43W 761ks. 50.2'

16

Quarter Corner Bet. Sec's. 16-17
Notes of Orig. Govt. survey 1893
Set wood post

Tam. 4 N21W 131ks. 8.6'

Tam. 5 N89E 401ks. 26.4'

17

Quarter Corner Bet. Sec's. 20-21
Notes of Orig. Govt. survey 1893
Set wood post

Tam. 4 N64E 191ks. 12.5'

Tam. 5 S72W 451ks. 29.7'

18

Quarter Corner Bet. Sec's. 16-21
Notes of Orig. Govt. Survey 1893
Set wood post

Tam. 6 S65W 301ks. 19.8'

Tam. 6 N28W 401ks. 26.4'

20

19 Section Corner to Sections 20-21-28-29

Notes of Orig. Govt. survey 1893

Set wood post

Spruce 3 S65E 96 lks. 63.4'

Spruce 2 N53W 40 lks. 26.4'

Spruce 2 1/2 N55E 27 lks. 17.8'

Tam. 3 S78W 65 lks. 42.9'

20

Quarter Corner Bet. Sec's. 15-16
Notes of Orig. Gov't. Survey 1893
Set wood post

Spruce 10 S19W 25 lks. 16.5'

Spruce 10 S50E 36 lks. 23.8'

21

21

Quarter Corner Bet. Sec's. 9-16
Notes of Orig. Govt. survey 1893
Set wood post

J. Pine 6 S33E 15 ks. 9.9'

Birch 7 N64W 20 ks. 13.2'

22

Quarter Corner Bet. Secs. 10-15
Notes of Orig. Govt. Survey 1893
Set wood post

Tam. 13 N9E 16 lks. 10.6'

Tam. 9 S29E 23 lks. 15.2'

SEE BOOK #1 PAGE 51

22

23

G-13

Quarter Corner Bet. Sec's. 9-10
Notes of Orig. Govt. Survey 1893
Set wood post

R. Elm 9 S22W 13 lks. 8.6'

Spruce 8 S89E 26 lks. 17.2'

NOTES ON 874 11-16-39, H. HOARD

FD. OR SET ASPEN POST 40" LONG - GOOD CONDITION

HOARD CALLED THESE COUNTY BT'S.

ELM 10 N73E ^{28.4'} 43 LKS. MKD 1/4 S10 BT

FD. 13 ELM WITH SCAR TO COR. N80E - 28.4' DEAD

OAK 12 S67W ^{27.7'} 42 LKS. MKD 1/4 S9 BT

FD. 18 OAK S74W 27.7' SCAR TO COR. GOOD CONDITION

11/4/76 CK

CHAINED SOUTH ALONG OLD SWAMP ROAD 2644' TO APPROX.
1/4 COR. LOCATION WHICH FALLS IN CENTER OF N-S ROAD
FOUND COUNTY BTE STATED BY HOARD
OLD FIELD TO SW - CUT OVER AREA TO NE-E-SE
NAIL TAGSON OLD BT'S.

2A

Quarter Corner Bet. Sec's. 4-9
Notes of Orig. Govt. Survey 1893
Set wood post

Spruce 6 S55W 10 lks. 6.6'

J. Pine 8 N83E 10 lks. 6.6'

COUNTY ROAD # 149 PLAT ON FILE IN COURTHOUSE

J. PINE 9 N9E 57.1

J. PINE 9 S16W 58.7'

May 27 1985 Itasca County Engineers Office
Replaced BTS: (Logger destroyed BTS)

J. PINE 18 N15° E(w) 31.04'

J. PINE 22 N25 E 36.19'

42

DISTANCE EAST OF SEC. COR. 4-5-8-9-2641.3'

DISTANCE WEST OF SEC. COR. 3-4-9-10-2643'

11-5-76 CK

CHAINED WEST FROM SEC. COR. 3-4-9-10

2643' W - SET SPIKE AT DISTANCE IN

CENTER OF E+W ROAD - Fd. CEDAR POST

BROKEN OFF LYING ON SOUTH SIDE OF ROAD

RESET 7" CEDAR POST SOUTH 23.5' FROM

SPIKE - PUT FSLP ON 13" J. PINE S9E

28.5' FROM SPIKE IN ROAD

25 E-13

AFFIDAVIT 7-12-79

Section Corner to Sections 3-4-9-10

Notes of Orig. Govt. survey 1893

Set wood post

Tam. 11 N44W 15 lks. 9.9'

Tam. 12 S39E 33 lks. 21.6'

Spruce 6 S42W 25 lks. 16.5'

Spruce 7 N66E 54 lks. 35.6'

Notes of County Road survey 19 Road #149

Plat is recorded at Hasca County Courthouse

Spruce 6 N64W 82.0'

Ed. spruce stp. $\frac{3}{4}$ 30" stub lying down mkd T148NR
at brq $\frac{3}{4}$ dist.Tam. 12 N55E 85.0' at brq $\frac{3}{4}$ dist.Ed Tam. stp. $\frac{3}{4}$ 30" stub lying down - no marks - has axe marks
on face

Spruce 6 S33E 64.3'

Ed. spruce stp. at brq $\frac{3}{4}$ dist.

Spruce 7 S42W 57.2'

Ed. spruce stp. at brq $\frac{3}{4}$ dist.Set 1 1/2" OD iron pipe - 4" below road surface to
mark corner location - monumentation should be
done as soon as frost is out 11-1-76 CRKTo perpetuate this corner I set 5 1/2" x 5 1/2" x 24" long
concrete monument - with 3" dia. brass tablet marked
6" below road surface T148NR29W

Iron pipe set beside monument

54	53
59	510

Witnessed by

1977
RLS WO

Tam. 9 N33E - 134.5' - mkd T148NR29W53BT

Tam. 16 S32E - 88.2' - " T148NR29W510BT

Tam. 9 S38W - 52.8' - " T148NR29W59BT

Tam. 9 N47W - 58.4' - " T148NR29W54BT

4-22-77 Curtis R. Krause

OK
ML
7/8/80

26

Quarter Corner Bet. Sec's. 3-10

Notes of Orig. Gov't. survey 1893

Set wood post

Tam. 8 N48E 231ks. 15.2'

Aspen 14 S79W 261ks. 17.2'

COUNTY ROAD #149 ON FILE AT COURTHOUSE.

SPRUCE 10 N49E 61.6'

POPPLE 24 S30W 52.5

DISTANCE EAST OF SECTION COR. 3-4-9-10-2642'

DISTANCE WEST OF SECTION COR. 2-3-10-11-2637.9'

27

Quarter Corner Bet. Sec's. 3-4

Notes of Orig. Govt. survey 1893

Set wood post

Tam. 9 S38W 141ks. 9.2'

Tam. 8 N62E 261ks. 17.2'

2003 ITASCA COUNTY
CORNER CERT

28

Section Corner to Sec's. 34-35 S. Bdry

Notes of Orig. Govt. Survey 18⁷⁵

Set wood post

Fir 10 N42E 5 ks. 3.3'

Fir 10 N35W 8 ks. 5.3'

Fir 10 S89W 10 ks. 6.6'

Fir 10 S27E 5 ks. 3.3'

see Book # 2
Page # 12
T147N R29W

29

29

Quarter Corner Bet. Sec's. 35-2 S. Bdry
Notes of Orig Gov't survey 1875
Set wood post

Pine 10 NSW 34 lks. 22.4'

Pine 10 S78W 27 lks. 17.8'

IN BK[#] 2 PAGE[#] 10 T147 R29

15

30

Section Corner to Sections 1-2-35-36 S. Bdry.
Notes of Orig. Govt. Survey 1875

Set wood post

Tam. 5 N21E 161ks. 10.6'

Tam. 5 N3W 331ks. 21.8'

Tam. 5 S35W 201ks. 13.2'

Tam. 5 S44E 371ks. 24.4'

Hasca County Road Survey 1922

Set wood post

Tam. 3 N58W 53.4'

Spruce 5 S28W 72.95'

Tam. 5 S56E 61.75'

Spruce 6 N45E 65.1'

31 X-1 AFFIDAVIT 7-12-79

QUARTER CORNER BETWEEN SEC'S. 31-36

NOTES OF ORIGINAL GOV'T. SURVEY 1874

SET WOOD POST FD. HOLE IN GROUND AND ROTTED
WOOD PROBABLY GJELHAUG'S POST SET IN 1939

W. PINE 14 S 6 E 22 LKS. 14.5'

NOW 21" W. PINE S 6 E 21 LKS. SCRIBED 1/4 S 31 BT

W. PINE 18 N 20 W 32 LKS. 21.1'

NO EVIDENCE OF THIS STUMP REMAINS AT BR. 3rd DIST.
AREA HAS BEEN DESTROYED BY LOGGING YEARS AGO

NOTES BY J. A. GJELHAUG RLS 11-14-39

FD. W. PINE 18 S 6 E 21 LKS. WITH SCRIBE BT VISIBLE

FD. WELL ROTTED AND BURNED PINE STUMP N 20 W 32 LKS.

SET 3" X 3" X 60" MAPLE POST AT CORNER LOCATION

PLACED FSLP ON W. PINE BT

FD. 21" W. PINE S 6 E 14.2' FROM HOLE IN GROUND AND
ROTTED WOOD FROM POST SET BY GJELHAUG

W. PINE HAS SCRIBE 1/4 S 31 BT VISIBLE - FSLP DATED
11-14-39 ON NORTH SIDE

NO EVIDENCE OF NW BT - AREA AROUND CORNER HAS
BEEN LOGGED BY SKIDDER AS THERE ARE TREES AND
STUMPS PUSHED UP AND DEEP RUTTS CUT INTO
GROUND - BRUSH IS VERY THICK AROUND CORNER AND
ONLY ASPEN STANDING TO NW - W - SW OF CORNER
A FEW SCATTERED W. OAK AND ELM STAND IN THE
BRUSH AND ASPEN - LINES RUN EAST AND NORTH FROM
THIS CORNER

1-10-77 Curtis R. Krause

REFER TO BK#2 T148 R30 Pg#20

W. PINE BT HAS BEEN CHOPPED INTO ON NW SIDE AND
BELIEVE OLD SCRIBE MAY HAVE BEEN CHOPPED OUT
OR ROTTED AWAY - PART OF BASE BLAZE IS VISIBLE
GJELHAUG MUST HAVE RESCRIBED W. PINE AS
WE FOUND SCRIBE 1/4 S 31 BT THIS WOULDNT BE
ORIG. SCRIBE

9-15-78 CRK

TO PERPETUATE THIS CORNER SET 2" DIA. X 5' LONG GALVANIZED
STEEL PIPE, WITH CONCRETE INSIDE AND CAPPED WITH 3" DIA.

BRASS TABLET MARKED

T148N
R30W 1/4 R29W

SET IN HOLE AND BY DISTANCE

FROM W. PINE BT

S36 | S31

WITNESSED BY

1978
RLS NO 12261

W. OAK 4 N 62 W 53.45' NOT MKD NAIL ON SOUTH SIDE

W. OAK 5 S 23 W 44.68' NOT MKD NAIL ON WEST SIDE

ELM 8 S 44 W 21.68 MKD 1/4 S 36 BT

W. PINE

MKD 1/4 S 36 BT

8" STEEL POST SET DUE NORTH 3.7' BOTH SIGNS.

9-15-78

Curtis R. Krause

CORNER IS 2.50' EAST OF FOREST ROAD

FSLP ON 8" ASPEN STUB EAST SIDE OF ROAD

DIDNT SCRIBE OAK AS THEY ARE SMALL TREES AND
DONT WANT KILL THEM AS THEY ARE THE ONLY GOOD
BT'S AVAILABLE NEAR CORNER

SET IRON AT SPLIT OF 21' 22 LKS. OR 14.2' AS THIS IS

POINT COMMON TO BOTH DISTANCES - THIS WOULD ALSO
FIT ORIG. TIE IF LOWER OLD BLAZE WAS USED

32

CLOSING CORNER BETWEEN SECTIONS 3-4

NOTES OF ~~ORINA~~ ORIGINAL GOV'T. SURVEY 1893

SET POST

ELM 6 S75W 19 LKS.

ELM 7 S17E 7 LKS.

INTERSECT NORTH BOUNDRY OF TOWNSHIP
^{1075.8'}
16.30 CHS. EAST OF STANDARD CORNER
TO SEC'S. 33-34

33

CLOSING CORNER BET. SEC'S. 4-5

NOTES OF ORIGINAL GOVT. SURVEY 1893

SET WOOD POST

TAM. 6 S54E 18 LKS.

TAM. 8 S69W 12 LKS.

INTERSECT NORTH BOUNDARY OF TOWNSHIP
^{1092.3'}
16.55 CHS. EAST OF STANDARD CORNER
TO SEC'S. 32-33

34

WEST 1116 BETWEEN SEC'S. 24-25
SURVEY BY P. C. WARNER 1927- PLAT ON
FILE AT ITASCA COUNTY COURTHOUSE

SET IRON PIPE

NO BEARING TREES

9-26-05 R MAIN

FD COUNTY IRON 2" BELOW GROUND AND
IN PLACE. GPS ED LOCATION.

4-5-06 R MAIN

LINE TO STANDARD NORTH AND WEST
WITNESS WITH:

R PINE 15" N30W 41.39 FT TO SPK MKD: S24BT

R PINE 10" N61°W 45.10 FT TO SPK MKD: S24BT

8 FT STEEL SIGN POSTS 3.95 NORTH 3.95 WEST

SECTION CORNER TO SECTIONS 7, 12, 13 & 18

NOTES OF ORIGINAL GOV'T SURVEY 1873

SET WOOD POST

JACK PINE 8 S25W 13 LKS.

JACK PINE 6 S30E 60 LKS.

JACK PINE 8 N78W 6 LKS.

TAM. 12 N57E 80 LKS.

PLAT OF THIRD RIVER ROAD SURVEY 1915 BY L.W. JOHNSON

MARKED NEW BT'S.

SPRUCE 5 N49 $\frac{1}{2}$ W 70.4'

JACK PINE 5 N88W 39.5'

CEDAR 15 N10 $\frac{1}{2}$ E 132.3'

7/25/79

CERTIFICATE OF SURVEY BY STATE OF MINN.
 SET BY PROPORTIONATE MEASURE BETWEEN
 QUARTER CORNERS NORTH 2605.97' or South 2667.76'
 SET 3/4" X 24" IRON ROD

WITNESSED BY

QUAD MAPLE 4" to 6" WESTERLY 65.96 DNR NAIL COB
 POWER POLE SW 64.08 " " "

SPRUCE 14 SE 47.31 " " "

ELM 8 EASTERLY 54.37' " " "

TRIPLE ELM 6 to 9 NE 65.03' " " "

LOCATE CENTER OF A 17" CEDAR STUMP N17E
 133.22' FROM IRON

5/23/75 CK

CHAINED SOUTH FROM ^{-2606'} 1/4 COR. BET. SEC'S. 7+12

FD. CEDAR STUMP - MARKS VISIBLE N5E
 132.2' FROM OUR CHAINED DISTANCE

CONTINUED LINE SOUTH TO 1/4 BET. SEC'S.

13-18 - 2668' - OTHER BT'S. IN POWER LINE

CLEARING TO WEST - PIECES OF JACK PINE STUMP
 IN AREA OF N84W - 39.5'

SECTION CORNERS OF SECTIONS 1-6-7+12

NOTES OF ORIG. GOVT. SURVEY 1873

SET WOOD POST

TAM. 12 N65W 8 LKS. =

TAM. 12 S75W 18 LKS. =

TAM. 10 N50E 28 LKS. =

TAM. 8 S50E 19 LKS. =

NOTE: SEE BOOK #2 T148NR28W
FOR SEARCH INFORMATION

QUARTER CORNER BETWEEN SEC'S. 1+6
 NOTES OF ORIG. GOVT. SURVEY 1873
 SET WOOD POST

SPRUCE 6 S10W 18 LKS. = 11.9'

SPRUCE 4 S30E 11 LKS. = 7.3'

NOTES OF RETRACEMENT OF LINE BETWEEN
 SECTIONS 1+6 BY GEORGE RALPH 1896
 FOUND OLD CORNER AT A BEARING OF N50W
 A DISTANCE OF 39.97 CHS. OR 2638.02'

12-12-91 CK-68

Fd. (BELIEVE) ITASCA COUNTY IRON + ALUM CAP MKP.

Fd. SPRUCE STP. 9" N64E 15.4' SCRIBE BT

Fd. SPRUCE STP. 8" N54W 15.8' SCRIBE BT

PLACE FSLP ON 7" BLK. SPRUCE N14E - 12.5' FROM IRON

IRON HAS BEEN BENT - PROBABLY LOGGED OVER IN

WINTER AND HIT BY SKIDDER

FALLS IN OPEN SPRUCE CUTOVER SWAMP (2' TO 4' SPRUCE)

PLACE 60° SPIKES AT FACE OF STUMPS

MONUMENT BENT 12" HIGH - 24" IN SWAMP

IRON IS 1" ID X 36" LONG

LINE AT N2E FELL 110' N88W FROM END CHAIN
 DISTANCE CHAINED FROM P. OF CO. PT. #32 - 2638'
 THIS WOULD CHECK GOOD WITH ORIGINAL

NOTES RECEIVED FROM ITASCA COUNTY 12-19-91

5-1-72 E. PELOQUIN

Fd. UNRECORDED SCRIBED SPRUCE AND POINT
 OF 2" STAKE

SET COUNTY IRON WITH CAP

Fd. BT SPRUCE 7 N43E 15.02'

NEW BT SPRUCE 5 N73W 16.03'

CLOSING CORNER OF SECTION 1+6

NOTES OF ORIG. GOVT. SURVEY 1873

SET WOOD POST

SPRUCE 6 S39W 27 LKS. = 17.82'

SPRUCE 4 S15E 16 LKS. = 10.56'

NOTES OF RETRACEMENT SURVEY OF LINE

BET. SEC'S. 1+6 BY GEORGE RALPH 1896

FOUND OLD CORNER AT A BEARING OF N5°W

AT A DISTANCE OF 78.40 CHS. OR 5174.4'

4.00 CHS. OR 264' EAST OF STANDARD COR.

TO SEC'S. 31+36

874 CCC NOTES BY L.G. MCEACHIN 2-23-35

NO POST FOUND - RESET 2 1/2" x 14" SPRUCE

HUB FROM BT

FOUND SPRUCE 8 S45E 16 LKS.

PLACED FSLP ON 8" SPRUCE ON EAST SIDE

CORNER BEARS N80E 20 LKS. = 13.20'

12-12-91 6B-CK

FROM IRON FOUND AT 1/4 COR. RAN LINE AT DUE NORTH

AND CHAINED 2536' - PLACE FSLP ON 7" BLK. SPRUCE

ON SOUTH SIDE AS APPROX. CC BET. SEC'S 1+6

APPROX. COR. IS IN SPRUCE SW. - SMALLER SPRUCE

TO EAST AND SOUTH

NO OTHER EVIDENCE FOUND

MEASURE WEST 264' TO STD. COR. TO SEC'S. 31+36

7/30/92 Krause & Brama

Searched with 2 metal detectors for old
ccc poster. Found no evidence of this corner

position. East and west of the approx.

position has been log years ago. Some old
standing spruce in the area.

Search between closing for 1/6 and
std. for sections 36/31.

TAGS STILL THE SAME AS IN 1990 CK

QUARTER CORNER BET. SEC'S 7 & 12

NOTES OF ORIG. GOV'T. SURVEY 1874

SET WOOD POST

TAM. 10 S87W 12 LKS. = 7.92'

TAM. 8 N63E 4 LKS. = 2.64'

NORTH BET. SEC'S. 7 & 12

11.00 CHS. LV. LAKE SET MC

21.00 " ENT. TAM. SWP.

40.00 " 1/4 COR.

62.00 " ENT. RIDGE

80.00 " SEC. COR.

CORNER TO SECTIONS 1-6-7-12

NOTES OF ORIG. GOV'T. SURVEY 1874

SET WOOD POST

SPRUCE 12 N12E 35 LKS. = 23.10'

POPLAR 7 N34W 21 LKS. = 13.86'

TAM. 7 S64W 15 LKS. = 9.90'

TAM. 8 S65E 43 LKS. = 28.38'

NOTES FROM ITASCA COUNTY (6-4-97 REC'D)
 COUNTY TRAVERSED FROM 1/4 7-12 NORTH
 TO CLOSING CORNER BET. SEC'S. 1+6

SET COUNTY MONUMENT IN CENTER LINE
 OF E+W ROAD COUNTY 28 AND CENTER LINE
 OF FR 2203 TO NORTH

MARKED BT'S. OCT. 4 1991

BALSAM	9"	S81E	81.60'	MKD. S7 BT	GONE
ASPEN	7"	N43E	97.10'		S6 BT
TW. W. OAK	7 1/2"	N62W	144.32'		S1 BT
P. POLE		N58E	68.06'		SPK. OK ^{RM} 2008

CAP MKD
 T14BN
 R30W R29W
 S1 | S6
 S7 | S7
 1995
 RLS 14677

NAD 83 ST. PLAN
 N 753120
 E 2300116 + 3 METERS

9-3-2008 R. MAIN

GPS IRON CAP @ ROAD SURFACE
~~CO BALSAM BT IS GONE~~. CO ASPEN NOW 12"
 CO W. OAK IS NOW 9". I FIND A W. SPRUCE 13"
 @ N18°W 87.66 FT ADDED BY ITASCA CO
 IN 2005

QUARTER CORNER BET. SEC'S. 1+6

NOTES OF ORIG. GOV'T. SURVEY 1874

SET WOOD POST

J. PINE 7 N64W 5 LKS. = 330'

J. PINE 10 N43E 14 LKS. = 9.24'

RECORDED COUNTY MONUMENT IN
T 148 R 30 BK 1 PG 13

NORTH BET. SEC'S. 1+6

37.00 CHS. ENT. N. PINE RIDGE

40.00 " 1/4 COR.

81.90 " CLOSING COR.

CLOSING CORNER BET. SEC'S. 1+6

NOTES OF ORIG. GOV'T. SURVEY 1874

SET WOOD POST

J. PINE 7 S70W 48 LKS. = 31.68'

J. PINE 10 S15E 48 LKS. = 31.68'

BELT. COUNTY ROAD SURVEY 1914 - By C.C. SPENCER

FIELD BOOK #26

NE CORNER SEC. 1

FD. GOV'T. POST + GOV'T. BT

J. PINE S15E 31.6'

MARKED NEW BT'S.

W. PINE STUMP 12 N27W 66.8'

W. PINE STUMP 12 S48W 76.8'

9-03-2008 R. MAIN

FD ITASCA COUNTY MONUMENT 6' UNDER Co Rd #32

6 FT NORTH OF Q. MONUMENT IS ALSO ± 24 FT WEST
OF FR 2203. ALONE CO BT

Co R PINE	13"	S18°W	47.54 FT	SPK WISHER TAG
Co R PINE	5"	S68E	88.95'	"
Co J PINE	12½"	N34°W	55.31'	"

INTERSECT 12th STANDARD PARALLEL

435 LKS. = 287.1' = EAST OF STANDARD COR.

41.90 CHS. = 2765.4' NORTH OF 1/4 COR.

ITASCA COUNTY
T410N
Co IRON MKD. 0
3" CAP R30WS 1 | S6R29W
1995
RLS 14677

QUARTER CORNER, BET. SEC'S, 28+33

ORIG. GOVT. SURVEY 1873

SET WOOD POST

J. PINE 7 S20W 222 LKS. = 146.52'

J. PINE 8 N22W 227 LKS. = 149.82'

44

QUARTER CORNER BET. SEC'S. 32+33

ORIG. GOV'T. SURVEY 1875

SET WOOD POST

TAM. 4 S40W 41 LKS = 27.06'

TAM. 4 N6W 13 LKS = 8.58'

44

45

CORNER TO SECTIONS 28-29-32-33

ORIG. GOV'T. SURVEY 1873

SET WOOD POST

ASPEN 8 S70E 117 LKS = 77.22'

ASPEN 8 S29E 128 LKS = 84.48'

NO OTHERS NEAR

45

46

QUARTER CORNER BET. SECS. 28+29
ORIG. GOV'T. SURVEY 1878
SET WOOD POST

TAM. 3 S58W 23 LKS = 15.18'

TAM. 3 N82E 34 LKS = 22.44'

46

QUARTER CORNER BET. SEC'S. 20+29

ORIG. GOV'T. SURVEY 1879

SET WOOD POST

TAM. 3 S25W 25 1/2 LKS. = 16.83'

TAM. 8 N12W 20 LKS. = 13.20'

QUARTER CORNER BET. SEC'S. 17 & 18
 ORIG. GOVT. SURVEY 1873
 SET WOOD POST

N. PINE 14 N50W 10 LKS. = 6.60'

N. PINE 10 N10E 14 LKS. = 9.24'

10- -05 R MAIN

GPS IRON. CLEARCUT ALL AROUND MONUMENT.
 FJ TWO J. PINE BTB NEAR IRON BOTH SNAGS.

49

MEANDER CORNER BET. SECS 7 + 18
ON WEST SHORE OF DECKER LAKE
ORIG. GOV'T. SURVEY 1873

ASPEN 7 S58W 13 LKS. = 8.58'

ASPEN 7 N83W 12 LKS. = 7.92'

49

MEANDER CORNER BET. SEC'S, 7 & 18
ON EAST SHORE OF DECKER LAKE
ORIG. GOV'T. SURVEY 1873
SET WOOD POST

ASPEN 6 S50E 25 LKS = 16.90'

ASPEN 6 N59E 46 LKS = 30.36'

MEANDER CORNER BET. SEC'S. 7+18
ON EAST SHORE OF COLEMAN LAKE
ORIG. GOV'T. SURVEY 1873
SET WOOD POST

BIRCH 8 N70E 62 LKS. = 40.92'

BIRCH 6 S55E 35 LKS. = 23.10'

9-22-08 R. MAIN

FDITASCA CO IRON 1 1/2" IP WITH 2" ALUM CAP
UP 102' STAMPED: T148N

V 715
M 1815
R2AW
1976

GPS MONUMENT ADD ONE BT

W. PINE 5" S50°E 15.82 FT TO SPK NOT SCRIBED TAGS

CO R. PINE 10" S19°W 39.50 FT SPK & WASHER TAGS

CO BIRCH NOW DEAD 10" X 20 FT TAIL SNAG

52

MEANDER CORNER BET. SEC'S. 25+36
ON WEST SHORE OF DIXON LAKE
ORIG. GOV'T. SURVEY 1873
SET WOOD POST

ASPEN 6 S70W 20 LKS = 13.20'

ASPEN 6 N45W 35 LKS = 23.10'

52

SOUTH QUARTER TO SECTION 34

ORIG. GOV'T. SURVEY 1875

SET WOOD POST

TAM. 4 N10W 19 LKS. = 12.54'

TAM. 4 S42E 6 LKS. = 3.96'

CORNER TO SECTIONS 3-4-33-34

ORIG. GOV'T. SURVEY 1875

SET WOOD POST

POPLAR 3 N87W 21 LKS. = 13.86'

POPLAR 3 S1½W 15 LKS. = 9.90'

POPLAR 3 S27E 19 LKS. = 12.54'

NO OTHER

SOUTH QUARTER COR TO SECTION 33

ORIG. GOV'T SURVEY 1875

SET WOOD POST

TAM. 8 S30W 5 LKS. = 3.30'

CEDAR 4 N20E 3 LKS. = 1.98'

56

SOUTH QUARTER CORNER TO SECTION 31

ORIG. GOVT. SURVEY 1875

SET WOOD POST

TAM. 5 N34E 11 LKS. = 7.26'

TAM. 4 S55W 4 LKS. = 2.64'

56

1975-1976 MILO STEFAN

PLAT OF SECTION 18. SET 2" X 5' GALV PIPE
 FILLED W/ CONCRETE & 3" BRASS CAP.

R. PINE

R. PINE

J. PINE 7" S75°W 64.3 FT (STANDING DEAD)
 2008

9-16-2008 R MAIN

FD IRON ± 20 FT NORTHWEST OF FR 3783.

" WILDLIFE OPENING " EAST AND SOUTH OF IRON

8 FT STEEL SIGN POSTS 3.45 FT EAST AND
 3.45 FT NORTH. DIST TO C OF POST.

GDS IRON. MONUMENT MFD: T148N R29W

FD ZBTS 9-1-76 BY CK J. PINE IS

STANDING DEAD

∞ LOT 4 | LOT 3
 ∞ LOT 5 | LOT 6
 1976
 RLS. NO. 12261

R PINE 16" S14°W 102.23 FT

R PINE 14" S33E 103.58 FT

END OF
 NOTES

BOOK 2