

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 31, Township 142, Range 30, 5th P.M.

STATE OF MINNESOTA, County of CASS


At the corner location shown on the sketch:

On 3/12/81 found a GLO brass cap monument as set in 1917.
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES

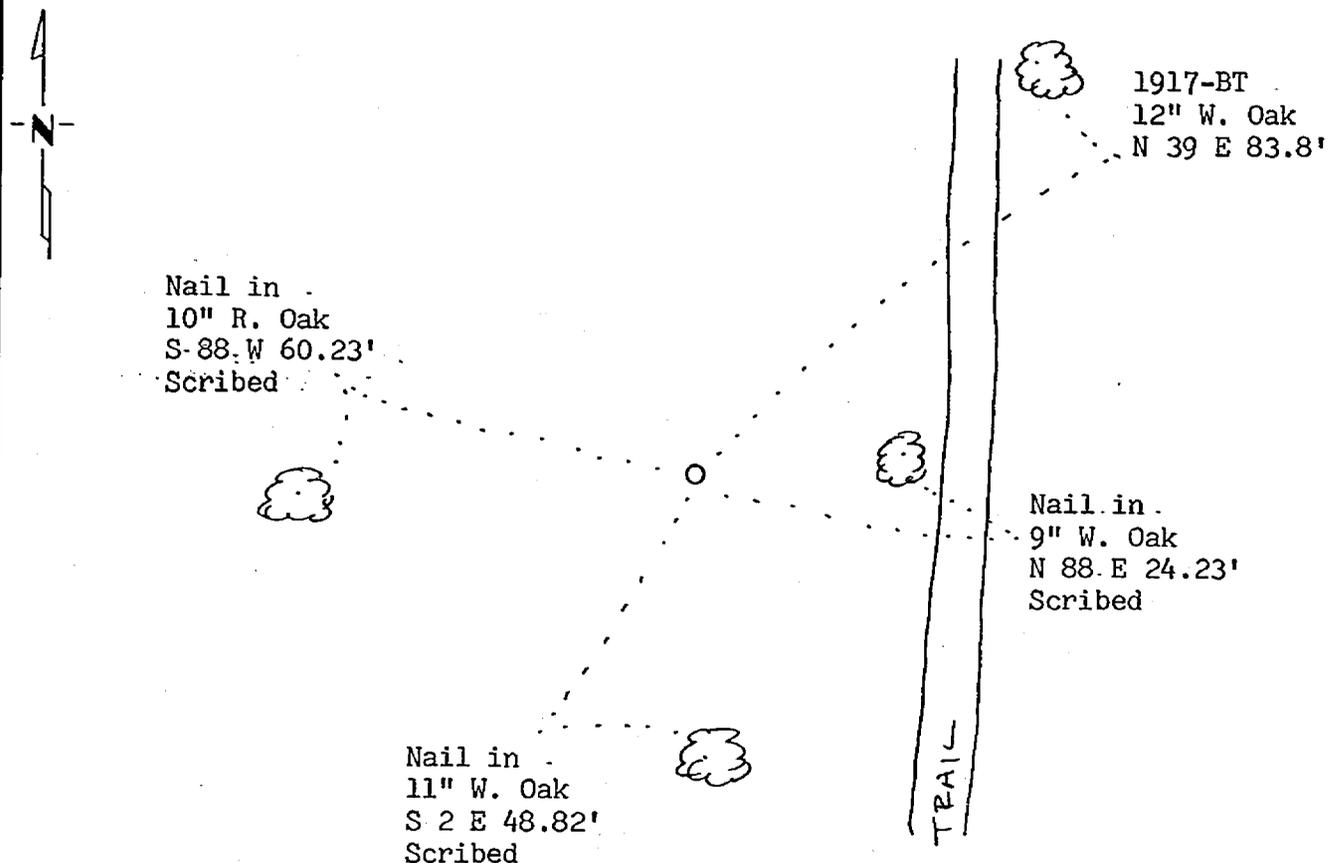

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary H. Stevenson 9-15-82
SIGNATURE DATE

Registration No. 12684

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

265257
 OFFICE OF THE COUNTY RECORDER
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 10:10 A.M. on the 29 day of Sept. A.D., 1982

County Recorder Buriah Hendrich

By MS County Recorder Deputy

DOCUMENT NO. 265257

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 18" W. Pine N $73\frac{1}{2}$ W 51 links and 30" W. Pine N 15 E 95 links.
- 1917 U.S. General Land Office dependent resurvey reestablished this corner by proportionate distance. No evidence was found of the original corner or bearing trees. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 6" W. Oak N $38\frac{1}{2}$ E 127 links and 6" W. Oak S 62 W 169 links.
- 1964 U.S. Forest Service records show the following: L. Gardner found the GLO brass cap monument.
- 1981 U.S. Forest Service technician W. Olson found the corner monumented with a GLO brass cap monument in good condition up 1.2'. The following bearing trees were found: None. Three new bearing trees were marked and are shown on this certificate. Steel sign posts were set 4.0' north and 4.0' west of the corner. Corner is 30' west of north-south trail.
- 1982 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1982 On Sept. 9 I visited the corner and found items as per the 1981 USFS reports. Found 1917 bearing tree 12" W. Oak N 39 E 83.8' alive. Oak was cut open and negative scribe marks found plain. Accepted corner as marking the same position as when set in 1917 based on bearing tree found. No evidence found of the other bearing tree.