

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East 1/4 Corner of Section 19, Township 144N, Range 25W, 5th P.M.


STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 10-12-1984 placed a 2 1/2" (O.D.) X 5 feet long galvanized iron
DATE pipe with 3" brass cap. Up 1.5 feet

5° East declination

SKETCH OF REFERENCE TIES
Not to Scale

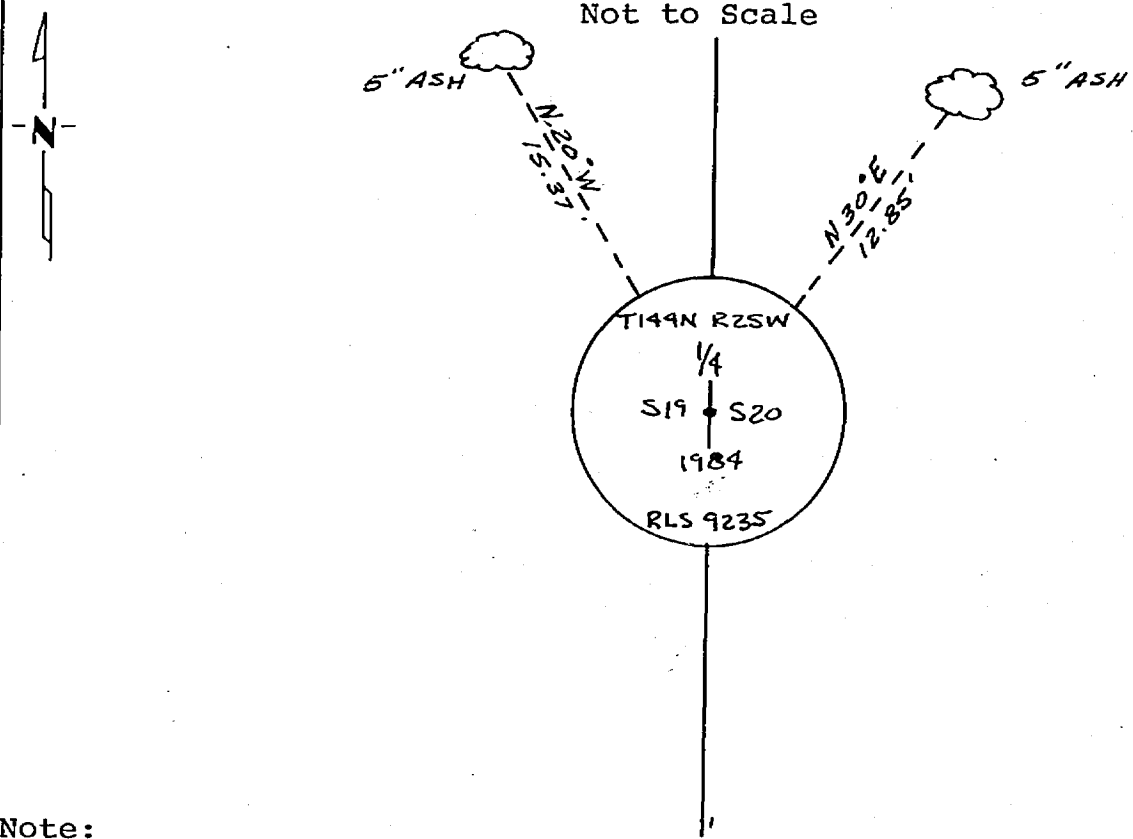

Note:

Trees are blazed & scribed with B.T. tags.
Distances shown are to a 20^d nail in notch
painted red on side of tree.

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

James H. Parker 3/29/85
SIGNATURE DATE

Registration No. 9235
 Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

281949
OFFICE OF THE COUNTY RECORDER
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:20 A .M. on the 15 day of May A.D., 1985

County Recorder Cherline Keyser
By ms, Deputy

DOCUMENT NO. 281949

Statement of Evidence:

P5

This corner was originally established in April, 1876, by B.C. Baldwin, Deputy Surveyor. The field notes of that survey are filed in the office of the Secretary of State, St. Paul, Minnesota. Mr. Baldwin's notes state that a post was set to mark the corner and referenced by the following:

A 14" Cedar that bears N24°W a distance of 8 links [5.28 feet]

A 9" Cedar that bears S78°E a distance of 11 links [7.26 feet]

On June 28, 1984, personnel from Advance Surveying & Engineering Co. made a thorough search for this corner and the above mentioned references but to no avail. This search area is now mixed hardwoods. The Cedar has all been logged off as evidenced by the remaining stumps

On October 12, 1984, an additional search was made by Advance prior to reestablishing this corner at its "lost" position half way and on line between adjacent section corners and as shown on the sketch.