

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 14
Township 138 N, Range 31 W, 5th P.M.
STATE OF MINNESOTA, COUNTY OF Cass



A000599918

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

1/27/2014 10:38:29 AM

AS DOC #: A000599918

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY SR Dep

Page 1 of 2 A000599918



On 11/20/2012, found a(n): 2 1/2" Capped Iron Pipe Laying Horizontal 0.6' Under Swamp Surface, Also Found Rotted Wood Remains Next to Pipe. Set Pipe Vertical up 0.3' at Base Position.

- left monument as found
- lowered monument
- removed monument (explain)
- raised monument

On _____, set a(n): _____

See "Statement of Evidence" for further details (on back)

(reserved for recording data)

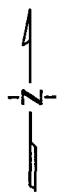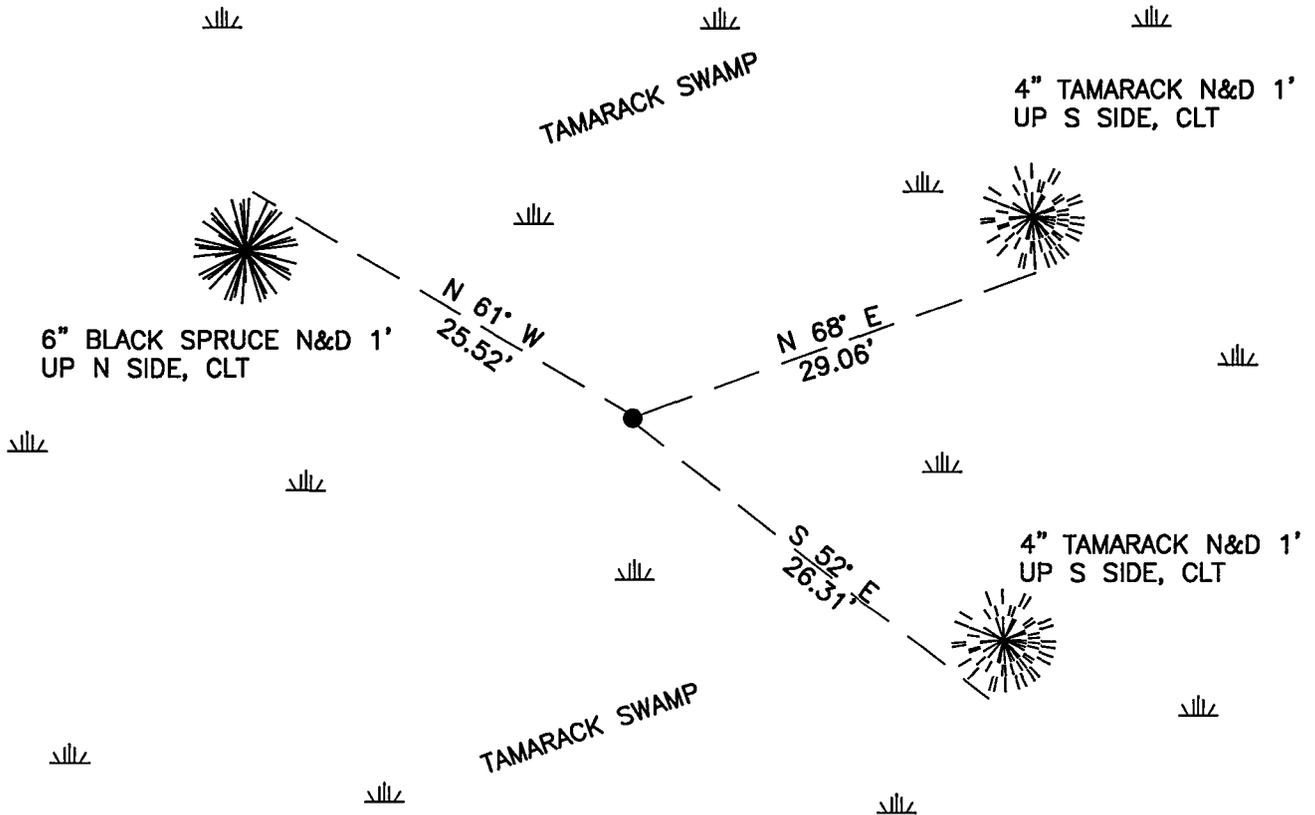

"SKETCH OF REFERENCE TIES"
(not to scale - bearings are magnetic)

Ties are measured to center of monument unless otherwise noted.

UNITS = Metric English

CASS COUNTY SOUTH COORDINATES

Northing: 326233.860

Easting: 477742.491

NAD 83/2007 Adjustment.

Obtained by RTK GPS observations.

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision, and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

signature
Jarrett M. Leas, Minnesota License No. 42619

2-1-13
date



Statement of Evidence

Northeast corner Section 14, Township 138 North, Range 31 West, 5th Principal Meridian.

- Nov. T.B.Walker, GLO Deputy Surveyor, in the notes of the subdivision of Township 138 North, Range 31 West
1870 set a post for the original corner and referenced it as follows:
8" Tamarac N 68 1/2° W 6 links (3.96 feet) 12" Tamarac S 26 1/2° W 23 links (15.18 feet)
8" Tamarac S 67° E 20 links (13.20 feet)
Said records are on file at the Minnesota Historical Society, St. Paul, Minnesota, copies are filed with the
Cass County Surveyor's Office (CCSO).
- Oct. J.H.Flynn, Cass County Surveyor, Survey Record 419, Book C, page 191, on file in the CCSO, states
1919 "cor. to sec's 11,12,13 and 14 said town, which was:
Tam 8 N 68 W 6 links
Tam 8 S 67 E 20 links
Tam 12 S 26 W 23 links
Now is:
Tam 8 (dead) S 67 E 13' 2" ft.
Tam 12 (stump with marks) S 26 W 15' 2" ft.
Established new brgs. To wit:
Tam 5 S 28 E 28' 2" ft.
Tam 8 S 83 1/2 E 24' 2" ft.
Tam 6 N 45 E 40' 5" ft
Spruce 7 N 33 1/2 W 36' 6" ft.
I also put down an Iron Mon. here 2 by 1/2" by 30". The Pictorial on page 193 indicates a 2 1/2 x 30" I.M.
- Feb. C.J.Bark, County Ditch No. 16, Book 97, Shelf 2, page 25, on file in the CCSO, indicates Iron Pipe (Sec
1922 Cor.) 204.7 feet East of North to South line, page 36, indicates Iron Pipe 21.6 feet, 70° 50' Northeast from
Station 2+00 on West to East Line from Sta. 106+48.0 on North & South Random.
- Oct. A KLJ survey crew found a 2 1/2" Iron Pipe, and is witnessed with the ties shown on the front of this
2012 certificate. Jarrett Leas, RLS #42619, after analysis of record and survey information accepts this
monument as the correct perpetuation of the corner