



A000601097

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

3/20/2014 11:04:11 AM

AS DOC #: A000601097

PAGES: 3

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY SR Dep

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Standard Southeast Corner of Section 32
Township 145 N , Range 27 W , 5th P.M.
STATE OF MINNESOTA, COUNTY OF CASS



On 05/19/2010 , found a(n): 5.5" Concrete Cylinder Monument
With A 3" Brass Tablet, 8" Above Ground

- left monument as found
- lowered monument
- removed monument (explain)
- raised monument

On _____, set a(n): _____
DATE

See "Statement of Evidence" for further details (on back)

(reserved for recording data)

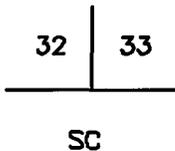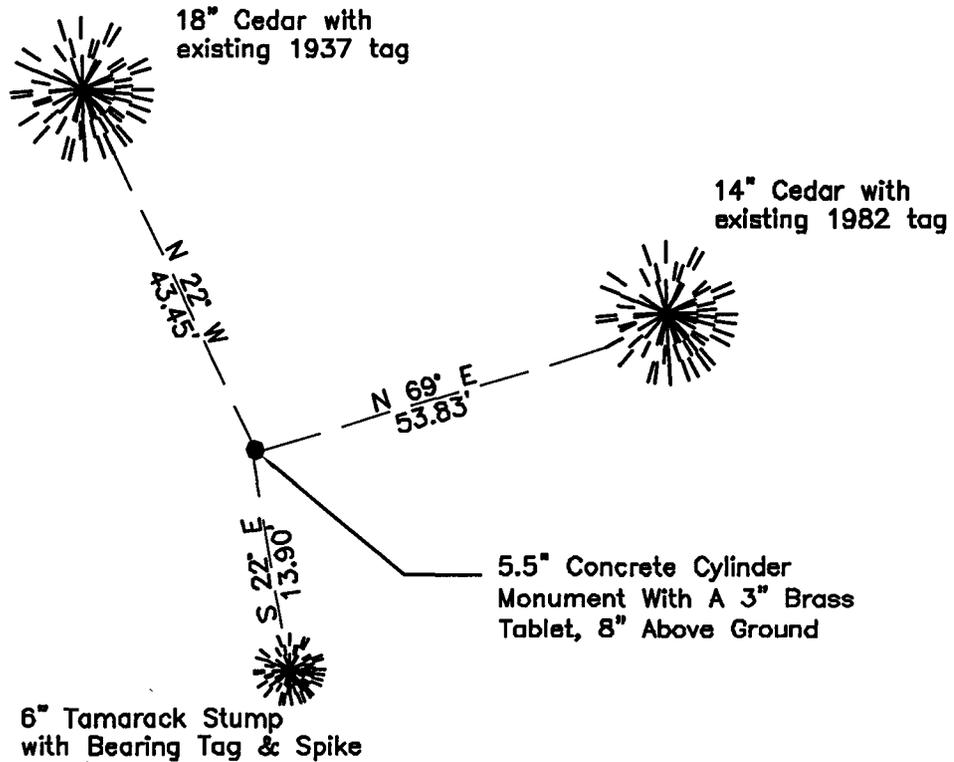

"SKETCH OF REFERENCE TIES" (not to scale - bearings are magnetic)

Ties are measured to center of monument unless otherwise noted.

UNITS = Metric English

UTM COORDINATES, ZONE 15

Northing: 17197870.180

Easting: 1363670.935

NAD 83/1996 HARN Adjustment.

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision, and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

Ross Wamre
signature

6/25/13
date

Ross Wamre, Minnesota License No. 45334

Page 1 of 3
A000601097



STATEMENT OF EVIDENCE: Standard Corner common to Sections 32 and 33 of Township 145 North, Range 27 West of the 5th Principal Meridian

1871; This corner was originally established by G.R. Stuntz for the GLO. His field notes indicate this corner position, witnessed by:

Tamarack 6" North 34^o West, 37 links
Tamarack 7" North 62^o East, 37 links

1929; H. E. Johnson, 874 forms, USFS Book 3 of Township 145 North, Range 27 West, page 10, found no evidence of the original corner but recovered a Norway Pine 17" Scribed BT he proceeded to set a Metal Location Poster on a 7" Ash to the south 7 links distant.

1937; GLO dependent resurvey of the Eleventh Standard Parallel North, along the South boundary of Township 145 North, through a portion of Range 26 West and through Range 27 West, 5th Principal Meridian. Hal D. Craig, found no remaining evidence of the original standard corner, reestablished this corner's position by proportionate measure and set a concrete monument, 2' long, 6" in diameter, 20" in the ground with a brass tablet, 3 1/2" in diameter witnessed by:

Norway Pine 18" North 15 1/2^o East, 108 links, mkd. SC T 145 N R 27 W S 33 BT.
Cedar 7" North 21 3/4^o West, 66 links, mkd. SC T 145 N R 27 W S 32 BT.

1962; Morrison & Tucker, USFS personnel, USFS Book 3 of Township 145 North, Range 27 West, page 10, found a blue line painted east and west, a tag on a 20" Red Pine and a tag on a 10" Cedar but found no evidence of the brass capped monument.

1982; Ken Whitehorn, RLS# 14677, Book 3 of Township 145 North, Range 27 West, page 10, found a 6" by 24" concrete monument leaning south of edge of swamp. They proceeded to straighten the monument and witnessed the monument by:

1937 Norway Pine now 22" North 14 1/2^o East, 70.85' to 60d spike in base of blaze
1937 Cedar now 11" North 22 1/2^o West, 43.45' to 60 d nail in SW side of tree
Cedar 8" North 68 1/2^o East, 53.83' to spike is base of blaze with Scribing
Hub for laser transmitter at edge of swamp, North 0^o East, 31'
Placed a Cedar log by corner with ribbon

1983; G. Robertson and D. Harmon, USFS, Book 1 of Township 145 North, Range 27 West, page 72, found the monument, two Cedar BT's still standing alive and witnessed by:

Tamarack 9" North 54^o West 54.65' MKD S32SC Bt with a double blaze 60d spike in base

2010; A Kadrmas, Lee & Jackson survey crew found a standard GLO 3" Brass tablet in a 5.5" concrete, 8" above ground. Witnesses found and established as shown on the face of this certificate.

2012; Ross Wamre, RLS #45334, after analysis of record and survey information accepts this monument as the correct perpetuation of the corner.

Contacts pertaining to this corner are as follows:



Cass County Recorder's Office
Cass County Engineers Office
Cass County Surveyors Office
Northern Engineering and Consulting Inc.
United States Forest Service
MnDOT – District Office 2
Bureau of Indians Affairs – Bemidji
Bureau of Land Management's (BLM) Northeastern States Field Office