


T. 139 R. 29 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 21 Corner common to sections 16,21

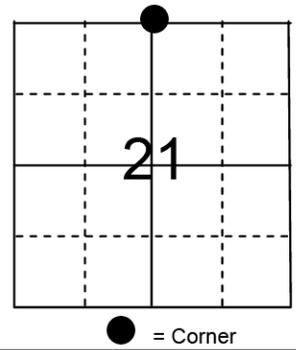

EXISTING SURVEYS

Original Government Survey

Year surveyed 1865  
Original monument Post

Original Evidence Found

Year of search 1908 by J. Curo  
Monument found Set by Hicks  
Curo Book 95, page 37

Bearing Trees

Species N. Pine N. Pine  
Diameter 15" 12"  
Bearing S 84 1/2° E N 5° W  
Distance 57 links 117 links

Original Bearing Trees Found

Species N. Pine N. Pine  
Diameter 15" 12"  
Bearing S 84 1/2° E N 5° W  
Distance 57 links 117 links

Subsequent Corner Restoration

Year surveyed 2/1918 By E.B. Horst, LS 376  
Location filed: County Book C, page 100, Curo Book 38A, pg. 48  
Monument: I.M.

Evidence of Subsequent Corner Restoration

Year of search 8/1920 By E.B. Horst, LS 376  
Location filed: Curo Book 166, page 40  
Monument: Set 2.5"x 30" capped I.M. over a 1" gas pipe already set by M. Smith, originally established from U.S. B. T.s. by Mr. Hicks and verified by J.W. Curo.

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Bearing Trees, Reference Objects

Species J. Pine Guide Board  
Diameter 8" Post  
Bearing N 20°16' E S 58°40' W  
Distance 71.6' 35.4'

Subsequent Corner Restoration

Year surveyed 10/1927 By A.R. Taubman  
Location filed: Ditch shelf 3, Book 160, page 4  
Monument:  
Corner at Station 359+00.7 and reference points.  
12" J. Pine, NE, 71.9'  
Post, SE, 48.2'  
  
9/1932, J.W. Curo, LS 1428  
Curo Book 38A, pages 40, 43, 61  
Found 1927 witnesses and corner on centerline E-W road.  
  
1966, R.F. Schneider, LS 5740  
Curo file 1957  
Found capped iron monument in center of E-W road and witnessed as follows.  
9" Jack Pine, N 8° E, 158.90'  
Tele. Pole, N 71° W, 81.70'  
  
1987, STEVENSON & ASSOCIATES  
Curo file 1957  
Found P.K. nail at surface of road and witness.  
9" J. Pine N 8° E, 158.9' (1966)

Evidence of Subsequent Corner Restoration Found

Year of search 7/2001 By CCHD/SO  
Location filed: #2001.035  
Monument: Found 2.5" ODIP, with Plumber cap down 1.4', on center line Hwy. #87 and extension of center line Hwy. #84 and witness as follows:  
6" N. Pine, N 60° E, 169.90' duplex nail, up 1.0', N. side  
Fence Cor., North, 32.35' duplex nail, up 1.0', E. side  
E. sign post, S 1° E, 77.77' E. flange  
N. sign post, S 60° W, 48.80' N. flange  
  
8/2001, CCSO  
#2001.035  
Set Mag nail, 1.2', N. of new center line, located with GPS.  
  
8/2019, J. Kramer, LS 23668  
Certificate of Location  
Found 2.5" iron pipe with plumber cap, down 1.4', 1'+/-, N. of E-W centerline and witnessed as follows.  
Fence Cor., North, 32.35'(2001) nail/disc, up 1.0', E. side  
N. sign post, S 60° W, 48.80'(2001) face  
Geodetic Mon., N 16° E, 28.77' 1114E center  
Stop sign post, S 68° E, 46.12' face

