

T57 R26

CORNERS

BOOK#2

K&S

FIELD BOOK

82 0032


T57

R26

CORNERS

BOOK#2

USFS
 Corner Restoration
 T57N R26W
 Book #2

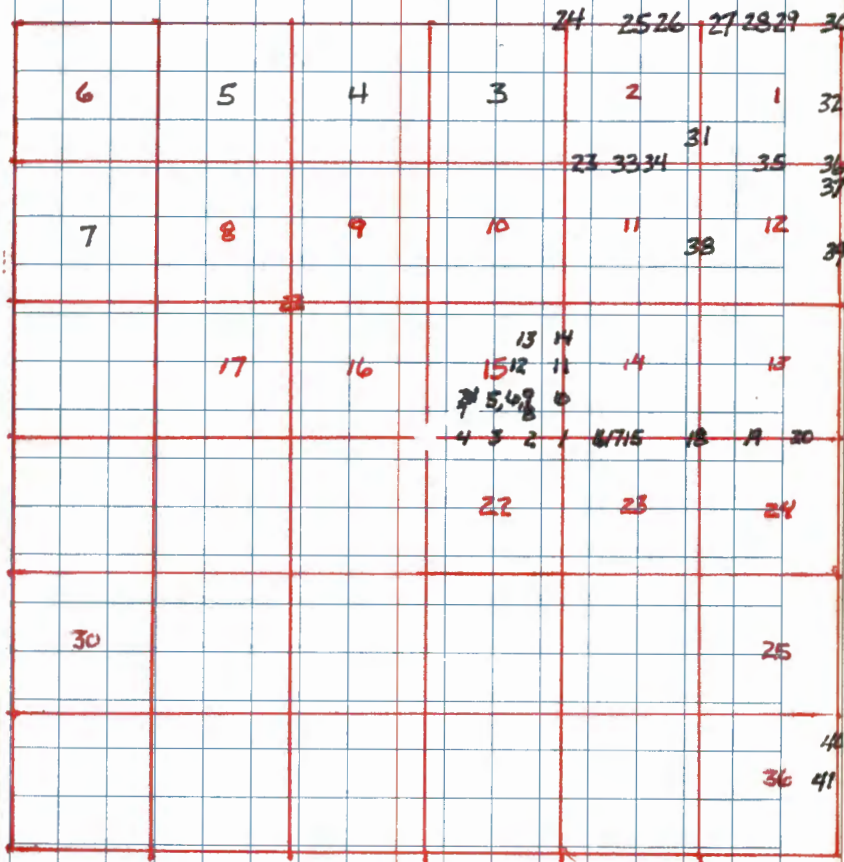

N-17

SECTION CORNER 14-15-22-23

1873 B.W. GRIFFIN
SET WOOD POST FROM WHICH

ASPEN 12" N20W 30 LBS 19.8'

ASPEN 12" N56E 35 LBS 23.1'

ASPEN 12" S50E 10 LBS 6.6'

ASPEN 12" S23W 25 LBS 16.5'

1927 PIAT BY P.C. WARNER

SET IRON PIPE

MAPLE 8" S67W 13.7'
Now 12" S75WR.OAK 8" N28E 24.9'
Now 18" N36ER.OAK 5" S75E 38.1'
DEAD NOW 8" S72E
TWEN

1934 E. PARKER

FOUND WOOD POST & IRON PIPE IN GOOD CONDITION.

IRON PIPE 6" ABOVE GROUND.

MAPLE 11" S74W 19 LBS 12.54'

OAK 9" S79E 57 LBS 37.62'

OAK 12" N27E 38 LBS 25.08'

1985 ITASCA CO

TIED TO TALL CORNER ON A TRAVERSE OF THE
SOUTH BOUNDARY OF THE FOREST.

NEW BTS

R.OAK 15" S37W 23.47

R.OAK 8" S75E 37.86

MAPLE 13" NORTH 11.32

"X" ROCK 2x2 NB2W 34.29 Flush w/ground

1988 REMAIN

FOUND 1 1/2" IRON PIPE WITH 2" ALUMINUM CAP
1.8' ABOVE GROUND. MONUMENT STAMPED

T57N

STEEL SIGN POST 3.46' EAST

15 | 14

STEEL SIGN POST 3.65' WEST

22 | 23

R26W

N-16

2. EAST 1/6 SECTION 15-22

1927 PLAT BY PC WARNER

SET IRON PIPE

MAPLE 7" N30E 20.4'

NOW 15"

MAPLE 8" S38W 11.7'

NOW 14"

11.27 REPLAZED 1985 BY
ITASCA CO.

1934 E. PARKER

FOUND 1/2" IRON PIPE & ZINC SCRIBED POST. PIPE

4" ABOVE GROUND.

MAPLE 9" N40E 24 LKS 15.84'

MAPLE 11" S43W 13 1/3 LKS 8.8'

1940 A. JOHNSON

FD IRON.

MAPLE 8" S38W 19 LKS 12.54'

MAPLE 8" N46E 31 LKS 20.46'

1985 ITASCA CO

RESET 3/4" IRON PIPE. FD 1927 BEARING

TREES.

NEW STS

~~MAPLE 14"~~

BASSWOOD 6" N55W 9.11'

1988 R. M. MOO

FD 3/4" DIA IRON PIPE 3" ABOVE GROUND

PLACED FSLP TAGS ON BEARING TREES.

STEEL SIGN POST 3.73' NORTH

STEEL SIGN POST 4.40' EAST

N-15

23: QUARTER CORNER SECTION 15-22

1873 EIE GRIFFIN

SET WOOD POST FROM WHICH

BIRCH 10" N31E 12 LKS 7.92'

BIRCH 11" S5E 35 LKS 23.1'

1927 PLAT BY P.C. WARNER

IRON PIPE

MAPLE 6" N60E 17.8

MAPLE 8" S28E 20.0

NOW 15"

1940 A. JOHNSON

Fd 3" SCREWED POST & 1/2" IRON PIPE WITH
AN ELBOW.

MAPLE 6" N68E 28 LKS 18.48'

MAPLE 8" S22E 32 LKS 21.12'

NOW 15"

1984 ITASCA CO WAS RUNNING A TRAVERSE

ALONG THE SECTION. I ENDED & FOUND A
COUNTY MONUMENT. ESTABLISHED AND NEW

BTS

BASSWOOD 8" N40W 13.02'

BASSWOOD 6" N37E 9.91'

BASSWOOD 9" S60W 14.93'

4/7/88

Fd ITASCA CO MONUMENT 1/2" IRON PIPE WITH
2" ALUMINUM CAP UP 2.0 FT.

MONUMENT STAMPED; T57N

	15
1/4	22
	R26W

STEEL SIGN POST 3.8' NORTH
4.0' WEST

N-14

4 WEST 1/16 SECTION 15-22

1927 PLAT BY P.C. WARNER

IRON PIPE

BASSWOOD 10" N74E 29.6'

MAPLE 10" S86W 36.2'

1934 E. PARKER

Fd IRON PIPE 6" ABOVE GROUND; CEDAR POST.

MAPLE 12" S84W 38/ks 25.08'

LINDEN 11" N74E 113/ks 74.58'

1940 A. JOHNSON

Fd 1/2" IRON PIPE & 3" SCRIBED POST

OAK 10" N86W 56/ks 36.96'

BASSWOOD 14" N83E 45/ks 29.70'

1985 ITASCA CO

MONUMENT IS 3/4" IRON 2" UNDERGROUND.

WITNESSED BY

X ROCK 1X1 S84W 26.77'

1985 TIPS CONT

X ROCK 2 X2 S30E 48.43

MAPLE 8" S51W 9.81

P. POLE S70E 82.57

M-15

5 CENTER SOUTH 1/16 SECTION 15

1927 PIAT BY PC WARNER

IRON PIPE

W. PINE 6" N53E 12.2'

Now 18" 4/88

W. PINE 9" N45W 14.6'

Now 16" 4/88

4/788 1 MAIN D OPENED

Fd 1" DIA IRON PIPE FLUSH WITH

THE GROUND

NEW BT

MAPLE 8" S39E 38.0' TO NAZI

STEEL SIGN POST 3.7' SOUTH

6 MEANDER CORNER, SOUTH $\frac{1}{16}$ LINE
WEST SHORE AMEN LAKE

1927 PIAT By P.C. WARNER

IRON PIPE

R PIPE 12" S67W 11.4'

W. PIPE 17" N83W 16.7'

MN-14

6 7. MEANDER CORNER ~~WEST~~ ^{WEST} 1/16 LINE

SOUTH SHORE CRANE LAKE

M 1927 PIAT B, PL. WARNER

IRON PIPE

F CEDAR 10" S56E 12.8

W CEDAR 14" S28W 15.0

5/26/88 M. Hayes, R. Maip⁺, P. Miles
 Found the iron pipe 3' ^{ft} underwater,
 70+ feet north of shoreline. Pipe sticks
 up above lake bottom by one inch.
 The inside diameter is 3/4 inch. (The ~~inside~~
 was not known as it would have required
 submerging my head to get a grip on the
 pipe with two hands.) From the pipe
 a dead 10" Cedar bears S48°E 13.0 ft.
 with upper blaze. This tree was broken
 off at the H₂O level and where the
 lower blaze would be was splintered
 when the tree broke. Some faint marks
 (axe or scribe) were visible on this
 upper blaze that we cut off. Also from
 the pipe was a figured 14" Cedar with
 upper & lower blazes that bears S21°W,
 15.0 feet to where the tree would be figured
 up correctly. The blazes were the

S 13°W

74.78

S 56°E

30.76

but, we could not see it as they were
 underwater.

Referenced this iron with two 5/8" dia x 36"
 long aluminum rod monuments with caps stamped:

R.M.
T51N R26W

30.76 FT
 TO SMC
 1988
 USFS

R.M.
T51N R26W

74.78 FT
 TO SMC
 1988
 USFS

from the SMC iron in the water:

S 13°W 74.78' to R.M.
 S 56°E 30.76' to R.M.

M.C. 7/

MN-16

6 B MEANDER CORNER EAST 1/16 LINE SOUTH
SHORE AMEN LAKE

1 1927 PIAT BY P.C. WARNER

IRON PIPE

W PINE 8" S 78 W 32.4'

W PINE 1.4" S 15 E 66.7'

1988 R. MAIN D. OJENEN

FD IRON PIPE UNDER WATER \pm 3 FT.

BOTH BEARING TREES ARE IN GOOD CONDITION.

PLACED FSLP TAGS ON THE BT'S.

6 9 MEANDER CORNER SOUTH $\frac{1}{16}$ LINE
EAST SHORE AMEN LAKE

1 AZT PLAT By AC WARNER
IRON PIPE

TAMARACK 4" S 8 E 7.7'

1 W PINE 11" S 86 E 109.4'

6 M-17
10 SOUTH 1/16 SECTION 14-15

1927 DIAT BY PL WARNER

IRON PIPE

SPRUE 5" S ? E 27.7

BABAM 8" N14E ~~27.7~~ 8.7

1935 KENG

Fd 1/2" IRON PIPE 6" ABOVE GROUND I.A. 4" ASPEN POST.

BABAM 10" N12E 11/KS 7.26'

SPRUE 6" S 25E 45/KS 29.7'

NOT LOOKED
FOR

L-17
6 11 QUARTER CORNER SECTION 14-15

1873 E.W. GRIFFIN

WOOD POST

ROAK 6" N36E 151ks 9.9'

ASPEN 10" S47W 61ks 3.96'

1927 PLAT BY P.C. WARNER

IRON PIPE

R PINE 16" S33W 43.6'

ROAK 12" S36E 36.2'

1935 KING

Fd 4" ASPEN POST & A 1/2" IRON PIPE 6" ABOVE
GROUND.

R PINE (STP) 14" S30W 571ks 37.62'

ROAK 13" S38E 581ks 38.28'


1956 O. LIND

Fd 1/2" IRON PIPE & SCRIBED WOODEN STAKE.

PLACED A LOCATION TAG ON A 6" ASPEN EAST
SIDE FROM WHICH CORNER BEARS N75W
0.46 CHAINS OR 30.36'

6/1988 RMAIN-D. OJENEN

FOUND 3/4" x 1.5' IRON PIPE SET BY WARNER
IN 1927. ALSO FOUND WARNER PINE NOW A
STUMP. SET NEW FOREST SERVICE MONUMENT
2" GALV X 4' GALVANIZED STEEL PIPE WITH 3"
BRASS CAP & MAGNETISED PLASTIC BREAKAWAY
BASE. MONUMENT 1.5' ABOVE GROUND.
MONUMENT STAMPED: T57N R26W

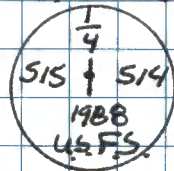

NEW BTs.

R. OAK 11" N70E 16.75 TO NAL

MAPLE 8" S9E 19.87 TO NAL

R OAK 9" N64W 14.35 TO NAL

Steel sign post 4.21 NORTH
" " " 4.32 WEST

L.15-16

12. MEANDER CORNER 1/4 LINE EAST SHORE AMEN LK

1927 Plat By P.C. WARNER

IRON PIPE

R. PINE 12" N69E 21.0'

R. PINE 14" S72E 18.0'

1939 A. JOHNSON

FD A 2" SCRIBED POST & A 1/2" IRON PIPE.

R. PINE 12" S66E 27/ks 17.82'

R. PINE 10" N79E 34/ks 22.44'

1987 J. KLENOTICH

Set A WC to this MC using a 1/2"

IRON PIPE WITH A PLASTIC CAP STAMPED

RLS 13310 & MAGNETIC BEARINGS WERE USED.

HE TIED THIS MONUMENT TO WARNERS 1927

BEARING TREES

R. PINE 20 N20E 6.98'

R. PINE 22 S03E 6.65'

1988 R. MAIN.

WARNERS MONUMENT FALLS IN AMEN LAKE

± 10 FT. BOTH BEARING TREES ARE IN
GOOD CONDITION. WITH FSLP TAGS ATTACHED.

K, 16-17
13 MEANDER CORNER NORTH $\frac{1}{16}$ LINE
EAST SHORE AMEN LAKE SEC 15

1927 PIAT BY PC WARNER

IRON PIPE

W. PINE	20"	N13E	28.7'
Now	28"	N8E	28.7

W. PINE	11"	S84W	22.7'
Now	21"	S77E	22.7

1939 A. JOHNSON

FD A ROTTED OFF WOOD POST & A $\frac{1}{2}$ "
IRON PIPE. IRON IS 5" ABOVE GROUND.
PLACED A LOCATION TAG ON A 7" R. OAK FROM
WHICH CORNER BEARS ~~SW~~ N10E \circ 3 CHAINS
OR 19.8'. THE TAG IS ON THE SW SIDE OF
THE TREE.

1987 R. MAENI, JACKSON

FOUND $\frac{1}{2}$ " IRON PIPE 3" ABOVE GROUND
IN SAME CONDITION AS 1939 SEARCH

K-17
14 NORTH 1/16 SECTION 14-15

1927 PIAT BY PC WARNER, ~~IRON PIPE~~

W. PINE 10" N45E 27.8'
Now 20" N52E 27.8

MAPLE 10" N65W 27.7'
Now 17" N58W 27.7

1935 KING

Fd AN A3" ASPEN POST. 36" ABOVE GROUND.

MAPLE 11" N66W 42/KS 27.72'

1956 O. LIND

Fd A WOODEN STAKE FLUSH WITH THE GROUND IN
POOR CONDITION.

W. PINE 14" N47E 38/KS

MAPLE 14" N30W 38/KS

1987 R. MAIN J. JACKSON

FOUND 1927 BEARING TREES. THRU 1935
& 1956 SEARCH MADE NO MENTION OF AN
IRON PIPE AND I DONT BELIEVE ONE WAS
SET IN 1927. PLACED F.S.L.P TAGS ON
1927 BT'S.

6/88 R. MAIN D. OJEWAN

SET A 4'x2" GALVANIZED STEEL PIPE
WITH 3" BRASS CAP AND PLASTIC BREAKAWAY
BASE WITH MAGNET. MONUMENT IS 1.6'
ABOVE GROUND. SET MONUMENT FROM 1927
BT'S. Fd SCRIBE IN BT'S AND PULLED
DISTANCES FOR MONUMENT FROM THESE POINTS.

MONUMENT STAMPED

NEW BT

REA OAK 15" S56W 35.01' TO N4E1

STEEL SIGN POSTS SOUTH 4.65'

" " " WEST 5.05'

T57NR26N

N 1/16
15 & 14
1988
USFS.

N-19

15 QUARTER CORNER SECTION 14-23

1873 E.W. GRIFFIN

SET A WOOD POST

MAPLE 5" ^{N31W}~~SS4E~~ 28/ks

BLK PINE 10 SS4E 28/ks

1985 ITASCA CO

SET CO IRON

MAPLE 3" NORTH 12.52

MAPLE 6 SS1E 16.70

1986 ITASCA CO

MAPLE 6" N87W 29.28

MAPLE 6 N09E 28.20

1988 RMAFN

Fd CO IRON 1/2 IRON PIPE WITH 2" ALUMINUM CAP 1.7' ABOVE GROUND.

MONUMENT STAMPED, T57N

1/4 — 14
| 23

R26W

STEEL SIGN POST EAST 2.05'

STEEL SIGN POST WEST 3.05'

N-18,19

16 MEANDER CORNER WEST SIDE LONG LAKE

1873 E.W. GRIFFIN

WOOD POST

BERCH 8" S50W 43/KS

BERCH 5" NORTH 50/KS

1965 ITASCA CO COUNTY MONUMENT

OAK 4" S04W 14.52

MAPLE 6" N74W 17.67'

1985 ITASCA CO

ROAK 13" N05W 24.80'

W PINE 26" S25W 21.0'

1988 R MAIN

FOUND 1/2" IRON PIPE / W / 2" ALUMINUM CAP

2.1' ABOVE GROUND. CAP STAMPED T57N

STEEL SIGN POST 3.50 WEST

MC
1/4
|
23
R26W

N-18,19

17 MEANDER CORNER EAST SHORE LONG LAKE

SEC 14-23

1873 E.W. GRIFFIN

WOOD POST

BLK PINE 8" N50E 281ks

BIRCH 8" S49E 241ks

1965 ITASCA CO

SET CO MONUMENT

R PINE 14" N6W 52.55'

R PINE 14" S78E 17.50'

1985 ITASCA CO tied into MC on a traverse of
the northern line bearing trees are still good.

1987 R. MAEN

FD COUNTY FROM 1 1/2" IRON PIPE WITH

2" ALUMINUM CAP IN GOOD CONDITION

2' ABOVE GROUND. STEEL SIGN POST EAST 3.8'

MONUMENT STAMPED; T 57N BEARING TREES ARE GOOD

MC
14
23
R26W

N-21

18 SECTION CORNER 13-1423-24

1873 E.W. GRIFFIN

WOODPOST

BLK PINE 10" S61W 50/KS

BLK PINE 6" N10W 20/KS

BIRCH 5" N51½ E 45/KS

BIRCH 8 334E 55/KS

1965 BENZING

ASPEN 3" N48E 16.43

ASPEN 6" S85E 32.58

BIRCH ^{ROTTEN} STP N72W 20.53

1986 ITASCA CO

ASPEN 16" S78W 27.74

ASPEN 16" S68E 35.26

1988 R. MAIN

FD 1½" IRON PIPE /W/ 2" ALUMINUM CAP
 1.8' ABOVE GROUND. SIGN POST 2.9' WEST
 AND 4.0' EAST. PLACED FSLP TAGS ON
 EXISTING BT'S. MONUMENT STAMPED.

T57N
14 13
23 24
R26W

OLD BT'S

ASPEN 9" N60 E 16.43 TO SCRIBE

ASPEN 11" S74 E 32.58 " "

ASPEN 16" S78W 27.74 " "

ASPEN 16" S60E 35.26 " "

N-~~2213~~ 2324

EAST

19 MEADOW CORNER ~~WEST~~ SHORE PUGHOLE LAKE

1873 EW GRIFFIN

WOOD POST

B/K PINE	8 12	N 18 W	30
B/K PINE	8 12	S 86 E	25 125
TAMARISK	8 12	S 86 E	25 125

1965 ITASCA CO

SET IRON PIPE.

WOAK 4 N65W 3.45

ROAK 6 N13W 29.73

N-~~22~~ 22-23

WEST

20 MEANDER CORNER EAST SHORE PUGHOLE LAKE

1873 E.W. GRIFFIN

WOOD POST

BLK PINE	12" 8	534W	124	30/ks
TAMARACK	12" 8	N22W	300	25/ks

1965 ITASCA CO

BIRCH 3" S62E 8.67

BIRCH 5" S70W 8.50 NOW DEAD

1983 ITASCA CO

X ROCK 4x4 S86E 12.41 X ON WEST POINT OF ROCK

A ROCK 1x1½ S4W 15.02 X ON ^{CENTER} WEST POINT OF ROCK

1988 R MAIN

FD CO IRON 2" IRON PIPE WITH ALUMINUM CAP 1.3' ABOVE GROUND. CAP STAMPED:

T57N
ML
13
24
R26W

Old BTs

BIRCH 6" S55E 8.67 TO SCREDE
PLACED FSLP TAG ON BT

STEEL SEGW POST WEST 3.6'

M-14,15

21 SMC on S¹/₁₆ Line Sec. 15
East Shore Crane Lake

1927 Plot by P.C. Warner,
set iron pipe symbol

5/26/88 M. Hayes, R. Main, P. Miles

At distance from CS¹/₁₆ we searched
for iron in 3¹/₂ ft. H₂O, 80' west of
shoreline. Got draw from metal locator
close to line and distance. Even by
submerging under water I could not feel
the iron. ^(4 ft) Set a picket at location
to post line to. MCH

8/10/88 R. MAIN-CURT KRAUSE

Ed 3/4" x 1.7' IRON PIPE AND IN PLACE 4 FT
UNDER WATER. PLACED TEMPORARY TIES OF
A 4" BAKAM 588 E 83.15
4" B AKAM 572 E 90.23'

21

1873 OREG GOUT SURVEY E.W. GRIFFIN
 W. BIRCH 14" N40W 60
 LINDEN 12" N54E 34
 W. BIRCH 14 S35E 39
 LINDEN 12 S66W 22

1938 From Form 874-9

IRONWOOD POST SET BY SETH W. PETERSON.

POST IS 3x3x36. PETERSON STATES THAT THIS

CORNER WAS SET BY HIM BY PROPORTIONAL

MEASUREMENT. METAL LOCATION POSTER ON A

BASSWOOD ON THE EAST SIDE FROM WHICH CORNER
 BEARS N86°30'E 1.08 CHAINS.

E 1718

23 MEANDER CORNER SECTION 2-11
EAST SHORE ORANGE LAKE

MARCH 1873 E.W. GRIFFIN ORIG GOUT SURVEY
SET WOOD POST WITNESSED

R. PINE 10 N66E 13/ks 8.58 FT

W. PINE 14 S63E 12/ks 7.92 FT

DEC 1924 P.C. WARNER ITASCA CO SURVEYOR PLAT
OF SECTION 11. PLAT SYMBOL INDICATES ORIG
EVIDENCE FOUND.

10/30/34 ERNEST PERRY 874-9
FD 4" ASPEN POST AND 3/4" IRON PIPE. Wd POST
UP 30" I.P. UP 10". WITNESSED WITH
ASPEN 7" NB9E 28/ks
ASPEN 8" STP N14W 40/ks

METAL LOCATION POSTER ON SW SIDE OF 7" ASPEN BT
FROM WHICH CORNER BEARS S89W 28/ks.

CORNER TO SECTIONS 2-3-34+35

ORIG. GOVT. SURVEY 1873

SET WOOD POST

BIRCH 8 NIW 250 LKS = 165.0'

TAM. 12 NSE 220 LKS = 145.20'

SPRUCE 6 S21E 35 LKS = 23.1'

SPRUCE 4 S32W 30 LKS = 19.80'

QUARTER CORNER BET. SEC'S. 2 & 35

ORIG. GOV'T. SURVEY 1873

SET WOOD POST

W. PINE 10 NIZE 20 LKS. = 13.20'

W. PINE 10 SIZE 10 LKS. = 6.60'

26 LINE TREE BET. SEC'S. 2+35
ORIG. GOV'T. SURVEY 1873
24" W. PINE ON LINE - 13.43 CHS. =
886.38' WEST OF SEC. COR.

CERTIFICATE FILED

26

27

WITNESS CORNER TO SECTION CORNER
 TO SECTIONS 1-2-35+36 - 4.00 CHS. = 264.0'
 EAST ON NW COR. SEC. 1 ON EAST SIDE
 OF BEAVER LAKE.

ORIG. GOV'T. SURVEY 1873

SET WOOD POST

SPRUCE 10 N26E 37 LKS. 21.12'

SPRUCE 4 S34E 10 LKS. 6.60'

CERTIFICATE FILED

278

MEANDER CORNER BET. SEC'S, 1+36
WEST SHORE OF LITTLE LONG LAKE
ORIG. GOV'T. SURVEY 1873
SET WOOD POST

ASPEN 5 N75W 25 LKS. = 16.50'

BLK. PINE 6 S13W 22 LKS. = 14.52'

MEANDER CORNER BET. SEC'S. 1+36

EAST SHORE OF LITTLE LONG LAKE

ORIG. GOV'T. SURVEY 1873

BLK. PINE 8 N15E 20 LKS. = 13.20'

BLK. PINE 8 S40E 18 LKS. = 11.88'

CERTIFICATE FILED

30 NORTHEAST TOWNSHIP CORNER TO SEC'S

1-6-31+36

ORIG. GOVT. SURVEY 1872

SET WOOD POST

BIRCH 14 N17W 35 LKS. = 23.10'

MAPLE 6 N33E 25 LKS. = 16.50'

PINE 30 S82E 66 LKS. = 43.56'

BIRCH 8 S21W 54 LKS. = 35.64'

CERTIFICATE FILED

30

MEANDER CORNER BET. SEC'S 142

NORTH SHORE OF JOHNSON LAKE

ORIG. GOV'T. SURVEY 1873

SET WOOD POST

BIRCH 16 N34W 16 LK. = 10.56'

BIRCH 12 N56E 15 LK. = 9.90'

CERTIFICATE FILED

EAST RANGE LINE

QUARTER CORNER BET. SEC'S. 1+6

ORIG. GOV'T. SURVEY 1872

SET WOOD POST

BIRCH 10 S51E 8 Lks. = 5.28'

BIRCH 10 N15W 49 Lks. = 32.34'

CERTIFICATE FILED

33 QUARTER CORNER BET. SEC'S. 2+11

ORIG. GOV'T. SURVEY 1872

SET WOOD POST

BIRCH 8 N64W 17 LKS. = 11.22'

BIRCH 8 S24E 22 LKS. = 14.53

CERTIFICATE FILED

33

34 MEANDER CORNER BET. SEC'S 2411

ORIG. GOV'T. SURVEY 1873


SET WOOD POST

BALSAM 10 N80W 46 LKS. = 30.36'

BIRCH 10 S48W 17 LKS. = 11.22'

CERTIFICATE FILED

34

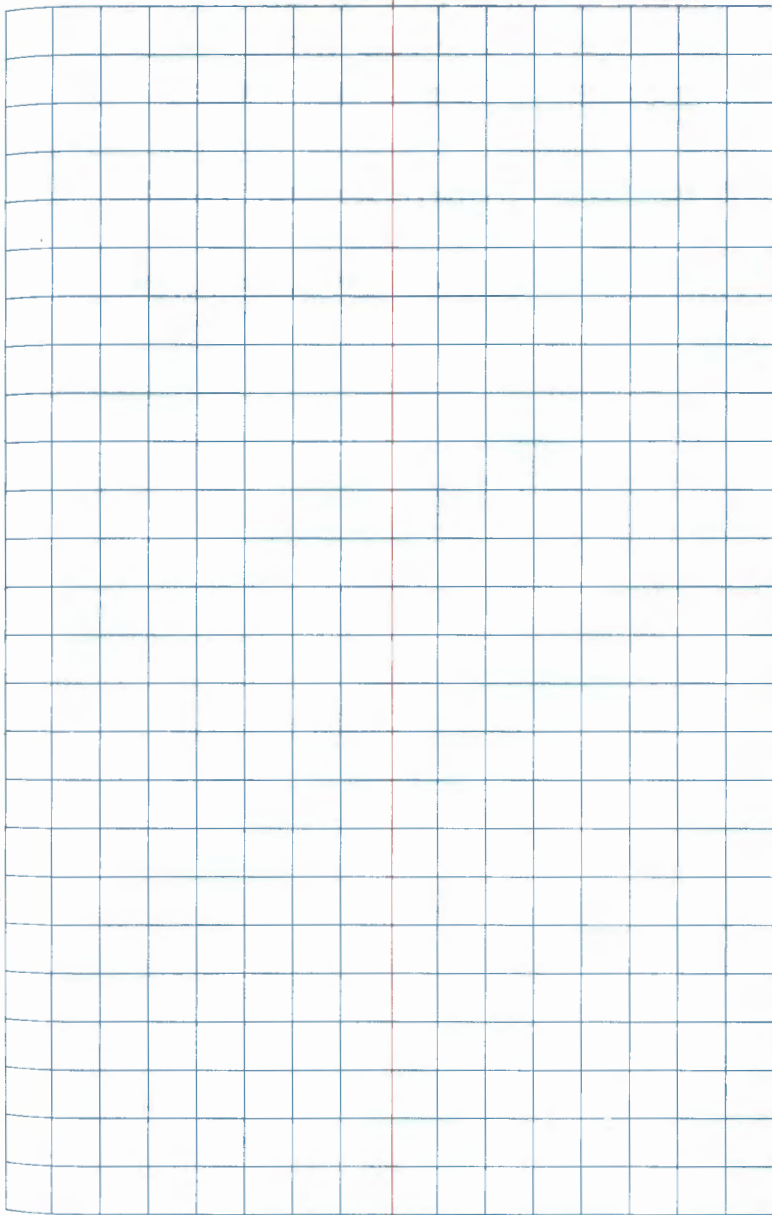

QUARTER CORNER BET. SEC'S 14 & 12

ORIG. GOV'T. SURVEY 1873

MARKED 10" MAPLE FOR CORNER

W. PINE 11 N36W 27 LKS. = 17.82'

W. PINE 10 S18E 22 LKS. = 14.52'

CERTIFICATE FILED

EAST RANGE LINE

CORNER TO SECTIONS 1-6-7+12

ORIG. GOV'T. SURVEY 1872

SET WOOD POST

BIRCH 13 S20W 8 LKS. = 5.28'

BIRCH 13 • N6W 30 LKS. 19.80'

BIRCH 12 N28E 30 LKS. = 19.80'

LYNDEN 7 S50E 27 LKS. = 17.82'

CERTIFICATE FILED

37 EAST RANGE LINE
MEANDER CORNER BET. SECS. 7+12

ORIG. GOV'T. SURVEY 1872

SET WOOD POST

PINE 15 NW 10 LKS. = 6.60'

PINE 15 S50E 27 LKS. = 17.82'

CERTIFICATE FILED

37

38 MEANDER CORNER BET. SECS, 11 & 12

ORIG. GOVT. SURVEY 1873

MARKED 6" BIRCH FOR CORNER

BALSAM 11 S51W 14 LKS. = 9.24'

BALSAM 7 S16E 16 LKS. = 10.56'

CERTIFICATE FILED

38

EAST RANGE LINE
MEANDER CORNER. BET. SEC'S, 7+12
SOUTH SHORE OF MOORE LAKE
ORIG. GOV'T. SURVEY 1872
SET WOOD POST

TAM. 9. 528W 20 LKS = 13.20'

CERTIFICATE FILED

40 EAST RANGE LINE
MEANDER CORNER BET. SEC'S. 31+36

ORIG. GOV'T. SURVEY 1873

SET WOOD POST

W. PINE 12 S 12 E 27 LKS. = 17.82'

N. PINE 5 S 15 W 40 LKS. = 26.40'

CERTIFICATE FILED

40

41 QUARTER CORNER BET. SEC'S. 31+36

ORIG. GOV'T. SURVEY 1873

SET WOOD POST

MAPLE 8 N70E 19 LKS = 12.54'

FIR 8 S78W 20 LKS = 13.20'

CERTIFICATE FILED

41

Q R F M

FS 3 193-42-11 13-42-22 193-42-06 13-42-24

BS 1 03-29-32 183-29-47 03-29-39 183-29-43

T @ 2 190-12-³⁹~~49~~ 190-12-35 190-12-27 190-12-31

190-12-33

VA 1-2 103-03-32 ✓ 256-56-30 148.76 45.346

VA 2-3 88-06-08 ✓ 271-~~505~~⁵⁴⁻⁰⁹ 365.76 111.486

FS 4 190-41-32 10-41-33 190-41-33 10-41-32

BS 2 02-21-23 182-21-09 02-21-19 182-21-16

T 3 188-20-09 188-20-24 188-20-14 188-20-16

188-20-16

FS 5 226-11-37 45-11-29 226-11-33 45-11-26

BS 3 02-26-44 182-26-48 02-26-45 182-26-31

T 4 222-44-53 222-44-41 222-44-48 222-44-55

222-44-49

VA 3-4 85-29-32 ✓ 274-30-55 247.02 75.293

VA 4-5 78-08-44 ✓ 281-51-31 221.92 67.637

TRAVERSE FROM MC N¹/₆ LINE MC EAST SHORE
AMEN LK TO N¹/₆ SECTION 15¹/₄.

R MAEN T II BS: MC N¹/₆ LINE
J. JACKSON
D. DEANEN

O R F M

FS 6 195-21-34 15-21-29 195-21-32 / 5-21-74

BS 4 03-10-15 183-10-06 03-10-21 183-10-08

π 5 192-11-19 192-11-23 192-11-11 192-11-26

192-11-20

FS 7 218-35-06 38-35-04 218-35-15 38-34-57

BS 5 01-21-44 181-21-37 01-21-42 181-21-38

π 6 217-13-22 217-13-27 217-13-33 217-13-19

217-13-25

VA 5-6 95-35-37 / 264-24-22 406.35 123.551

VA 6-7 91-09-35 / 268-51-25 149.78 45.651

FS 8 226-51-18 46-51-10 226-51-21 46-51-11

BS 6 01-16-53 181-16-46 01-16-47 181-16-49

π 7 225-34-25 225-34-24 225-34-34 225-34-22

225-34-26

VA 7-8 89-13-43 / 270-46-34 137.10 41.805

FS = NAI 1 @ N $\frac{1}{6}$ position.

END