

T 150N - R 27W

CORNER

RESTORATION

Book 2

T 150N R 27W


CORNER

Book 2

### DISTANCES FROM SIDE STAKES FOR CROSS-SECTIONING

Roadway of any Width. Side Slopes 1½ to 1.

In the figure below: opposite 7 under "Cut or Fill" and under .3 read 11.0, the distance out from the side stake at left. Also, opposite 11 under "Cut or Fill" and under .1 read 16.7, the distance out from the side stake at right.

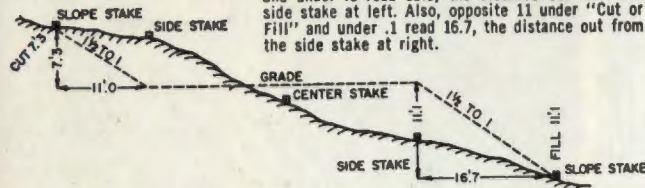

Cut or Fill	Distance out from Side or Shoulder Stake										Cut or Fill
	0	.1	.2	.3	.4	.5	.6	.7	.8	.9	
0	0.0	0.2	0.3	0.5	0.6	0.8	0.9	1.1	1.2	1.4	0
1	1.5	1.7	1.8	2.0	2.1	2.3	2.4	2.6	2.7	2.9	1
2	3.0	3.2	3.3	3.5	3.6	3.8	3.9	4.1	4.2	4.4	2
3	4.5	4.7	4.8	5.0	5.1	5.3	5.4	5.6	5.7	5.9	3
4	6.0	6.2	6.3	6.5	6.6	6.8	6.9	7.1	7.2	7.4	4
5	7.5	7.7	7.8	8.0	8.1	8.3	8.4	8.6	8.7	8.9	5
6	9.0	9.2	9.3	9.5	9.6	9.8	9.9	10.1	10.2	10.4	6
7	10.5	10.7	10.8	11.0	11.1	11.3	11.4	11.6	11.7	11.9	7
8	12.0	12.2	12.3	12.5	12.6	12.8	12.9	13.1	13.2	13.4	8
9	13.5	13.7	13.8	14.0	14.1	14.3	14.4	14.6	14.7	14.9	9
10	15.0	15.2	15.3	15.5	15.6	15.8	15.9	16.1	16.2	16.4	10
11	16.5	16.7	16.8	17.0	17.1	17.3	17.4	17.6	17.7	17.9	11
12	18.0	18.2	18.3	18.5	18.6	18.8	18.9	19.1	19.2	19.4	12
13	19.5	19.7	19.8	20.0	20.1	20.3	20.4	20.6	20.7	20.9	13
14	21.0	21.2	21.3	21.5	21.6	21.8	21.9	22.1	22.2	22.4	14
15	22.5	22.7	22.8	23.0	23.1	23.3	23.4	23.6	23.7	23.9	15
16	24.0	24.2	24.3	24.5	24.6	24.8	24.9	25.1	25.2	25.4	16
17	25.5	25.7	25.8	26.0	26.1	26.3	26.4	26.6	26.7	26.9	17
18	27.0	27.2	27.3	27.5	27.6	27.8	27.9	28.1	28.2	28.4	18
19	28.5	28.7	28.8	29.0	29.1	29.3	29.4	29.6	29.7	29.9	19
20	30.0	30.2	30.3	30.5	30.6	30.8	30.9	31.1	31.2	31.4	20
21	31.5	31.7	31.8	32.0	32.1	32.3	32.4	32.6	32.7	32.9	21
22	33.0	33.2	33.3	33.5	33.6	33.8	33.9	34.1	34.2	34.4	22
23	34.5	34.7	34.8	35.0	35.1	35.3	35.4	35.6	35.7	35.9	23
24	36.0	36.2	36.3	36.5	36.6	36.8	36.9	37.1	37.2	37.4	24
25	37.5	37.7	37.8	38.0	38.1	38.3	38.4	38.6	38.7	38.9	25
26	39.0	39.2	39.3	39.5	39.6	39.8	39.9	40.1	40.2	40.4	26
27	40.5	40.7	40.8	41.0	41.1	41.3	41.4	41.6	41.7	41.9	27
28	42.0	42.2	42.3	42.5	42.6	42.8	42.9	43.1	43.2	43.4	28
29	43.5	43.7	43.8	44.0	44.1	44.3	44.4	44.6	44.7	44.9	29
30	45.0	45.2	45.3	45.5	45.6	45.8	45.9	46.1	46.2	46.4	30
31	46.5	46.7	46.8	47.0	47.1	47.3	47.4	47.6	47.7	47.9	31
32	48.0	48.2	48.3	48.5	48.6	48.8	48.9	49.1	49.2	49.4	32
33	49.5	49.7	49.8	50.0	50.1	50.3	50.4	50.6	50.7	50.9	33
34	51.0	51.2	51.3	51.5	51.6	51.8	51.9	52.1	52.2	52.4	34
35	52.5	52.7	52.8	53.0	53.1	53.3	53.4	53.6	53.7	53.9	35
36	54.0	54.2	54.3	54.5	54.6	54.8	54.9	55.1	55.2	55.4	36
37	55.5	55.7	55.8	56.0	56.1	56.3	56.4	56.6	56.7	56.9	37
38	57.0	57.2	57.3	57.5	57.6	57.8	57.9	58.1	58.2	58.4	38
39	58.5	58.7	58.8	59.0	59.1	59.3	59.4	59.6	59.7	59.9	39
40	60.0	60.2	60.3	60.5	60.6	60.8	60.9	61.1	61.2	61.4	40

J. A. GJELHAUG 1936

Fd.

J. PINE STP. 8 N32E 22LKS=14.5

PUT FSLP ON J. PINE 8 N20E

53LKS. = 35.0'

WILL CHAIN FROM W¼ SEC. 34 TO E¼

JAG DISTANCE

W½ 2676.3 E½ 2675.64

TOTAL 5352'

BEARING S88°53'W

J. A. GJELHAUG 1936


Fd. ORIG. BT'S.

TAM STP. 10 N32W 18LKS. = 11.9

TAM DOWN 10 S40E 32LKS. = 21.1

USFS

T150N R27W  
BOOK 2 OF 3

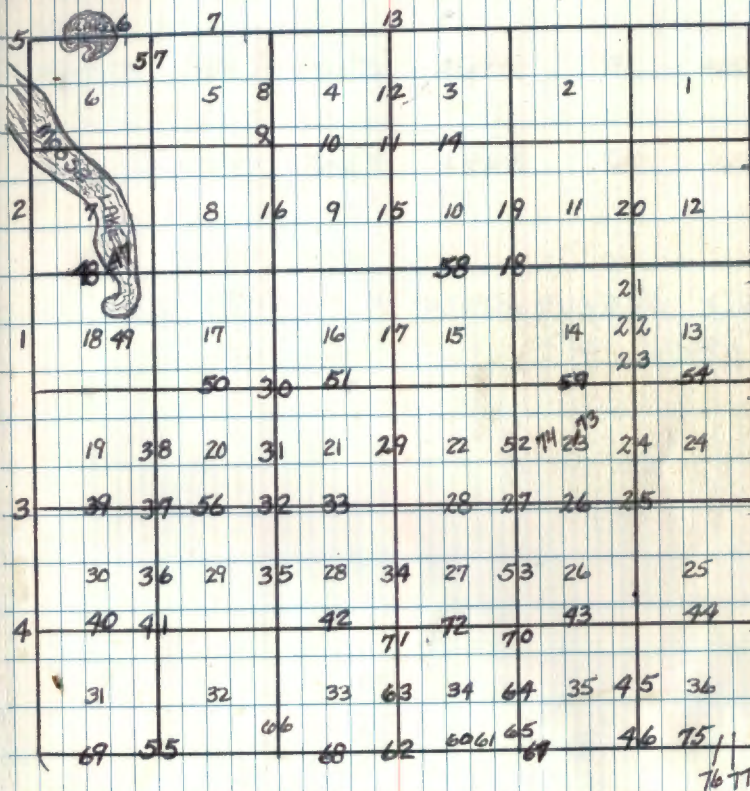

ON RANGE LINE WEST

1-2 QUARTER CORNER BET. SEC'S. 13-18

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

ASPEN 10 N23E 30 LKS. 19.8'

ASPEN 10 N89W 5 LKS. 3.3'

SEE FIELD BOOK #2 150-28

PAGE 4

10-24-79 CK-6B

CHAINED FROM SEC. COR. TO NORTH 2694'

AS TOTAL OF MILE IS 5388' AND ESTABLISH

APPROX. 1/4 COR. NO EVIDENCE OF ORIG. SURVEY

PUT FSLP ON 12 ASH N32E-31.0' FROM

4 SQD. ASPEN 6" AS COR. - 30' SOUTH OF ASH

SWP NW-SE


QUARTER CORNER BET. SEC'S. 7-12

NOTES OF ORIG. GOVT. SURVEY 1882

SET WOOD POST

ASPEN 5 N70E 5 LKS. 3.3'

ASPEN 4 S70W 8 LKS. 5.3'

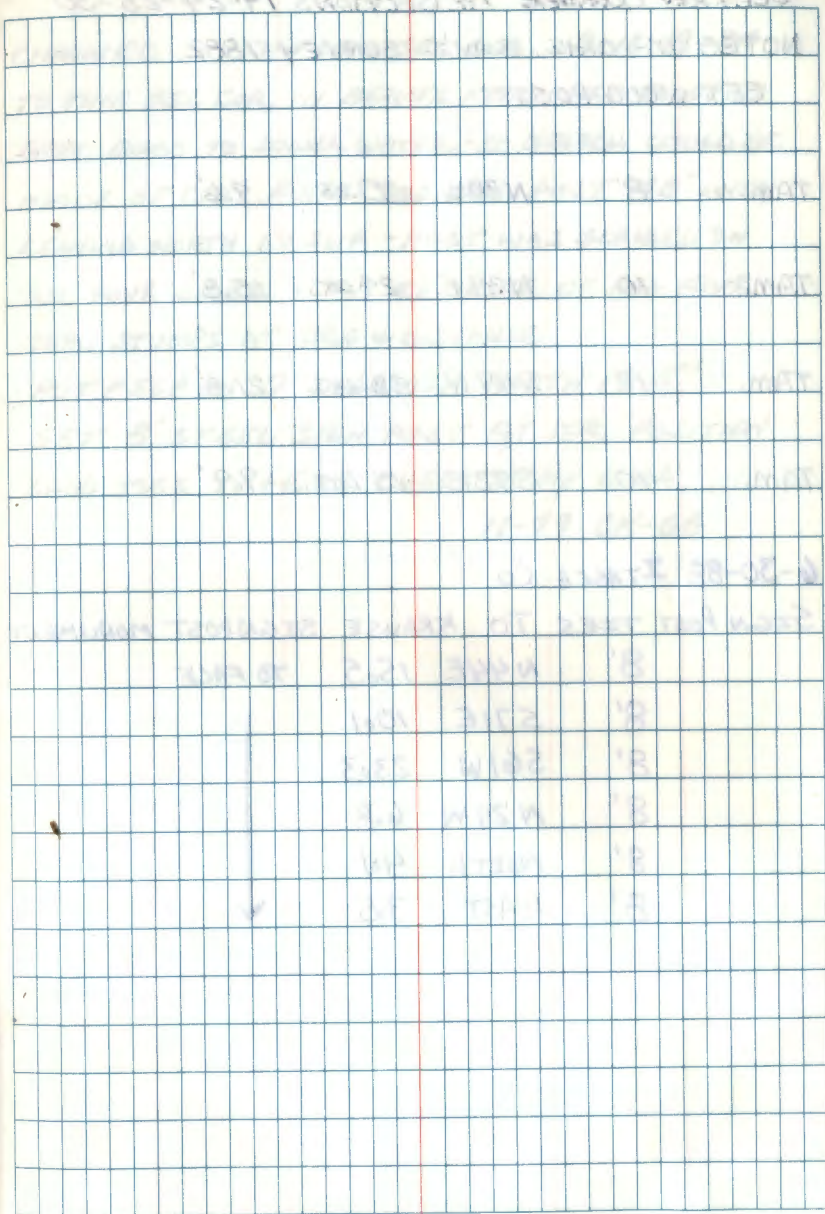

SECTION CORNER TO SECTIONS 19-24-25-30

NOTES OF ORIG. GOVT. SURVEY 1882

SET WOOD POST

TAM. 8 N38W 7 LKS. 9.6'

TAM. 10 N37E 24 LKS. 15.8'

TAM. 12 S49W 33 LKS. 21.8'

TAM. 10 S73E 15 LKS. 9.9'

6-30-88 ITASCA CO

SIGN POST TIES TO KRAUSE SIGNPOST MONUMENT

8' N44E 15.5 TO FACE

8' S71E 10.1

8' S61W 23.3

8' N29W 6.8

8' NORTH 4.1

8' EAST 3.5



CHAINED SOUTH FROM SEC. COR. 13-18-19-24  
 TO THIS SEC. COR. IN BEAVER POND - HAD TO OPEN  
 THREE DAMS TO LOWER WATER - SO SEARCH COULD BE  
 MADE OF COR. Fd. 4" SQD. TAM POST 48" LONG  
 LEANING NORTH IN S.N.P. - POST WAS SCRIBED ON  
 ALL FOUR SIDES - Fd. EVIDENCE OF ALL FOUR  
 TAM. STUMPS AT BRG & DISTANCE  
 PUT FSLP ON 7" DEAD ASH NORTH 19.5'  
 SET 8' STEEL SIGN POST AT COR. POSITION  
 LAND TIES N + E + S CHECK VERY GOOD  
 11-79 CK-GB

SECTION CORNER TO SEC'S. 25-30-31-36

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

BIRCH 8 S72E 15 LKS. 9.9'

BALSAM 10 S33W 45 LKS. 29.7'

ASPEN 10 N2E 28 LKS. 18.5'

ASPEN 9 N29W 60 LKS. 39.6'

TOWNSHIP CORNER TO SEC'S. 1-6 RG'S. 28-27 W

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

HSPEN 12 N74E 40 LKS. 26.4'

BALSAM 8 S77E 42 LKS. 27.7'

HSPEN 18 N37W 30 LKS. 19.8'

HSPEN 15 S19W 35 LKS. 23.1'




MEANDER CORNER BET. SEC'S. 6-31

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

ASPEN 8 S17E 10LKS. 6.6'

ASPEN 10 N55W 30LKS. 19.8'

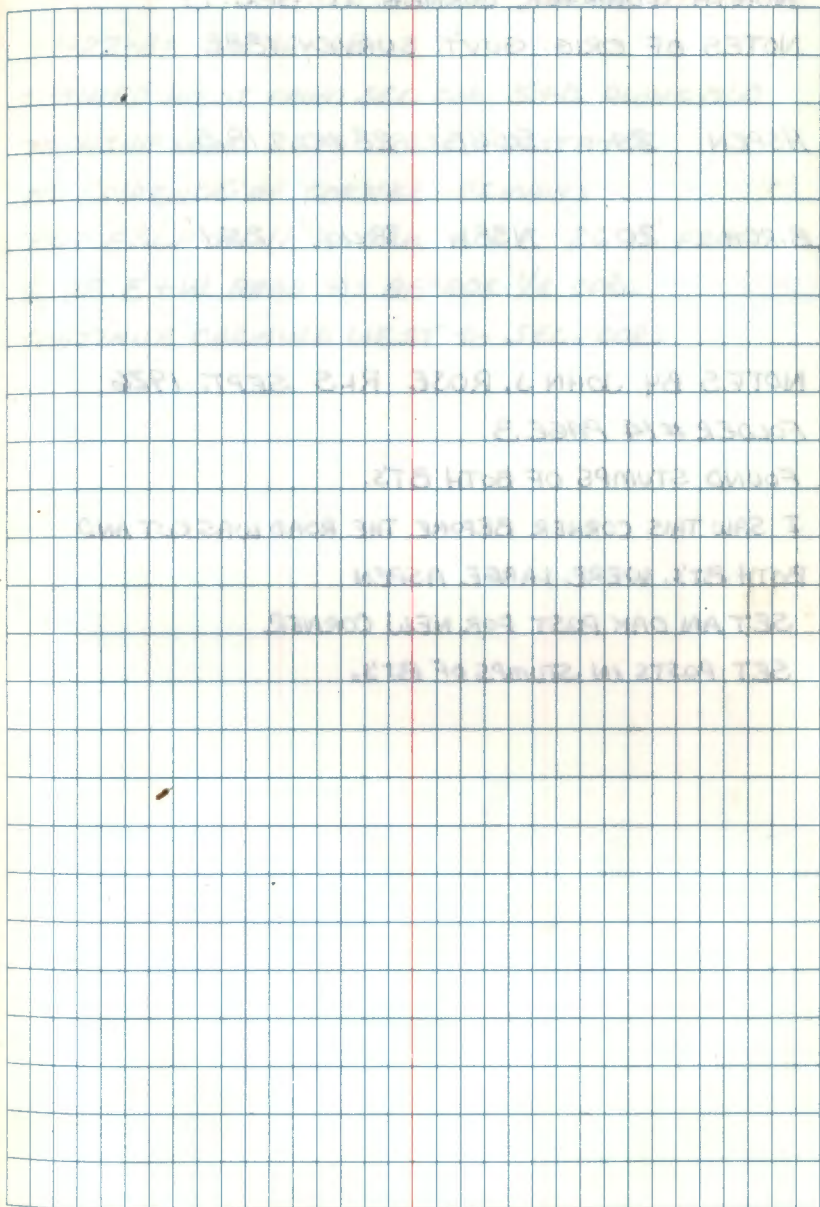

67

NORTH QUARTER CORNER TO SEC. 5

NOTES OF ORIG. GOVT. SURVEY 1882

ASPEN 24 S56E 28 LKS. 18.5'

BIRCH 20 N38W 38 LKS. 25.1'

NOTES BY JOHN J. ROSE RLS SEPT. 1926

FOLDER #14 PAGE 3

FOUND STUMPS OF BOTH BT'S.

I SAW THIS CORNER BEFORE THE ROAD WAS CUT AND

BOTH BT'S. WERE LARGE ASPEN

SET AN OAK POST FOR NEW CORNER

SET POSTS IN STUMPS OF BT'S.

11-22-83 CK. JA-6B

CHAINED WEST FROM SEC. COR. 5+6 ALONG OLD  
TOWNSHIP ROAD 2610' ROSE'S DISTANCE

NO EVIDENCE OF CORNER REMAINS

PUT FSLP ON 11" W. OAK N2E 26.0' FROM  
Q OF E+W ROAD AS APPROX. 1/4 COR.

CONTINUE CHAINING WEST TO SEC. COR.

8  
QUARTER CORNER BET. SEC'S. 4-5

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

HSPEN 5 S10W 15 LKS. 9.9'

HSPEN 10 S23E 20 LKS. 13.2'

3-8-07 Jim Schoonover

Found County Trus

4" OAK S.E. No TAG.

8" OAK N41°E 71.74'

CORNER IN ROAD Co# 26

6 9

SECTION CORNER TO SECTIONS 4-5-8-9

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

TAM. 5 N20W 10 LKS. 6.6'

TAM. 6 S15W 23 LKS. 15.2'

TAM. 10 N27E 20 LKS. 13.2'

TAM. 9 S28E 14 LKS. 9.2'

NOTES BY L.W. JOHNSON 1-15-34 FORM 874

FOUND POST IN GOOD CONDITION 30" HIGH

FSLP ON BASSWOOD 6 S32E 49 LKS. 32.3'

6/21/88 KW-GR-CK

SET COUNTY MONUMENT WITH ALUM CAP MARKED

FLUSH WITH GROUND

TISON R27W

55 | 54

58 | 59

1988

WITNESSED BY

RLS NO 14677

MAPLE 5 CLUMP N57W 39.11' SPK &amp; TAG

W. SPRUCE 11 N15W 23.68' " "

ASPEN 11 S36W 38.50' " "

BASSWOOD 14 S24W 32.20' " "

DOCUMENT # 400655

CERTIFICATE FILED

11-21-84 CK-GE-JA

SEARCH AREA FOR EVIDENCE OF POST OR B.T'S., BUT NOTHING COULD BE FOUND - EST. APPROX. SEC. COR. POSITION BY USING  $\frac{1}{2}$  OF COUNTY ROAD NORTH AND EAST - BY USING ROSE'S, DISTANCE FROM NORTH WE ESTABLISH APPROX. SEC. COR. LOCATION SET 4"X4"X5' DRY CEDAR POST TO MARK APPROX. POSITION - PUT FSLP ON 8" ASPEN S68W 15.6' FROM POST - FOUND RUSTED OLD FSLP ON 14" BASSWOOD S26E 28.0' FROM OUR POST

CHAINED S86W TO E'1/16 BET. SEC'S. 5+8

FOUND ROSE'S CORNER - THIS DISTANCE 1290' WAS RIGHT ON CORNER - BOTH DISTANCE &amp; LINE

BELIEVE OUR POSITION FOR SEC. COR. IS AS GOOD AS IT CAN BE REESTABLISHED, CHECK

WITH KEN WHITEHORN TO SEE IF WE CAN MONUMENT

6/20/88 KW-CK-GR

SCRAPED GROUND FROM TAG ON BASSWOOD S27E 32.3' CENTER OF

TREE NO EVIDENCE FOUND NEED TO SURVEY IN.

KEN USED ABOVE INFORMATION FROM BASSWOOD WITNESS TIE TO RESTORE CORNER LOCATION

E-II QUARTER CORNER, BET. SEC'S. 4-9

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

TAM 10 N25E 54 LKS. 35.6'

BALSAM 8 S25W 24 LKS. 15.8'

F-8 2007 2300 1870

## E-13 SECTION CORNER TO SECTIONS 3-4-9-10

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST Fd. 2 OLD POST POINTS

AT CORNER POSITION

TAM. 12 S86E 6 LKS. 4.0'

Fd. TAM. STUMP & LOG IN SW. S86E 4.0' ROSE MAY HAVE CHOPPED OFF Fd. AXE MARKS ON PIECES

TAM. Y5 N34E 35 LKS. 23.1'

Fd. TAM. STUMP ROTTED &amp; BURNT N34E 19.6'

TAM. 10 S34W 6 LKS. 4.0'

Fd. TAM. STUMP BODY ROTTED S34W 4.0'

SPRUCE 7 N37W 30 LKS. 19.8'

NO EVIDENCE REMAINS AT BRG. CORNER

Notes by ROSE - 1927 FOLDER 14 PAGE 60

ROSE'S DISTANCE FROM 1/4 COR. EAST 2588'

FELL 10.42' SOUTH OF SEL. COR. 3-4-9-10

FOUND 3 BT'S, AND POINT OF OLD POST - SET NEW

POST 16 SOUTH OF OLD POST

CC CERTIFICATE FILED

9/14/85 CK-68

FOUND 3"X3"X10" LONG POST POINT AT 2590'E OF 1/4 4/9

AS PER JOHN ROSE'S CALLED DISTANCE - POINT OF POST WAS

IN GOOD CONDITION - FOUND 4"X4"X8" OLD POST POINT ON

NORTH SIDE OF OTHER POST - FOUND REMAINS OF THREE

TAM. BT'S, STUMPS - THEY ARE BADLY DECAYED &amp; BURNT

AT 1600'E OF 1/4 OUR LINE WAS 8' N OF ELW FENCE LINE

BRS S89E - AT 2400'E OUR LINE WAS BESIDE OLD FENCE

LINE - OUR LINE FELL 15' SOUTH OF CORNER, LOCATION

PLACE FSLP ON ASH 6 N13W - 10.3' NAIL &amp; TAG

PLACE BT TAG ON ASH 5 S50E - 5.75 " "

PLACE 4"X4"X8' DRY CEDAR POST BETWEEN OLD POST

POINT TO MARK CORNER POSITION

A LARGE CEDAR 16" N25E APPROX. 50' USE FOR LANDMARK

TO COME BACK INTO CORNER IN ASH AND THICK BRUSH SWP.

VERY WET AT THIS TIME


QUARTER CORNER BET. SEC'S, 3-4

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

HSPEN. 8 NBSE 18 LKS. 11.9'

HSPEN 11 S70W 12 LKS. 7.9'

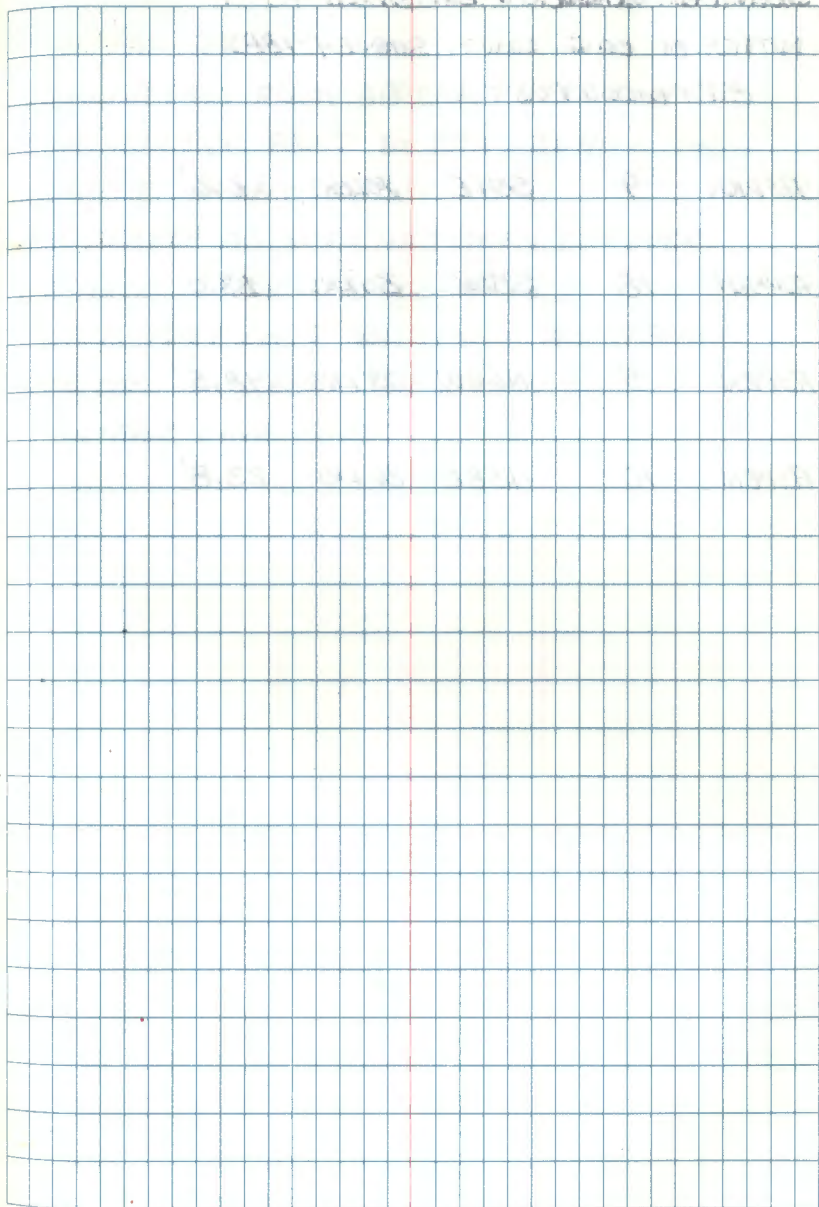

SECTION CORNER TO SEC'S. 3-4

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

FSPEN 9 S71E 10 LKS. 6.6'

FSPEN 18 S50W 50 LKS. 33.0'

FSPEN 5 N60W 28 LKS. 18.5'

FSPEN 10 N58E 36 LKS. 23.8'

12/19/90 GB-WS

CHAINED EAST FROM APPROX. 1/4 BET. 4433  
LINE RUN DUE EAST TO STA. 2640'E OR  
5280'E OF NW COR. SEC. 4

NO SEARCH AS AREA HAS BEEN CUTOVER

WE HAVE 12" SNOW COVER ALSO

PLACE FSLP ON 7" BASSWOOD AS APPROX.

SEC. COR. TO SEC'S. 3-4-33-34

CONTINUE LINE EAST



QUARTER CORNER BET. SEC'S. 3-10

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

SPRUCE 10 N4W 8 LKS. 5.3'

SPRUCE 10 S4E 22 LKS. 14.5'

01-9-2582 35 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

191 15880 17140000

G-13 QUARTER CORNER BET. SEC'S. 9-10

NOTES OF ORIG. GOVT. SURVEY 1882

SET WOOD POST

ASPEN 8 N8E 8 LKS. 5.3'

BASSWOOD 10 S8W 12 LKS. 7.9'

NOTES BY JOHN J. ROSE 1-4-27

FOLDER #14 PAGE 62

2687.2' SOUTH OF SEC. COR. 3-4-9-10 - 2688.5' SOUTH TO S.C.

W.OAK 10 N28°45'W 17.4'

6/21/88

SET ITASCA COUNTY MONUMENT

1"X30" ALUM. WITH CAP MARKED

TISON R27W

1/4

S9-S10

1988

WITNESSED BY

ROSE'S				
W.OAK	20	N20W	17.40'	TAG & NAIL
W.OAK	10	S25E	42.67'	MKD BT
W.OAK	6	N69W	65.38'	BT
W.OAK	5	S12W	46.64'	BT

CERTIFICATE FILED

11-2-83 CK-66

FD. JOHN ROSE'S OAK BT - LIVING WITH SCAR

FACING 1/4 COR. POSITION - NO IRON FOUND

TAGGED BT

6/21/88 KWCK GR

FD. 20" W.OAK WITH OLD FSLP + NEW FSLP + BT TAG - NEW DRIVEWAY

PUSHED NEAR CORNER LOCATION F4W - TRAILER HOME SITES IN FIELD

NE OF OAK BT - NO POST WAS FOUND IN EARLIER SEARCH BY SCRAPING

GROUND AT S20E 17.4'

QUARTER CORNER BET. SEC'S, 8-9  
 NOTES OF ORIG. GOV'T. SURVEY 1882  
 SET WOOD POST

TAM. 6 S60E 25 LKS

TAM 5 S17W 20 LKS.

NOTES BY JOHN J. ROSE 10/11/26

FOLDER #14 PAGE 49

FOUND OLD POST - ALSO NEW POST SET ABOUT  
 15 YEARS AGO E+W  $\frac{1}{4}$  LINE OF 8 HAS BEEN  
 RUN

SET SPRUCE POST 4X4 $\frac{1}{2}$  IN PLACE  
 OF DECAYED POST

BT. TO SEC. 8 DOWN

QUARTER CORNER BET. SEC'S. 15-16  
 NOTES OF ORIG. GOVT. SURVEY 1882  
 SET WOOD POST

BALM-OF  
 GILEAD 6 N66E 30 LKS. 19.8'

SPRUCE 10 N37W 44 LKS. 29.0'

874 CCC NOTES BY PAUL H AMONT 12-5-33

Fd. STAKE MARKED 44S-15 + 1/4S-16

Fd. ASPEN DEAD 12" MKD. S16 BT

NO FSLP

2-7-83 CK-JO

CHAIN LINE AND RUN NORTH FROM SW SEC. COR TO  
 SEG 15-2680' TO APPROX. 1/4 COR. POSITION  
 NO EVIDENCE FOUND. - CONTINUE CHAINING NORTH  
 TO SEC COR. 9-10-15-16 - 2680' IS 1/2 OF N+S  
 ROAD AND 1/2 OF CO. ROAD EAST  
 FROM END OF CHAIN <sup>FROM</sup> SOUTH - WE MOVE 140'E  
 AND ESTABLISH APPROX. 1/4 COR - PLACE FSLP  
 ON 7" BALMIE 11.0' NORTH OF TAG IS APPROX. COR.  
 TIES NOW FIT ROSE'S. TIE OF 100'E TO SWP.  
 AND 196' SOUTH TO CREEK E+W  
 EDGE OF HAY FIELD E+W - FIELD IS NORTH OF COR.  
 NO ORIGINAL EVIDENCE REMAINS

## SECTION CORNER TO SECTIONS 10-11-14-15

NOTES OF ORIG. GOV'T SURVEY 1882

SET WOOD POST

TAM. 10 N12E 4 LKS. 21.6'

TAM. 10 S15E 25 LKS. 16.5'

TAM. 8 S66W 54 LKS. 35.6'

SPRUCE 15 N26W 70 LKS. 46.2'

ORIG. TIE 5 LKS. WIDE  
4.20 CHS. = 277.2' WEST OF SEC. COR - GROSS CREEK

NOTES BY JOHN J. ROSE RLS 10-26

FOLDER #14 PAGE 72

FOUND STUMP OF BT'S, BEARING SAME AS ORIG.

NOTES, BUT DISTANCES DO NOT AGREE

5345.6' FROM NW COR TO SEC. 15

REC'D. 7/7/88  
GRATTAN CEMETERY NOTES FROM ITASCA COUNTY

FOUND GOV'T SPRUCE 15 N26W 46.2'

TAM. 14 S53E 78.7'

POST IN + GOV'T BT

2-7-83 GB-JA

CHAINED EAST ALONG COUNTY ROAD E+W  
FROM NW SEC. COR TO SEC. 15 2673 + 2673  
5346' TOTAL TO THIS CORNER - FENCE LINE  
NORTH - NO OTHER EVIDENCE - POST MAYBE  
IN ROAD FILL - NO ORIG. BEARING TREE  
EVIDENCE REMAINS - EST APPROX. POSITION  
IN  $\frac{1}{4}$  OF ROAD AND CHAIN SOUTH TO  $\frac{1}{4}$  BET.  
SEC'S. 14 + 15

NOTES FROM ITASCA COUNTY - ROAD SURVEY #74  
JUNE 1910 - NOTES + PLAT ON FILE

FROM EAST INTERSECT COR'S TO SEC'S. 10-11-14+15  
AT 80.25 CHS = 5296.5' - NO NEW BT'S.

RECORDED ON PLAT - CONTINUE WEST BET. SEC'S.  
10+15 TO 80.97 CHS. = 5344.02' TO SEC. COR.

TO SEC'S. 9, 10, 15 + 16  
= 290.4  
4.40 LKS. WEST OF SEC. COR. TO SEC'S. 10-11-14+15  
BROOK = 290.4' WEST OF CORNER

QUARTER CORNER BET. SEC'S, 10-11

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

ASPEN 10 N27E 18 LKS. 11.9'

WILLOW 14 S27W 10 LKS. 6.6'

QUARTER CORNER BET. SEC'S, 11-12

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

CEDAR 8 N31E 10 LKS. 6.6'

TAM, 4 N27W 15 LKS. 9.9'

874 CCC NOTES By L.W. JOHNSON 2/1/34

Fd. SCRIBED POST 3"X3"X28"

FSLP ON CEDAR POST 54 LKS = 35.64'

EAST OF CORNER

1973 CK-JP

CHAINED NORTH FROM EVIDENCE FOUND AT SEC. COR.

11-12-13-14 ALONG OLD R.R. GRADE 2680' TO FENCE

LINE CORNER - WIRE WEST + SOUTH - Fd. SQUARD POST

WITH TAG 50' WEST OF OLD GRADE - NO ORIG. EVIDENCE

COULD BE FOUND - OPEN FIELD TO WEST OF LINE

CONTINUE CHAINING NORTH TO EVIDENCE FOUND AT

SEC. COR. 1-2-11-12 - TOTAL DISTANCE FOR N 1/2 MILE

2800'

NORTH 1/16 CORNER BET. SEC'S. 13-14

NOTES OF ITASCA COUNTY SECTION SUBDIVISION

SECTION 13 BY P.C. WARNER 1928

PLATON FILE

SET IRON MONUMENT

8/24/78 CK BT

FOUND 1" OD. IRON PIPE MARKING CORNER - 10" BELOW  
SURFACE OF COUNTY ROAD # 26 - CHAINED FROM SEC.CORNER TO NORTH A DISTANCE OF 1334.6' FELL AT  
IRON PIPE - IRON (TOP) IS BENT WEST - CORNER IS 6.5'  
WEST OF CENTER LINEPUT FSLP ON 7 W. SPRUCE DUE EAST 47.5' FROM  
IRON PIPE IN ROAD



QUARTER CORNER BET. SEC'S. 13-14  
 NOTES OF ORIG. GOVT. SURVEY 1882.  
 SET WOOD POST

TAM 12 S66W 50 LKS. = 33.0'

TAM. 20 SITE 45 LKS. = 29.7'

NOTES OF ITASCA COUNTY SECTION SUBDIVISION  
 SECTION 13 By P.C. WARNER 1928  
 SET IRON MONUMENT

8/24/78 CK BT

FOUND 1" OD IRON PIPE MARKING CORNER 4" BELOW  
 SURFACE OF COUNTY ROAD #26 - CHAINED A DISTANCE  
 OF 1334.6' FROM IRON FOUND AT N<sup>1</sup>/<sub>16</sub> AND FELL  
 AT IRON PIPE - IRON IS IN CENTERLINE OF ROAD  
 PUT FSLP ON POWER POLE S22W 84.0' FROM  
 IRON PIPE IN ROAD - WET ON BOTH SIDES OF ROAD  
 435' SOUTH OF <sup>1</sup>/<sub>4</sub> CORNER TO CENTER OF BRIDGE  
 OVER WINDIGO CREEK

SOUTH 1/16 CORNER BET. SEC'S. 13-14

NOTES OF ITASC COUNTY SECTION SUBDIVISION  
SECTION 13 BY P.G. WARNER 1928

SET IRON MONUMENT

8/24/78 CK BT

FOUND 1" OD IRON PIPE MARKING CORNER - 6" BELOW  
SURFACE OF COUNTY ROAD #26 - CHAINED FROM  
IRON FOUND AT 1/4 CORNER TO NORTH A DISTANCE  
OF 1334.6' WHICH FELL AT IRON PIPE - IRON IS 4'  
WEST OF CENTERLINE

PUT FSLP ON S ASPEN N84E 42.5' FROM IRON  
PIPE IN ROAD

CONTINUED CHAINING DOWN ROAD AND TO EAST  
SIDE OF COUNTY ROAD #26 - DISTANCE OF 1334.6'  
AND CHECKED WITHIN 1.0' OF IRON BAR AT SEC. COR.  
SECTION CORNER IS IN EAST DITCH OF COUNTY ROAD

QUARTER CORNER BET. SEC'S, 23-24

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

TAM. 6 N10E 15 LKS. = 9.9'

TAM. 9 S20W 16 LKS. = 10.6'

NOTES BY JOHN ROSE RLS SEPT. 1927

FOLDER #15 PAGE 26427

TO REESTABLISH ABOVE 1/4 CORNER ROSE RAN LINE

BETWEEN SEC. COR'S, 13-14-23-24 AND SEC. COR'S,

23-24-25-26 AND AT MID POINT IN R.R. GRADE

A DISTANCE OF 2678.8 SET HUB FOR 1/4 COR.

NO EVIDENCE OF ORIG. POST OR BT'S, WAS FOUND

NOTES OF ITASCA COUNTY ROAD SURVEY 1919-1920

DORALAKE TO PINETOP BY O.J. LIDBERG

MARKED NEW BT'S,

CEDAR STUMP 8" S81E 19.4'

BALSAM 4" N72E 81.7'

874 BY L.W. JOHNSON 1-10-34

FD. BALSAM 4" N72E 81.7' SCRIBED S23 BT

FD. CEDAR STUMP 8" S81E 19.4' SCRIBED S24 BT

FSLP ON 8" FENCE POST ON W SIDE OF COUNTY ROAD

W.C. BEARS S72E 131 LKS. = 86.46'

CORNER IS 51 LKS. = 33.7' EAST OF WC IN CENTER OF TRACK

9-12-85 CK-JA-GB

SEARCHED FOR WC TO 1/4 COR. DETERMINED FROM CCC FSLP

ON FENCE POST - FROM POST WENT S66E-86.5' - NO

EVIDENCE OF POST WAS FOUND IN OLD R.R. GRADE N+ S

9-13-85 SAME CREW

FROM APPROX. SEC. COR. 23-24-25-26 WE TRAVERSE

ALONG ROAD NORTHERLY TO THIS LOCATION AND CONTINUE

TO IRON BAR AT NW COR OF SEC. 24 - OUR DISTANCE

WOULD BE 2673.8' FOR SPLIT OF 1 MILE

PLACE OLD CEDAR POST S66E-86.5' FROM CCC FSLP ON

CORNER POST ON EAST SIDE OF COUNTY ROAD #26

PLACE NEW FSLP ON POST BY CCC'S, FACING COUNTY ROAD

POST (CCC) IS 52' EAST OF ROAD, PLACED FSLP ON 10" BALSAM

S59W-10.2' FROM APPROX. 1/4 COR. BET. 23+24

PLACED 2" CEDAR HUB IN OLD R.R. GRADE AT APPROX.

CORNER - OLD SWAMP TRAIL RUNS WEST FROM THIS

APPROX. CORNER POSITION

## SECTION CORNER TO SEC'S, 24-25-23-26

NOTES OF ORIG. GOV'T. SURVEY 1882

## SET WOOD POST

ASPEN	10	N30E	15 LKS.	9.9'	} NO EVIDENCE REMAINS (85CK)
SPRUCE	9	S26E	13 LKS.	8.6'	
SPRUCE	8	S26W	15 LKS.	9.9'	
SPRUCE	9	N40W	16 LKS.	10.6'	

## ITASCA COUNTY ROAD SURVEY 1919

## SET WOOD POST

BALSAM	7	N8E	56.9'	} NO EVIDENCE REMAINS (85CK)
BALSAM	9	N9W	49.1'	
BALSAM	7	N37W	35.5'	
BALSAM	8	N68W	58.0'	

NOTES BY JOHN J. ROSE 1927 FOLDER 15 PAGE 26

SET OVER POST AND RAN RANDOM LINE NORTH

874 BY L.W. JOHNSON 1-10-34

FD. BALSAM POST GOOD CONDITION

FD. FOUR COUNTY B.T.S. RECORDED ABOVE AT BRG. 401ST.  
PLACE FSLP ON ASPEN 7" N70W 8 LKS. FROM CORNER

7-18-07 R. MAFFN

GPS IRON<sub>3</sub> CORNER 530' EAST OF Co Rd #26  
FSLP 14" BALSAM FROM WHICH CORNER IS EAST 500 FT

5/15/74 CK-BT + 8/17/78 CK

SEARCH AREA IN LIGHT SNOW COVER - NO EVIDENCE FOUND OF B.T.S.  
FOUND RUSTED TAG ON GROUND NEAR BASE OF ASPEN STUMP  
FROM STUMP & TAG WE MOVE 564E 5.3' AND SET 2" X 24" OAK  
STAKE AT APPROX. CORNER POSITION - PLACE FSLP ON 8" BIRCH  
STAKE 18.3' FROM OAK STAKE

9/13/85 CK-GB

SEARCH AGAIN IN AREA OF PREVIOUS SEARCH AREA - FOUND  
RUSTED TAG IN CENTER OF ROTTED 8" TO 10" ASPEN STUMP  
OAK STAKE SET AT APPROX. LOCATION IS GONE - WE RESET  
FROM FSLP ON BIRCH STAKE 18.3' - FOUND HOLE OR DEPRE-  
SSION WITHIN 6" OF WHERE OAK STAKE WAS - WE SCRAPPED  
GROUND WITH SHOVEL AND FOUND SQUARED 4" DARK AREA  
BELOW SURFACE AND AROUND HOLE - DUG 4" TO 6" BEFORE  
SQUARD AREA CHANGED TO TAPER IN LIGHTER SOIL  
DUG DOWN AND TAPER BECAME LESS AS A POST POINT  
WOULD CHANGE - PLACE PICKET IN DARK REMAINING  
TAPER AS SECTION CORNER, TRUE POSITION - ASPEN  
STUMP IS N70W 5.0' FROM PICKET

9/14/85 CK-GB

SET ELM STAKE 2" X 30" IN HOLE OR DISCOLORATION OF  
OLD POST AND MARKED TEMP TIES

W. OAK 6' N32E 43.0' SPIKE &amp; TAG

W. SPRUCE 13 S28W 40.4' " "

W. OAK 5 N19W 88.85' " "

FSLP ON 9 BIRCH NOW BRG. S77E 19.8' NOIL

SEE BOOK #3 PAGE 19 FOR MONUMENTATION

QUARTER CORNER BET. SEC'S. 23-26

Notes by Orig. Surveyor, King - 1882

Set wood post

Aspen 8 N23W 151ks. 9.9

Spruce 10 S14E 201ks. 13.2

Notes by J. J. Rose 1927-

Folder 15, page 23 OF SEC. COR. DISTANCE E 2630

Fd. post

Notes by CCC's (Sherman) 1934

Fd. post down and scribed.

Fd. pine 7" S34E 351ks. 23.1"

Scribed  $\frac{1}{4}$  S26BT. Put F.S.L.P.

on Pine BT

10-29-07 R. MAIN

Fd NEW COUNTY MONUMENT (2-10-99) AND TWO

ASPEN BTs. IRON IS S 27°W 2637 FT FROM

KRAUSE BRAMA TAG. I DID NOT HAVE CO

INFO. GPS IRON. IRON FLUSH W/ GROUND.

5/24/88 - CK, GB - Chained west county distance

2626.5 from SE sec. cor. 23. At end of line,

chained north to  $\frac{1}{2}$  of R.R. 343'. J. Rose call was

291', so searched for corner 50' north of our line.

Scraped ground for post, found no evidence. Fd.

rotton cut off balsam stp at approx. N23W 69'.

for possible co. BT. Fd. no evidence of original BT's.

Fd. no evidence of old CCC poster.

Placed F.S.L.P. on 7" Aspen N20E 8.6'

from 1" picket (dry spruce) marking approx.

corner position. Approx. corner position

falls 30' west of swamp and 125' north of  
grassy opening.

SECTION CORNER TO SECTIONS 22-23-26-27

Notes of Orig. Gov't Survey 1882

Set wood post

Aspen 10 N56E 12 lks. 7.9

Aspen 6 N64W 32 lks. 21.1

Aspen 5 S80E 40 lks. 26.4

Spruce 6 S46W 35 lks. 23.1

Notes by County Survey of 1919-

Plat on file

Found corner &amp; mkd. new BT'S

Spruce 10 N48W 35.8

Balsam 9 S11W 31.0

Spruce 15 S30E 42.8

Spruce - N7W 44.6

Notes by CCC's (Ames) - 1934

Fd. post scribed 4" x 4" x 30" high

Fd. Spruce 14" N4W 68 lks. scribed

Placed F.S.L.P. on it 44.8'

CERTIFICATE FILED

5/25/88 CKGB

From N 1/4 SEC. 26

CHAINED COUNTY DISTANCE OF 2626 OR ROSE'S 2630'

INTO AREA OF SEARCH - FD, LARGE SPRUCE STUMP NORTH  
OF OUR END CHAIN - USED THIS SPRUCE TO SEARCH FROM  
AS WE BELIEVE THIS STUMP IS COUNTY BT

SCRAPED GROUND AND FOUND TWO DARK AREAS IN SOIL

AND BELIEVE THESE ARE FROM POST POINTS

WILL BRING IREN WHITEHORN IN SOON TO LOOK AT EVIDENCE

NOW UNDER FS SIGN 54-9 TO PROTECT FROM WEATHER

PUT FSLP ON 13 BALMIE N76W-9.0'-5' PICKET NEAR COR.

APPROX. 230' W OF NEWLY PAINTED FIELD

Talked to Hugh Reiger, he states that Bob Schaar  
and himself found old CCC tag on a windfall  
spruce. Bob Schaar removed tag and placed  
on a Aspen approx. 15' west of spruce.  
We found rusty tag with Bob Schaar  
name.

6/8/88 GB, KW, TW, GR

Found large spruce stp and windfall 15'  
east of Aspen that had F.S.L.P. Scribe  
area rotted out, but found nail holes

on log where tag once was attached.  
Found <sup>we'll</sup> decayed post point after scraping  
ground and remains of all four Co. BT'S.

Tied in true corner position from position  
established 5/25/88. 8' south and 11' west.  
Contact Itasca Co. for monumentation. <sup>new</sup> 11' <sup>old</sup> 12'

QUARTER CORNER BET. SECS. 22-27

NOTES OF ORIG. GOV'T. SURVEY 1887

SET WOOD POST

SPRUCE 6 S57W 20 LKS. = 13.2'

SPRUCE 20 N62W 42 LKS. = 27.7'

QUARTER CORNER BET. SECS. 22-27

NOTES OF ORIG. GOV'T. SURVEY 1887

SET WOOD POST

SPRUCE 6 S57W 20 LKS. = 13.2'

SPRUCE 20 N62W 42 LKS. = 27.7'





SECTION CORNER TO SECTION 16-17-20-21

NOTES OF ORIG. GOVT. SURVEY 1882

SET WOOD POST

ASPEN 6 S60E 15 LKS. 9.9'

ASPEN 12 S7W 29 LKS. 19.1'

ASPEN 16 N24W 40 LKS. 26.4'

ASPEN 5 N60E 12 LKS. 7.9'

SECTION CORNER TO SECTION 16-17-20-21

NOTES OF ORIG. GOVT. SURVEY 1882

SET WOOD POST

ASPEN 6 S60E 15 LKS. 9.9'

ASPEN 12 S7W 29 LKS. 19.1'

ASPEN 16 N24W 40 LKS. 26.4'

ASPEN 5 N60E 12 LKS. 7.9'

QUARTER CORNER BET. SEC'S. 20-21  
 NOTES OF ORIG. GOVT. SURVEY 1882  
 SET WOOD POST

ASPEN 8 N15W 23 LKS. 1512'

J. PINE 6 N71E 50 LKS. 3310'

SECTION CORNER TO SECTIONS 20-21-28-29

NOTES OF ORIG. GOVT. SURVEY 1882

SET WOOD POST

BALSAM 14 S44W 18 LKS. 11.9'

SPRUCE 10 S3E 43 LKS. 28.4'

BALSAM 10 N37W 50 LKS. 33.0'

SPRUCE 8 N50E 50 LKS. 33.0'

SECTION CORNER TO SECTIONS 20-21-28-29

NOTES OF ORIG. GOVT. SURVEY 1882

SET WOOD POST

BALSAM 14 S44W 18 LKS. 11.9'

SPRUCE 10 S3E 43 LKS. 28.4'

BALSAM 10 N37W 50 LKS. 33.0'

SPRUCE 8 N50E 50 LKS. 33.0'

QUARTER CORNER BET. SEC'S, 21-28

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

ASPEN 5 N65W 5 LKS. 3.3'

ASPEN 6 S65E 15 LKS. 9.9'

874 CCC NOTES BY L.W. JOHNSON 1/23/34

Fd. POST 3" x 3" x 30" - IN GOOD CONDITION

Fd. OAK 10 N20E 10 LKS. = 6.60' SCRIBED


PLACE FSLP ON ASPEN 15" ON NE SIDE

OF TREE - CORNER BRS. N40E 12 LKS. = 7.92'

QUARTER CORNER BET. SEC'S. 27-28  
 NOTES OF ORIG. GOV'T. SURVEY 1882  
 SET WOOD POST

ASPEN 5 N44E 20 LKS. 13.2'


ASPEN 5 N72W 13 LKS. 8.6'

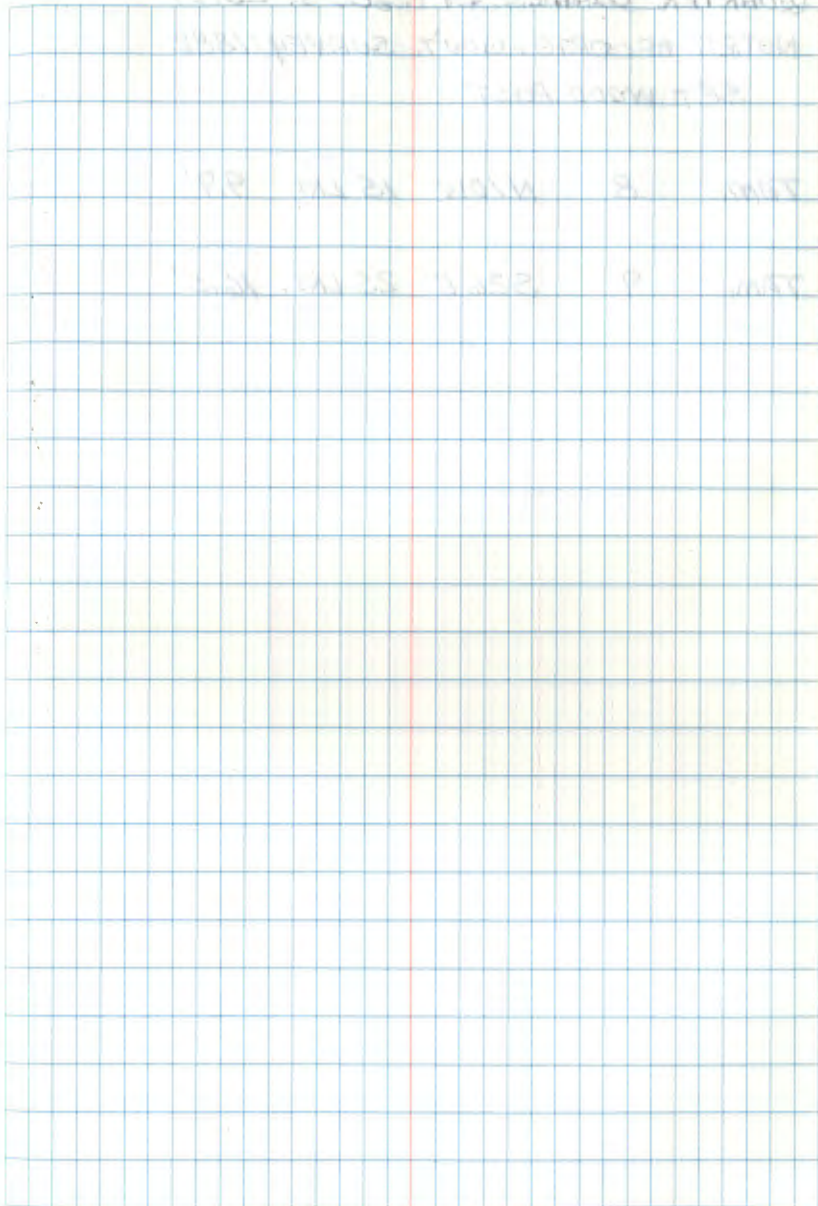

QUARTER CORNER BET. SEC'S, 28-29  
NOTES OF ORIG. GOV'T. SURVEY 1882  
SET WOOD POST


TAM. 8 N10W 15 LKS. 9.9'

TAM. 9 S26E 25 LKS. 16.5'

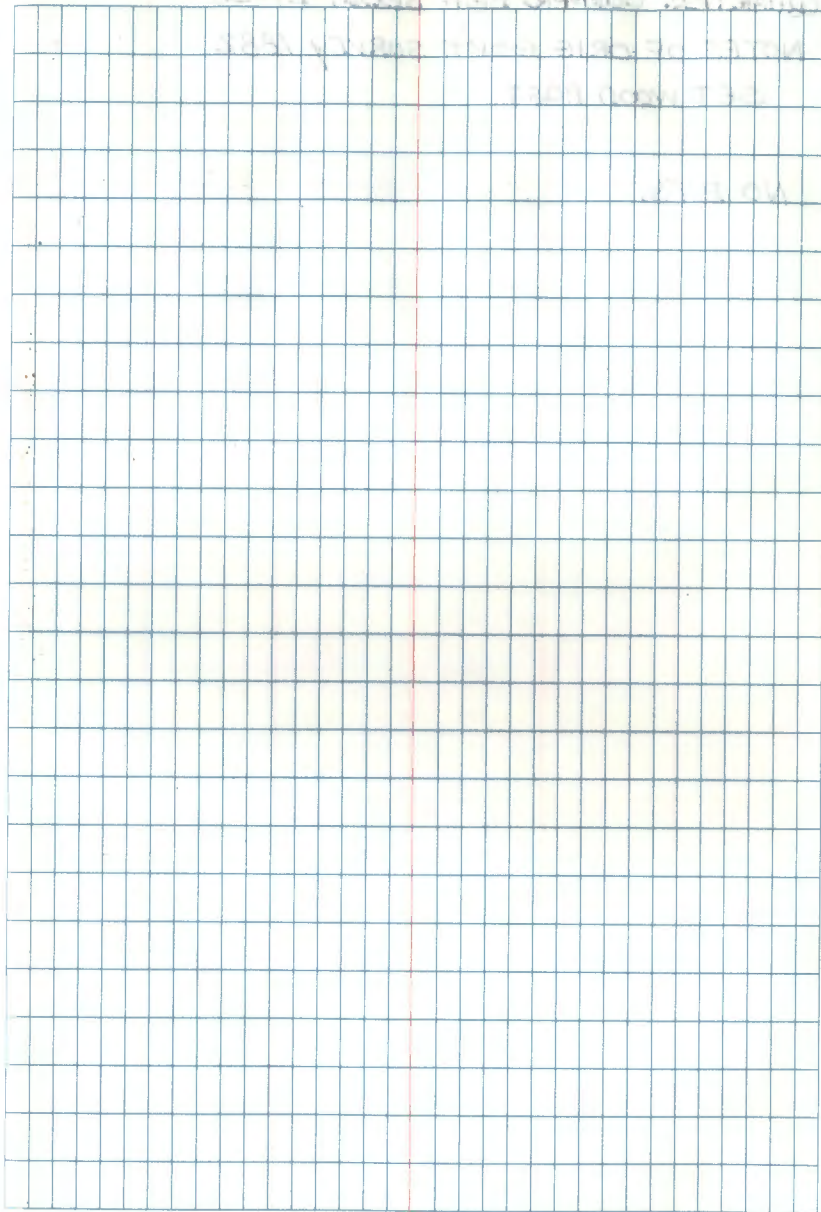

QUARTER CORNER BET. SEC'S. 29-30  
NOTES OF ORIG GOV'T. SURVEY 1882  
SET WOOD POST

NO BT'S.

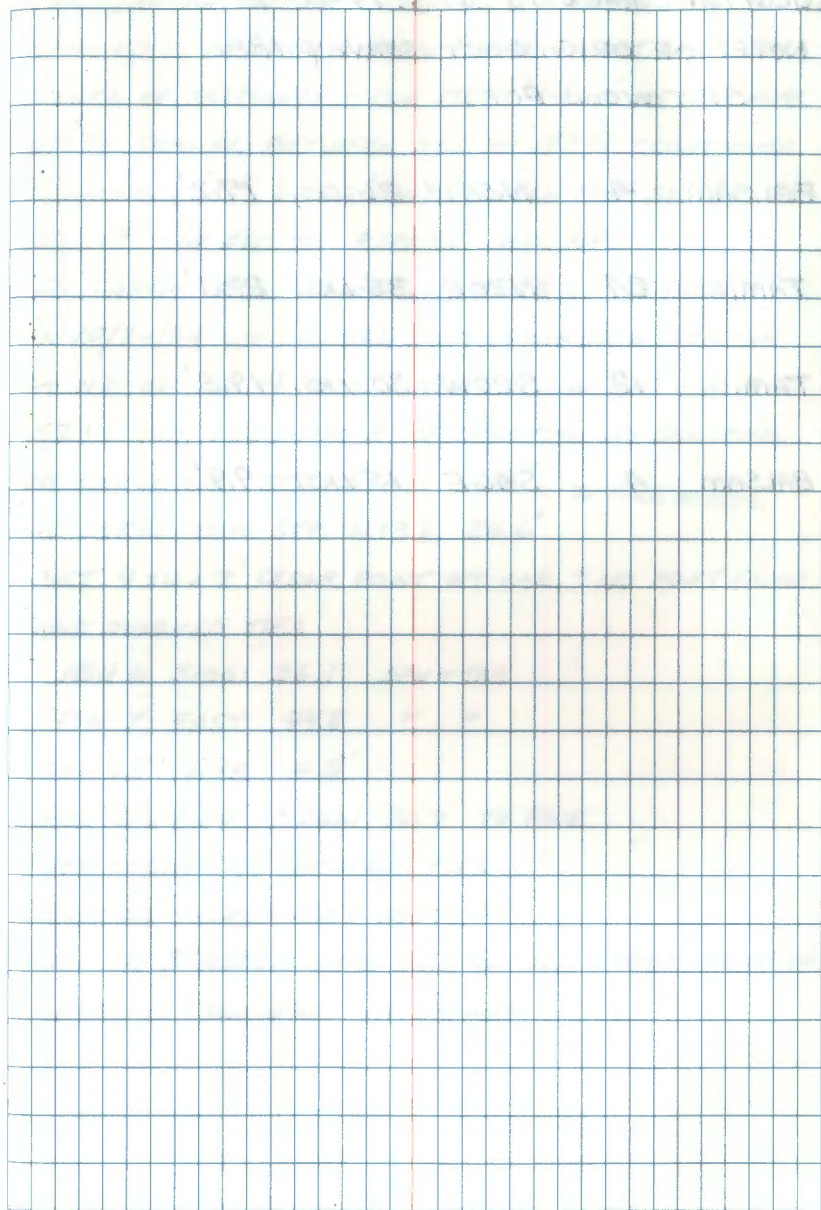

R-5 SECTION CORNER TO SEC'S, 19-20-29-30

NOTES OF ORIG. GOV'T SURVEY 1882.

SET WOOD POST

BALSAM 4 N55W 26 LKS. 17.2'

TAM. 24 N20E 35 LKS. 23.1'

TAM. 12 S20W 30 LKS. 19.8'

BALSAM 4 S46E 15 LKS. 9.9'

10/25/84 CK-68-JA

CHAINED FROM ORIG. SECTION CORNER LOCATION AT SW CORNER OF SECTION 19 - DUE EAST 2560' TO IRON PIPE AT  $\frac{1}{4}$  CORNER BETWEEN SECTION 19+30 - CONTINUED CHAINING EAST 2667' AND SEARCH FOR SE COR. TO SEC. 19 - IN OLD TAM & SPRUCE SWP. N45

FD. LARGE TAM. STUMPS IN AREA OF SEARCH ON 10/24/84 WE CHAINED SOUTH FROM ORIG. LOCATION AT NE OF SEC. 19 - LINE RUN AT S 2 W AND CHAINED 5230' AND FELL 140' E OF LOCATION AT SEC. COR. FD. LARGE TAM. STP. S10W 21.6' TO FACE OF STPS.

FD. LARGE TAM. STP. N13E 24.6'  
SET 4x4x7' CEDAR POST AT COR. - NO POST FOUND AND MARKED TIES

FISH 6 S10W 26.1 SPK + TAG

FISH 7 EAST 44.8 " "

FISH 13 N19E 4.5'

ROCK 6'x9'x4' S26W 70.7' TO FACE FROM CORNER TO HIGHLAND TIES


EAST 60' - NORTH 125' - SOUTH 70'  
FSLP ON 8" ASPEN ON E SIDE OF NEW FOREST ROAD N45 CORNER IS 360' EAST IN SWAMP



QUARTER CORNER BET. SEC'S, 19-20  
 NOTES OF ORIG GOV'T. SURVEY 1882  
 SET WOOD POST

SPRUCE 9 S10W 14 LKS. 9.2'

SPRUCE 6 S23E 20 LKS. 13.2'

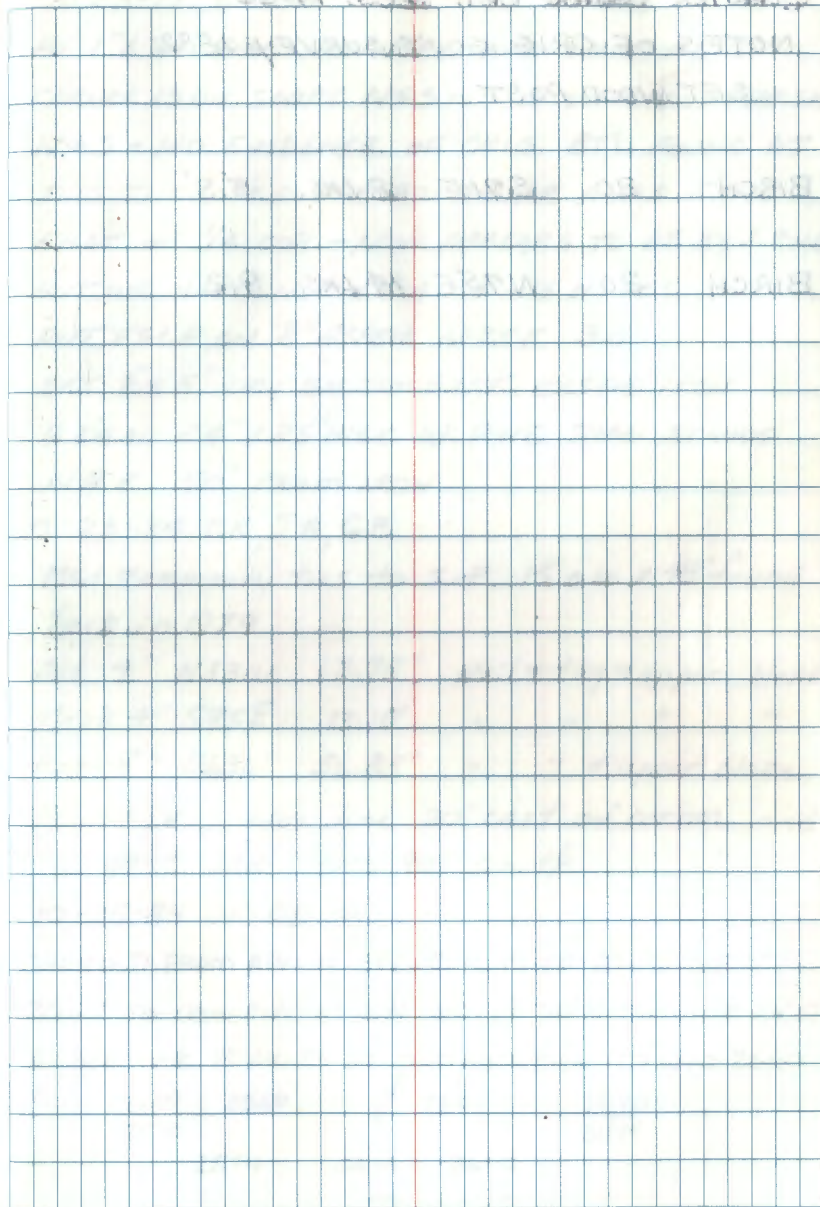

QUARTER CORNER BET. SEC'S. 19-30  
 NOTES OF ORIG. GOV'T. SURVEY 1882  
 SET WOOD POST

BIRCH 20 S71E 8 LKS. 5.3'

BIRCH 20 N75E 14 LKS. 9.2

10-23-79 CK-GB

FD. 1" X 24" HIGH IRON PIPE WITH UNION AT TOP  
 CORNER IS ON SLOPE N45-15'E OF GRASS MARSH  
 N45 - NO EVIDENCE OF ORIG. BT'S. FOUND AT  
 THIS TIME - OLD BLAZED LINE RUNS E+W  
 EAST OF 1/4 COR. - IRON APPEARS TO BE BY J. ROSE  
 BUT WE HAVE NOT LOCATED HIS NOTES

PUT FSLP ON 8" ASPEN N75E 3.0'

SET 2" X 5' DRY BALSAM POST BESIDE IRON

A DEAD 24" X 25' HIGH W. PINE SNAG STANDS

N8E 50' FROM IRON

10-23-84 CK, JA, GB

Mkd. temporary ties to I.P. 1 1/2" O.D. X 48' found  
 back in 1979.

Ash 4" N33W 13.75' Nail + tag upper blaze

Maple 4" S85E 13.10' " " " "

Ash 8" S63W 56.85' " " + upper blaze.

Found N-S blue line 20' east of corner and  
 a west blue line 90' south

10-25-84 CK-GB-JA

CHAINED FROM APPROX. SEC. COR 19-20-29-30 WEST  
 2667' TO IRON PIPE AT S 1/4 SEC. 19 - THEN CONTINUE WEST  
 TO SEC. COR. 19-24-25-30 DISTANCE CHAINED WAS 2560'

2419	2560'	2667'	1920
2530			3029


2574 ORIG. 2640

79.00 CWS.

QUARTER CORNER BET. SEC'S, 30-31  
 NOTES OF ORIG. GOV'T. SURVEY 1882  
 SET WOOD POST

ASPEN 10 N15W 20 LKS. 13.2'

ASPEN 9 S27E 14 LKS. 9.24'

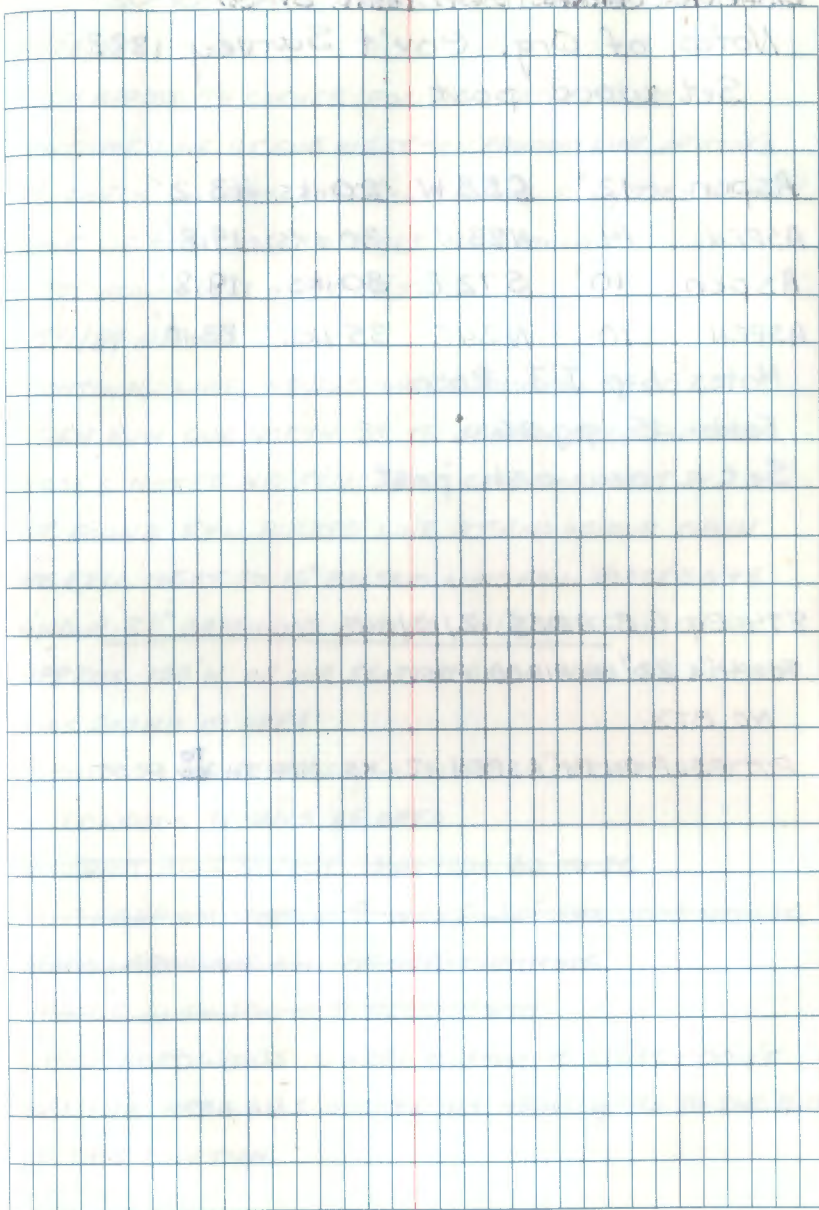

SECTION CORNER TO SECTIONS 29-30-31-32

Notes of Org. Gov't Survey 1882

Set wood post

Aspen 12° S53W 20 lks. 13.2'

ASPEN 14 N23W 30 lks. 19.8'

Aspen 10° S72E 30 lks. 19.8'

ASPEN 10 N34E 35 lks. 23.10'

Notes by J.J. Rose

Folder 15, pg. 86

Set a new ash post

874 By F.B. AMES 2/13/34

Fd. 4" x 22" SCRIBED POST

NO BT'S.

PUT FSLP ON 14" ASPEN 12 LKS. NORTH ~~OF~~<sup>TO</sup> POST

4/28/89 GB-CK

FROM APPROX. 1/4 CORNER POSITION BET. SEC'S. 29+32

CONTINUE LINE AT DUE WEST - ON RANDOM LINE OF ROSE'S  
TO CHECK TIE GOING WEST - WE BELIEVE BY TIES ALONG  
LINE WE ARE CLOSE TO ROSE'S RANDOM LINE  
TO STA. 4400' W - OUT OF TIME

5/11/89 GB-CK

CONTINUE LINE AT DUE WEST TO STA. 5520' W  
THEN RUN DUE NORTH 90' TO SEARCH AREA - AS PER  
ROSE'S NOTES HE FELL 88.6' SOUTH OF POST  
WE FOUND E+W BLAZED LINE AT END OF OUR CHAIN  
WE FELL NEXT TO 16" BALSAM WINDFALL BLAZED N+S  
AND A 21" BASSWOOD BLAZED ON (4) SIDES WHICH IS  
APPROX. 100' N OF OUR SEARCH AREA - NO TAG OR POST  
WAS FOUND IN AREA  
CORNER FALLS IN BALSAM WINDFALLS + BRUSH WITH  
HARDWOODS N-W-S OF AREA  
~~LOW WET AREA NW+SE IS APPROX. 60' TO SE~~  
~~PUT FSLP ON MAPLE 7 WEST 30' FROM OUR APPROX.~~  
~~SEARCH AREA AND END OF OUR CHAINING~~  
~~MAPLE WITH TAG IS BLAZED E+W~~  
LARGE HARDWOODS IN AREA MOSTLY TO WEST - DON'T  
BELIEVE AREA WAS BURNED AS HEAVILY AS TO THE EAST  
OF THIS LOCATION

SEE BOOK 3 PAGE 6 - CONTINUATION OF INFO

QUARTER CORNER BET. SEC'S, 28-33  
 NOTES OF ORIG. GOVT. SURVEY 1882  
 SET WOOD POST

SPRUCE 10 S17E 11 LKS. 7.3'

NEARLY LEVEL WELL ROTTED STUMP S18E - 7.3'

SPRUCE 20 N3W 30 LKS. 19.8'

LARGE ROTTED STUMP 24" HIGH AT NZW 19.8'

9/20/90 GB-CK + BLM CREW

BLM TRAVERSED INTO AREA FROM EAST

SEARCHED 2 HRS. FOUND LARGE ROTTED TAM. OR SPRUCE STUMP

AT NZW 19.8' AND WELL ROTTED TAM. OR SPRUCE STUMP

AT S18E 7.3' NO POST FOUND - AREA WAS LOGGED

OVER YEARS AGO

SET ITASCA COUNTY MONUMENT - FLUSH WITH SWAMP

CAP MARKED

TISON R 27W

1/4 S28

S-33

1990

WITNESSED BY

RLS 14677

ASH 5 S87W 49.3' MKD 1/4 S33 BT

ASH 6 S2E 30.6' " " " "

ASH 7 N81/2E 77.6' " " " "

8' STEEL SIGN POST DUE WEST 3.0' WITH 54-9

IN BALME - ASH - SWALE LOWLAND

# CERTIFICATE FILED

11/17/03 - G. Brama found monument with  
 cap set 4" above ground & leaning SE.  
 Found all 3 ash BT's marked in 1990.  
 Ash tree S2E at 30.6' is dead. This  
 corner was G.P.S. today.

## QUARTER CORNER BET. SEC'S, 26-35

Notes of Orig. Gov't Survey 1882

Set wood post

Birch 12" N7W 81ks. 5.3.

falls in field

J. Pine 15" S53W 301ks. 19.8

falls in field

Notes of County Survey - 1919

Fd.  $\frac{1}{4}$  Sec. cor.

Set post and mkd. BT'S

Spruce 10" N85E 52.3

No evidence

Birch 4" S50W 56.9

Falls in field.

FOLDER #15 PAGE 18+19 FROM SEC. COR NW OF SEC. 35

EAST TO  $\frac{1}{4}$  BET. SEC'S, 26+35 - DISTANCE OF 2634.9'SAME FOLDER PAGE 19 FROM THIS  $\frac{1}{4}$  COR. SOUTH ALONGCENTER OF ROAD A DISTANCE OF 5198.1' TO S  $\frac{1}{4}$  SEC. 35

1/10/34

CCL'S 874 says L.W. Johnson found both

county BT'S; Birch 6" S50°W 56.9'

and Spruce 10" N85E at 52.3. Placed

metal poster on 5" Balsam on west side of

road S70W.

5/26/88 - CK, GB

Occupied the C/4 sec 35 with a theodolite and backsighted south quarter sec. 35, turned county angle  $180^{\circ}46'$ . With E.D.M. measured 5222' and set a 60D spike 3" below road surface for approx. north  $\frac{1}{4}$  of sec. 35.

Spike is set approx 1.75' east of  $\frac{1}{2}$  of N-S county road, No evidence of original or county BT'S. Placed F.S. L.P. on 7" Balsam of Gilend, S86E, 41.4'.

10-29-07 R MAIN

GPS IRON (REBAR/W/PLASTIC CAP) IN  $\frac{1}{4}$  CO RD.

REBAR SET BY XTASCA COUNTY 6/8/2000

TAG ON POWER POLE N86W 32086 FT TO

SPK ON NORTH SIDE OF POLE UP 1 INCH.

TIE BY ICDSM.


QUARTER CORNER BET. SEC'S. 25-36

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

ASPEN 3 N23W 30 LKS. 19.8'

NO OTHER TREE NEAR

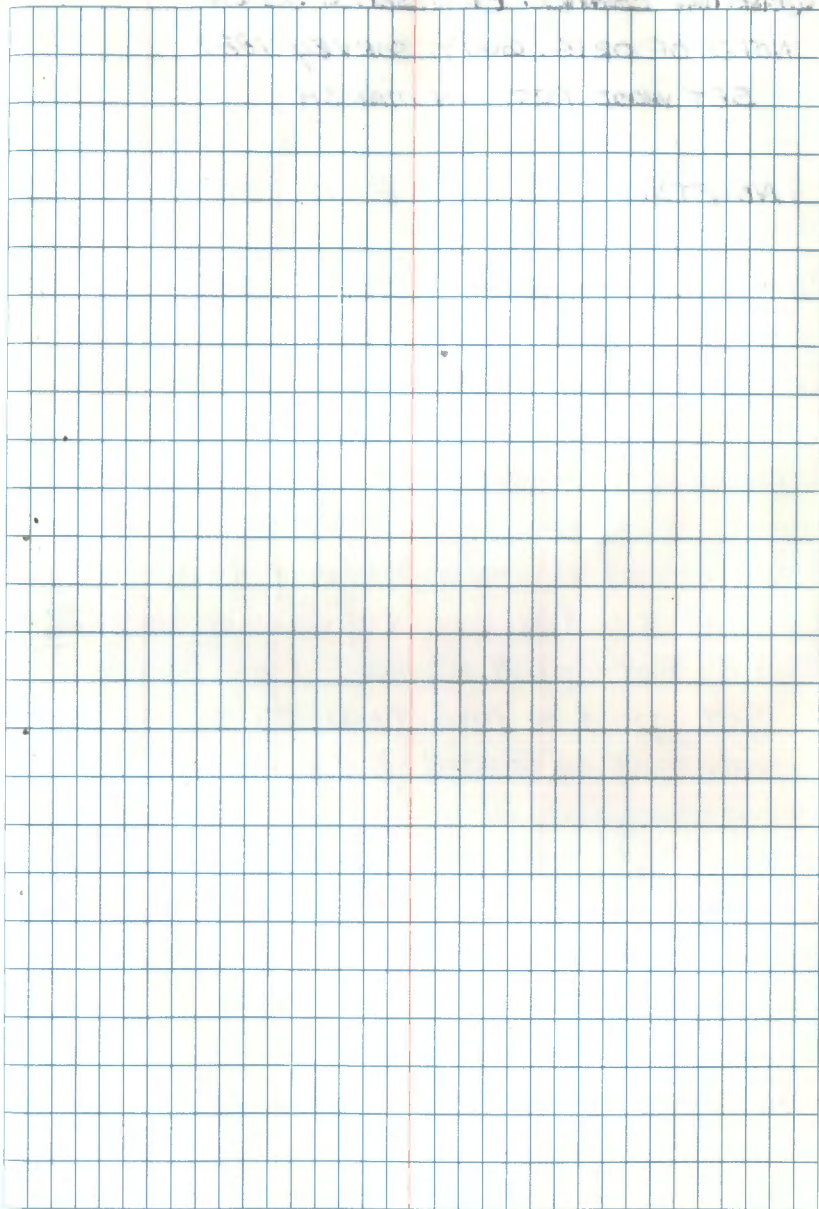





SECTION CORNER TO SECTIONS 35-36, 1, 2

Notes of Orig. Gov't Survey 1875

Set Tam. post 4" x 5"

TAM 7 S38E 291ks. A.14A

1928 Fd. no evidence

Spruce 6 N13W 131ks. 8.58ft

NOTES BY ITASCA COUNTY 1919 FOUND ABOVE BT - <sup>1927</sup> Fd. no evidence

Spruce 7 S6W 261ks. 17.16ft

Spruce 7 N2E 341ks. 22.44A

Notes of County Survey, 1919 -

Plat on file <sup>1/4 EAST TO SEC. COR.</sup> COUNTY DISTANCE 2584.4

Fd. Cor. post

Set post &amp; mkd. new BT'S

Spruce 5 S23W 57.2

1927 Fd. rotted spr. stp. S31W 57.2. Fd. burnt blaze with <sup>placed 60d spike</sup> scribble

Spruce 5 S12E 72.9

88' Fd. ROTTED STUMP AT DUE SOUTH 72.9' 6/22/88 CK  
Fd. no evidence. Area is still frozen underneath

Spruce 5 N71E 25.7

88' Fd. rotted spr. stp. N79E 25.7. Placed 60d spike

Spruce 5 N53W 31.7

Fd. rotted spr. stp. N45W 31.7' Placed 60d spike

NOTES BY ED. CHRISTENSEN &amp; JOHN J. ROSE 1927

FOLDER 15 PAGE 31

SET OVER POST AT SEC. COR. 1-2-35-36 AND RAN LINE

NORTH BET. SECS. 35+36 - PAGE 33 RERUN LINE NORTH

874 CCC NOTES BY H. ADAMS 7/16/34

FOUND SPRUCE POST 30" HIGH FAIR CONDITION (NO FSLP)

FOUND SPRUCE 8 N40W 48 LKS. MKD S36 BT

SPRUCE 5 N30E 60 LKS. + SPRUCE 8 S52W 85 LKS.

5/18/88 - CK, GB Chained east from So. 1/4 sec. 35  
county dist. of 2584'. Found evidence of 3 countyBT'S and 2 post points set from BT'S. Found  
<sup>old</sup> a 3" x 5' long squared post laying under moss.Fd. FSLP on 5" Black spruce N26E at 6.2  
from post points.Set a hard and dry 3" x 8' long, squared  
tam. post on north side of post points.Reset old 3" x 5' squared post on east side of  
corner. Placed 60d spike in post point making corner.

Mkd. BT'S: 5/18/88

1. Tam 7" S62E 44.60' Mkd. T149N R27S1 BT

2. Tam 4" S87W 13.50' Tags and 20d galv.

High ground approx. 125' east of corner.

Corner falls 650' west of high ground in Blk. Spruce

Chained distance checked within 2' of county and  
line was approx. 25' north.

## MOOSE LAKE

MEANDER CORNER WEST SHORE, BET. SEC'S, 7-18

NOTES OF ORIG. GOVT. SURVEY 1882

SET WOOD POST

BALSAM 8 S28W 15 LKS. 9.9'

BALSAM 8 N45W 13 LKS. 8.6'

NOTES BY JOHN ROSE - 1927

FOLDER #13 POSITION BY TRAVERSE Pg. 78

TIES Pg. 92 -

SET OAK POST 4" X 4"

BALMIE 5 S44W 9.3'

BALMIE 12 S12E 17.3'

12-30-83 CKJA-GB

CHAINED FROM APPROX. N<sup>1</sup>/<sub>4</sub> SEC. 18. LINE RUN AT

N85E - MEASURED 495' AND SEARCH AREA FOR

EVIDENCE OF ROSE'S CORNER - NO EVIDENCE

COULD BE LOCATED AT THIS TIME. WE NOW HAVE

16" SNOW COVER AT LOCATION - SET 2" X 7'

ASH POST AS APPROX. COR. - PLACE FSLP

ON 13" ASH S3E - 20.0' FROM ASH POST

CHAINED FROM E MC ACROSS LAKE, ROSE'S, DISTANCE

OF 1145' OUR CHAIN WAS WITHIN 2'

ROSE'S DISTANCES FROM N<sup>1</sup>/<sub>4</sub> SEC. 18 EAST  
TO WEST MC 495.1 - DISTANCE FROM WEST  
MC ACROSS MOOSE LAKE TO EAST MC 1145.9'

QUARTER CORNER BET. SEC'S. 7-18

CORNER IN LAKE

NOTES BY JOHN ROSE - 1927

FOLDER #13 Pg. 78+79

SET POST AND PILED ROCK AROUND IT

NO BT'S. NEAR

12-21-83 CK-GB-JA

WE CHAINED AND RAN LINE FROM ROSE'S SEC. COR.  
ON RANGE LINE TO SECTIONS 7-12-13-18

LINE RUN AT N88E - AND CHAINED 2453'E

260'E ENT. BEAVER POND NW-SE

1170'E LV. " " NE-SW

1915'E WOODS TRAIL NE-SW

2453'E MARK POSITION ON OUR LINE AND SEARCH

AREA FOR  $\frac{1}{4}$  COR. POST BY ROSE

CHECK ROSE'S TIES TO SOUTH OF  $\frac{1}{4}$  COR. AND FOUND

OUR LINE WAS TOO FAR SOUTH - FROM OUR END

STATION 2453' - WE RAN NZW - 125' AND ESTABLISHED

APPROX.  $\frac{1}{4}$  COR. IN OPEN FIELD - WE NOW CHAINED SOUTH

TO LOOK FOR CN $\frac{1}{16}$  SEC. 18 BY ROSE AT A DISTANCE OF

1345' - NO EVIDENCE COULD BE FOUND OF ROSE'S COR.

AT CN $\frac{1}{16}$  SEC. 18 - WE WALK BACK TO APPROX. N $\frac{1}{4}$

SEC. 18 AND SEARCH AGAIN IN AREA - BUT APPEARS AREA

WAS FLOWED YEARS AGO - NO EVIDENCE OF POST OR

ROCK PILE COULD BE FOUND - WE NOW CHECK ON  
W. MC BY ROSE ON WEST SHORE OF MOOSE LAKE  
12-30-83 CK-JA-GB

CHAINED N85E - 495' FROM APPROX. N $\frac{1}{4}$  LOCATION  
TO SEARCH FOR WEST MC BY ROSE - DIDN'T FIND MC  
AT APPROX. N $\frac{1}{4}$  SEC. 18 - SET 2" ASPEN PICKET  
AT APPROX. CORNER - IN OPEN FIELD - PLACE  
FSLP ON 8" ASH S2E 45.0' FROM PICKET - S-S

WILL RUN N45  $\frac{1}{4}$  LINE SEC. 18 SOON TO CHECK  
DISTANCE

6-7-91 CK-GB-JA

CHAINED FROM APPROX. CS $\frac{1}{16}$  SEC. 18 - WHICH WAS  
CHAINED NORTH FROM S $\frac{1}{4}$  IN WINTER AS S $\frac{1}{4}$  IS  
IN IMPOUNDMENT WHICH IS FLOODED WITH 2' TO 3' OF WATER  
LINE WAS RUN & CHAINED FROM APPROX. CS $\frac{1}{16}$  TO C $\frac{1}{4}$  TO CN $\frac{1}{16}$   
TO N $\frac{1}{4}$  SEC. 18

OUR LINE FELL 8' TO 10' EAST OF 1983 POSITION AND TOTAL  
DISTANCE FELL 14' NORTH OF 1983 POSITION

CENTER EAST 1/16 CORNER IN SEC. 18

NOTES BY JOHN J. ROSE 1927

FOLDER 13 PAGE 88

SET SPRUCE POST 3x4 (PEELED)

SPRUCE 4 S18W 13.7'

SPRUCE 5 N21E 11.6'

12-12-83 GB-JA

CHAINED FROM 1/4 BET. SEC'S. 17+18

ROSE'S DISTANCE 1235.6' - LINE RUN AT S88W

FOUND 1" WOOD POST N25E - 13.7' FROM

ROSE'S. BT - FD. SPRUCE 8. S25W - 13.7'

SCAR CLOSED - NO EVIDENCE AT THIS TIME

OF OTHER BT TO NE

SET 2"x8" TAM POST IN PLACE OF 1" WOOD

POINT - PLACE 1" WOOD POINT AT SOUTH EDGE

OF 2" TAM POST

MARKED TIES TO 2" POST

ASH 5 N74W ~~8.1~~ <sup>51.1</sup> LOWER BLAZE ~~POINT~~

BLK. SPR. 7 S28E 10.0' MKD BT

CORNER FALLS APPROX. 30' SOUTH OF NORTH

EDGE OF SPRUCE + ALDER SWAMP - 60' E

OF WEST EDGE OF SWP. + 70' WEST OF EAST

EDGE - LINE AT S88W FIT GOOD + DISTANCE

WAS GOOD - LINE WAS VERY ROUGH WITH  
STEEP RIDGES

1235.65' BETWEEN CE 1/16 AND C 1/4 + E 1/4  
2471.3' C 1/4 TO E 1/4


QUARTER CORNER BET. SEC'S. 17-20

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

BALSAM 8 S85W 23 LKS. 15.2'

BALSAM 10 N48W 36 LKS. 23.8'

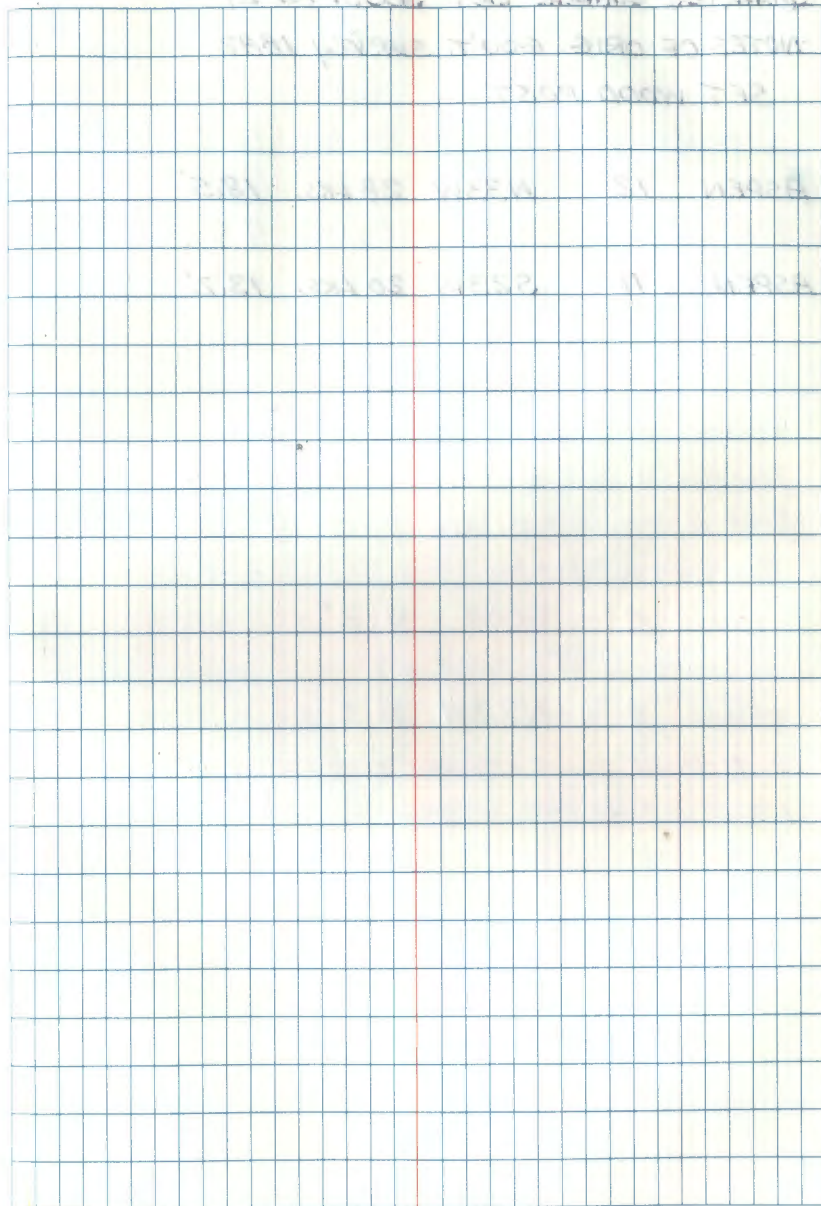


QUARTER CORNER BET. SEC'S. 16-21

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

ASPEN 12 N33W 28 LKS. 18.5'

ASPEN 11 S23W 20 LKS. 13.2'

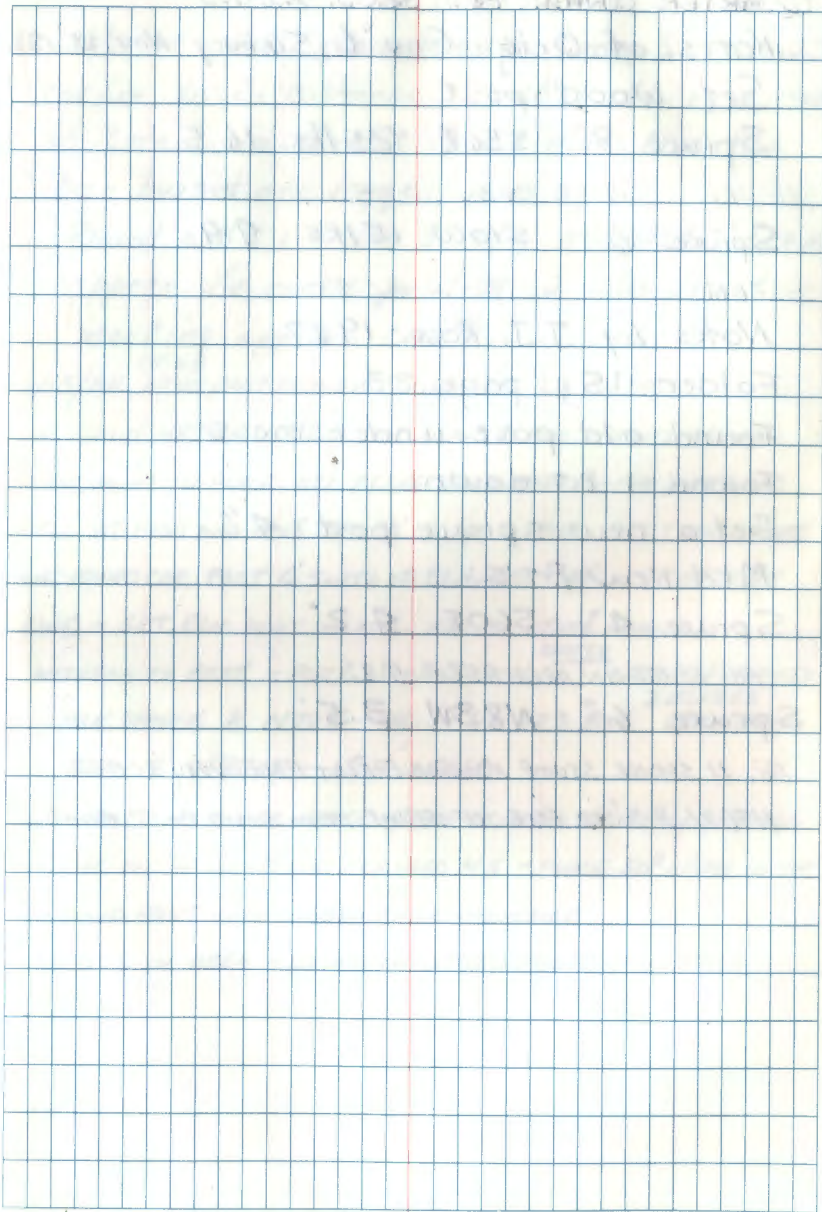

QUARTER CORNER BET. SEC'S. 22-23

Notes of Orig. Gov't Survey Nov. 13, 1882

Set wood post

Spruce 8" S56E 251ks. 16.5

Spruce 6 S10W 151ks. 9.9

Notes by J.J. Rose 1927

Folder 15, page 23

Found old post under moss

Found 1 BT down

Set a new spruce post 4"

Mkd. New BT'S:

Spruce 4" S60E 4.2'

Fd. ROOTS IN AREA S52E 4.2'

Spruce 6" N83W 3.5'

Fd. 11 SPRUCE STUMP POSSIBLE FLAT FACE, VERY ROTTED

N76W 3.5' TO FACE OF STUMP FROM SOLID POST POINT

5/25/88-CK, GB chained north from SW sec. 23 corner Rose's distance of 2684. Fd. no evidence of corner position at this time. Area has been burned and logged years ago.

Placed a F.S.L.P. on 3" elm N66W 15.7' from approx. 1/4 corner position. 2" elm picket marking approx. corner.

6/15/88 <sup>CK-GB</sup> FROM POST FOUND AT CWN/16 SEC. 23 BY ROSE

WE CHAIN N89°W - 1288.5' AND FOUND 2 POST POINTS & SMALL

STAKE POINT IN PLACE ALL BESIDE SOLID POINT - OUR DISTANCE

FELL AT POST AND LINE WAS 3' SOUTH - FROM POSITION ABOVE

WE FOUND COR. POST 6' SOUTH OF ELM. POST 4' WEST OF FIRST

LINE - SET ELM. POST AT COR. BESIDE OTHER POINTS

WITNESS TO POST - PIECE OF CAST IRON <sup>SHARP</sup> BESIDE W. OF POSTS

BLK. SPRUCE 8 N78E - 46.2' 1/4 S23 BT <sup>2 BLAZES</sup> SPK + TAG

ELM 3 N44W - 15.4 FSLP

SOLID POST WAS UNDER ALDER CLUMP LEANING WESTERLY - A PIECE OF THE TOP OF POST WAS SCRIBED 45 - PLACE 50<sup>d</sup> SPIKE IN TOP OF SOLID POST WITH SCRIBED PIECE ALONGSIDE

NO BT'S IN AREA - BRING IN STEEL POSTS FOR TIES


QUARTER CORNER BET. SEC'S, 26-27

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

SPRUCE 18 N66E 5 LKS. 3.3'

SPRUCE 15 N55W 6 LKS. 4.0'

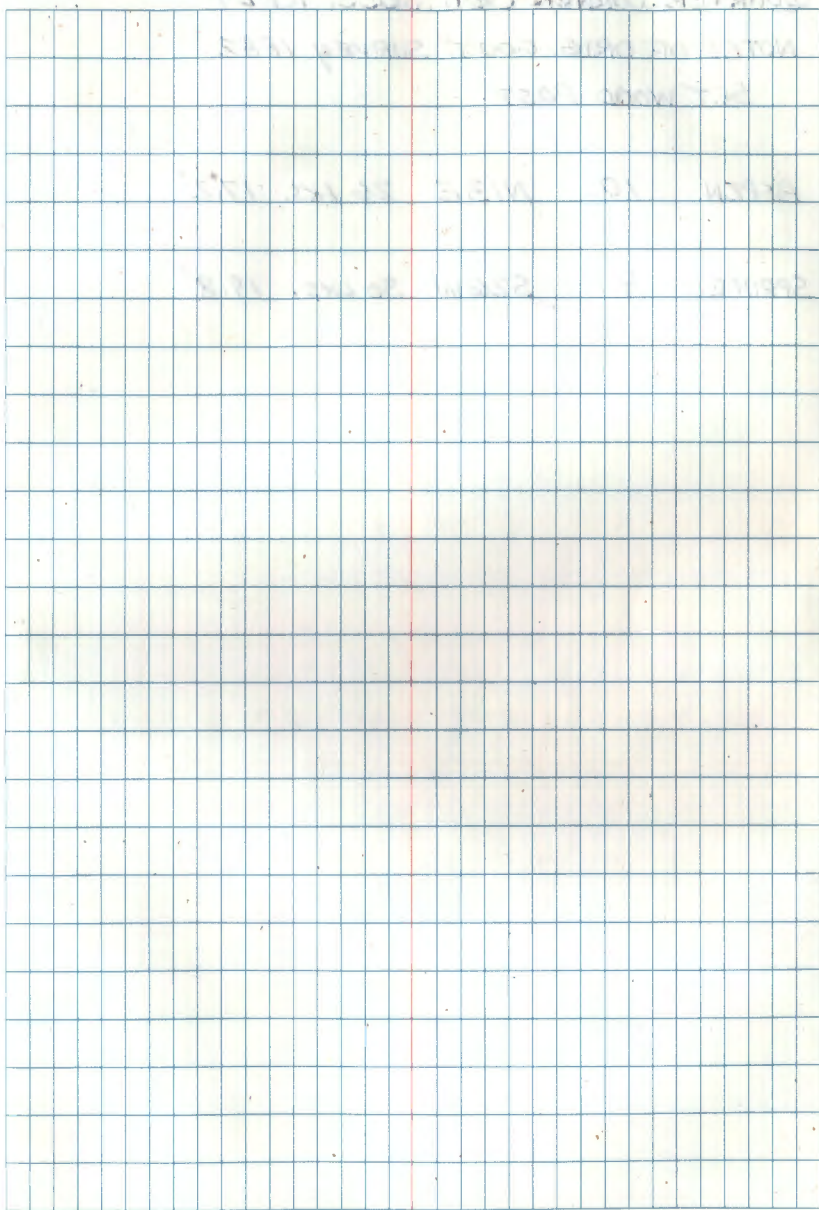




QUARTER CORNER BET. SEC'S. 13-24

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

ASPEN 10 N13E 26 LKS. 17.2'

SPRUCE 9 S26W 30 LKS. 19.8'

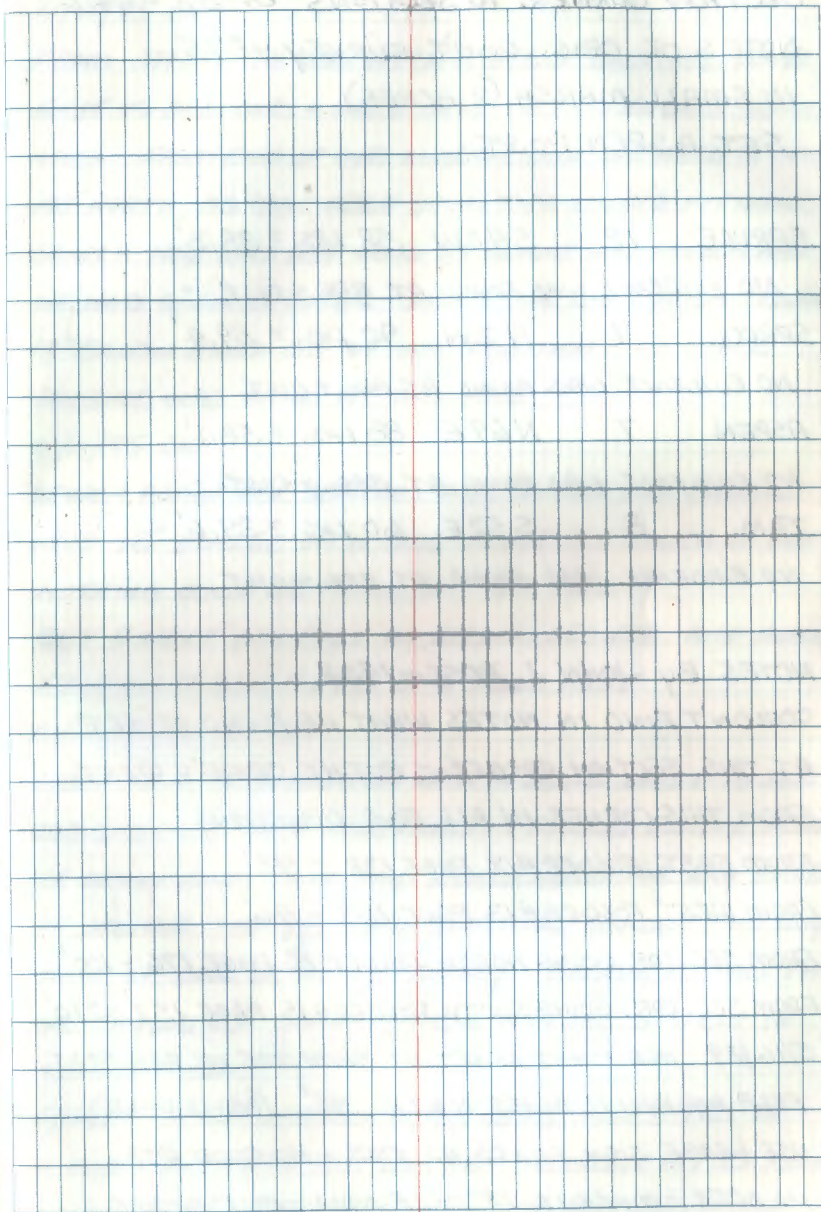

SECTION CORNER TO SECTIONS 31-32-546

NOTES OF ORIG. GOVT SURVEY 1875

IN SMALL MARSH (2 ACRES)

SET ASPEN POST

SPRUCE 12 S40W 58 LKS. = 38.3'

NO EVIDENCE WAS FOUND AT BRG. + DIST.

SPRUCE 9 N2W 90 LKS. = 59.4'

NO EVIDENCE WAS FOUND AT BRG. + DIST.

ASPEN 7 N69E 88 LKS. = 58.1'

NO EVIDENCE WAS FOUND AT BRG. + DIST.

TAM. 8 S52E 60 LKS. = 39.6'

NO EVIDENCE WAS FOUND AT BRG. + DIST.

NOTES BY JOHN J. ROSE 1928

COULDN'T FIND IN NOTES WHAT HE FOUND OR SET

AT THIS SECTION CORNER - BUT HE CAME & WENT

FROM THIS CORNER IN ALL FOUR DIRECTIONS

FROM EAST FOLDER #13 PAGE 138 - 48'

FROM WEST FOLDER #13 PAGE 162 - 46'

FROM SEC. COR. GOING NORTH FOLDER <sup>13</sup>~~15~~ PAGE 176 - 100'

FROM SEC. COR. GOING SOUTH FOLDER #15 PAGE 152 - 210'

\* 5/16/89 OLD POINT IS SET AT SOUTH SIDE OF ASH POST

FLSP ON ASH 11 BEARS N62E 45' (ASH IS DEAD)

USE LARGE SIGN POSTS AS TIES - NO GOOD BTS.

IN AREA - MUCK IS 18" DEEP NOW - BUT SWAMP

BOTTOM IS SOLID - NEED DIGGERS FOR IRON MONUMENT

CORNER AT N END OF BEAVER POND - WALK IN FROM NORTH

SEE BOOK #3 PAGE 5 FOR MONUMENTATION

11/10/75 CK

FROM APPROX. 1/4 COR. AT N 1/4 SEC. 6 CONTINUE LINE EAST TO SEC. COR. - USED ORIG. TIES TO LOCATE SEARCH AREA - FROM END OF OUR LINE & CHAIN, WE NEED TO MOVE 100' NORTH, AS THIS AREA ORIG. TIES WOULD FIT CALLS SEARCH NOW WAS NOT GOOD AS SWAMP WAS FROZEN AND WE HAD 6" SNOW COVER - FOUND TAM. LOG LYING IN SWAMP 12" BELOW MOSS SE OF OUR POSITION - NO OTHER EVIDENCE WAS FOUND AT THIS TIME

11/11/75 CK

SEARCH AGAIN FOR SEC. COR. AND FOUND OLD BALMIE STUB 12" BLAZED ON N SIDE ABOUT 25' SOUTH OF POST NOTHING COULD BE FOUND AT THIS TIME SET 4X4X7' ASH POST AS APPROX. SEC. COR. AND PLACE FLSP ON 11 ASH N84E 31.0' FROM POST

10/16/85 CK-GB-JA


CHAIN FROM ORIG. POSITION OF N 1/4 SEC. 5 WEST TO SEC. COR. LOCATION - AREA NOW FALLS IN FLOODED BEAVER POND WE DRAIN DOWN POND AND SEARCH AGAIN FOR ANY EVIDENCE OF SEC. COR. - AFTER 2 HRS. SEARCHING COULDN'T FIND ANYTHING OF ORIG. OR ROSE'S SURVEY - BELIEVE AT THIS TIME WE SHOULD RUN TRAVERSE FROM N 1/4 SEC. 5 WEST TO TOWNSHIP CR.

5/16/89 CK-GB SEARCH AGAIN USING ROSE'S TIES IN 4 DIRECTIONS - ASH POST WAS SET ACCORDING TO TIES FROM SEARCH IN 85 - SEARCH AROUND ABOVE POST AND FOUND POINT OF OLD POST 4" X 12" AND ANOTHER FLAT PIECE OF POST LYING IN MUCK 5' NE OF ASH POST - BELIEVE POST POINT IS ROSE'S POST POINT TIED TOGETHER WITH RIBBON FLUSH WITH SWAMP \*CONT.

QUARTER CORNER BET. SEC'S. 20-29  
NOTES OF ORIG. GOVT. SURVEY 1882  
SET WOOD POST

TAM. 6 N62W 6 LKS. 4.0'

TAM. 9 S62E 5 LKS. 3.3'

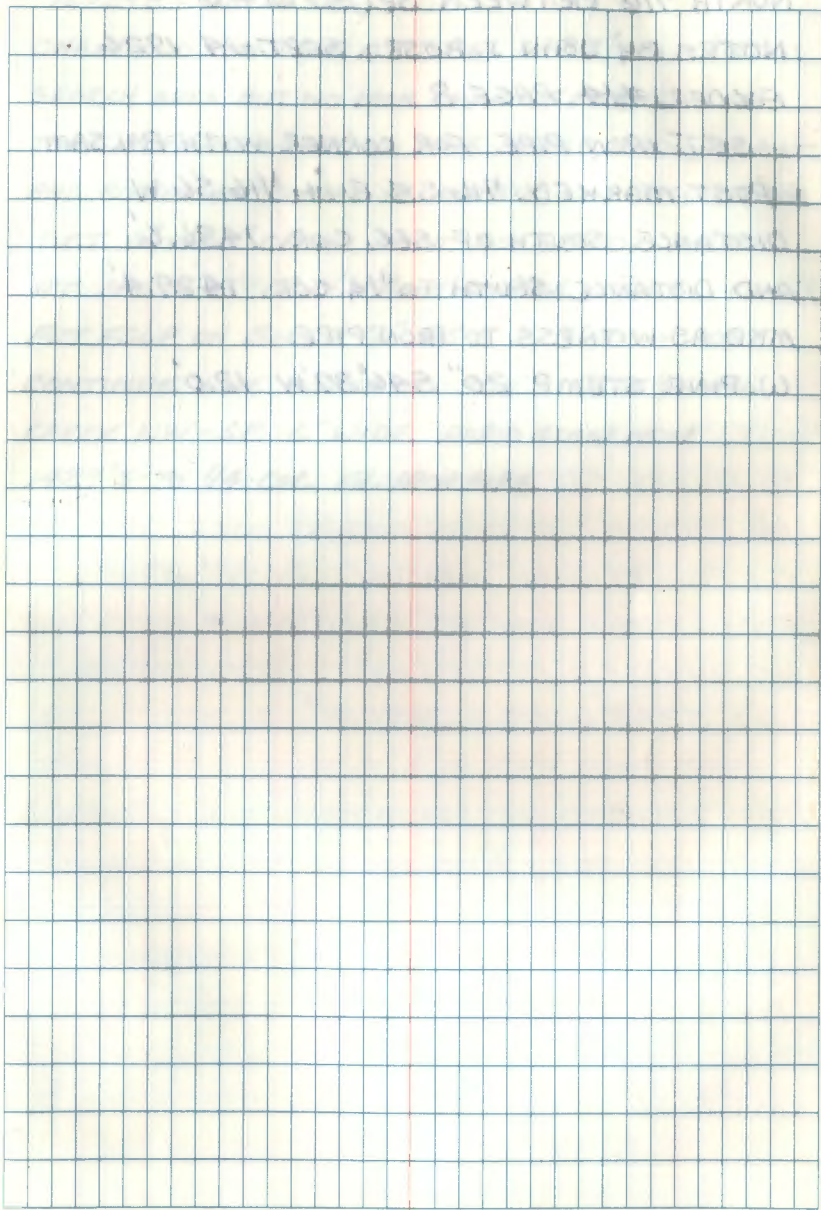

NORTH  $\frac{1}{16}$  BETWEEN SEC'S. 546

NOTES BY JOHN J. ROSE, SEPT. 19 1926

FOLDER #14. PAGE 8

SET IRON PIPE FOR CORNER WITH BALSAM  
POST MARKED.  $\frac{1}{16}$  S5 E +  $\frac{1}{16}$  S6 W  
DISTANCE SOUTH OF SEC. COR. 1436.6'  
AND DISTANCE SOUTH TO  $\frac{1}{4}$  COR. 1429.4'  
MKD AS WITNESS TO IRON PIPE  
W. PINE STUMP 20" S46°37'W 12.0'

12-2-83 GK-JA-GB

CHAIN AND RUN LINE AT S2E 1437' TO N $\frac{1}{16}$   
SEARCH AREA BUT NO IRON COULD BE FOUND AT THIS  
TIME - FOUND LARGE W. PINE STUMP, BADLY BURNT  
AND ROTTED - NO SCRIBE IS VISIBLE ON FACE OF STP.  
SET 6" X 36" CEDAR POST AS APPROX. N $\frac{1}{16}$   
AT N 55° E 12.0' FROM W. PINE STUMP  
PUT FSLP ON BIRCH 7" S5E 6.5' FROM POST  
CONTINUE LINE SOUTH TO 300'S  $\frac{1}{4}$  OF SMALL  
CREEK NW-SE 6' WIDE RAPID FLOW NOW  
1429'S TO  $\frac{1}{4}$  COR. FD. IRON PIPE

QUARTER CORNER BET. SEC'S. 10 + 15  
 NOTES OF ORIG. GOV'T. SURVEY 1882  
 SET WOOD POST

ASPEN 7 N37W 14 LKS. 9.2'

ASPEN 5 N68E 7 LKS. 4.6'

NOTES BY JOHN J. ROSE OCT 1926

~~3~~ FOLDER #14 PAGE 72

NO EVIDENCE OF ORIG. CORNER - SET POST  
 BY PROPORTIONAL MEASURE 2673' E+W  
 FOUND FENCE LINE AT 2680 N+S WHICH  
 HE SUPPOSED IS 1/4 LINE - TOTAL FOR MILE  
 WAS  $5345.6 \div 2 = 2672.8'$

7/7/88 RECEIVED NOTES FROM ITASCA COUNTY FOR  
 GRATTAN CEMETERY (NO DATE)

1/4 10+15

OAK 12 S84E 86.6' - NOW OPEN CATTLE PASTURE  
 PINE STUMP 10 N67W 70.3 - FALLS IN OPEN HAY FIELD  
 SPRUCE STUMP FROM ROAD SURVEY 18 S57W 50.8'  
 EAST 266.6' TO COR OF SEC'S. 10, 11, 14+15

2-7-83 GB-JA

CHAINED ALONG 1/2 OF COUNTY ROAD EAST FROM  
 SEC. COR. 9-10-15-16 - 2673'E - NO TRACE  
 OF 1/4 COR. - CONTINUE E - 2673'E - APPROX. SEC.  
 COR. FENCE LINE NORTH - NO OTHER EVIDENCE

NOTES FROM ITASCA COUNTY - COUNTY ROAD #74  
 JUNE 1910 - NOTES + PLAT ON FILE

FROM SEC. COR. 10, 11, 14+15 WEST TO SEC. COR TO  
 SEC'S. 9-10, 15+16 80.97 LKS. =  $5344.02 \div 2 = 2672.0'$   
 1/4 COR. 10/15 CEDAR 11 N27E 53 LKS. = 34.98'  
 SPRUCE 18 S27W 77 LKS. = 50.82'

9/1/92 GB-CK

USED GATTEN CEMETERY PLAT AND FOUND FRONT (3) IRONS  
 TO REESTABLISH 1/4 CORNER LOCATION

SET 60° SPIKE AT LOCATION 3" BELOW ROAD  
 SPIKE IS 10.4' SOUTH OF 1/2 OF E+W COUNTY ROAD  
 LINED UP 3 FRONT IRONS WHICH ARE IN STRAIGHT LINE  
 THEY MEASURE REASONABLY CLOSE - FROM WESTERLY  
 IRON - MEASURE 40' WEST TO SECTION LINE - SET SPIKE  
 SET INSTRUMENT OVER SPIKE AND TURN 90° ANGLE  
 AND MEASURED 47' SOUTH TO 1/4 COR. LOCATION  
 SPIKE AT 1/4 LOCATION IS IN LINE WITH OLD FENCE LINE  
 TO SOUTH - TIES TO SPIKE

10" CEDAR FENCE COR POST SOUTH 13.34

2 1/2" IRON PIPE AT SW COR OF CEMETERY - IN CONCRETE  
 36.6' NE - NO TRACE OF OLD BTS.

59 N-19

Quarter Cor. Bet. Sec's 14 & 23  
Notes of Orig. Gov't Survey 1882  
Set wood post

Tam 9" N41W 181ks. 11.9

Tam. 10 S41W 231ks. 15.2

Notes by J.J. Rose - 1927

Folder #15 pg. 26

Found post down and rotted stump of  
1 BT.

FROM NW COR. SEC. 23 EAST A DISTANCE OF 2545.5'

59

60

QUARTER CORNER BETWEEN SEC'S. 2 &amp; 34

NOTES OF ORIG. GOVT. SURVEY 1875

SET TAM. POST

TAM 10 S40E 23 LKS. 15.2'

TAM. 10 N32E 18 LKS. 11.9'

NOTES BY JOHN J. ROSE 10-6-27 SURVEYOR

FOLDER 15 PAGE 36

FOUND BOTH BT'S. - ONE STANDING - OLD POST  
GONE

SET NEW CEDAR POST 5"

NOTE: GOVT. FIELD NOTES DO NOT AGREE

66' WEST OF CREEK

874 BY L.W. JOHNSON 1-18-34

FD. CEDAR POST IN GOOD CONDITION - 30" HIGH

FD. TAM. 15 N50E 14 LKS. = 9.2' SCRIBED S34 BT

PUT FSLP ON CEDAR 9 ON NE SIDE - POST IS N40E

10 LKS. = 6.6' IN SWAMP - 1 CHAIN E TO CREEK

5/11/88 KW-TW-GR-CK-GB

WE SEARCH AND EXAMINE TAM. STUMPS FOUND IN "85"

BUT NO CHOP MARKS OR SCRIBE COULD BE FOUND

AS HIGH WATER AND DECAY HAS DESTROYED EVIDENCE

ON STUMPS - KEN ACCEPTS CEDAR POST - OLD FSLP ON

DEAD CEDAR SNAG AND LIVE TREE CEDAR TO WEST

OF CORNER AS BEST EVIDENCE TO ORIG. COR. POSITION

9/28/85 CK-JA-GB

CHAINED FROM OLD R.R. GRADE ROSE'S DISTANCE OF

770'E ON BOG - FOUND OLD RUSTED TAG ON 10" CEDAR

60'S OF MY LINE RUN EAST - FOUND STUMPS OF BOTH

ORIGINAL TAM BT'S. - FD. ROSE'S 5" CEDAR POST

LEANING IN SWAMP - STOOD 5" POST UPRIGHT AND

DISTANCES BY CHAINING AND TAG ON CEDAR CHECK OK

SET NEW CEDAR POST (DRY) 4" X 4" X 10' BESIDE ROSE'S

POST 5' HIGH - PUT NEW FSLP ON 9" DEAD CEDAR

S39W 6.4' FROM CEDAR POST

CORNER IS 60' W OF CREEK RUNS SOUTH OUT OF

CODDINGTON LAKE

TIES TO TAM. STUMPS FOUND FROM ROSE'S POST

TAM. STUMP 10"-12" N10W 11.3' - TAM. STUMP 12"-14"

N25E 22.3' &amp; TAM. STUMP 10"-12" S81E 18.1'

\*3/21/87 CK-JA

CUT CEDAR SNAG OFF - NOW STUB 7' HIGH WITH FSLP (NEW &amp; OLD)

SET 8' STEEL SIGN POSTS EAST 4.7' AND NORTH 5.1' FROM

CEDAR POST AT 1/4 CORNER WITH 59-9 ATTACHED

WE MONUMENT WITH 2" DIA. X 48" LONG FSBC IRON PIPE

OVER 8' STEEL SIGN POST WITH CAP MARKED

WITNESSED BY

TISON

TAM. 7 N72W-70.30' MKD 1/4 S34 BT R27W  $\frac{S34}{53}$  1/48' STEEL SIGN POST WEST 4.4' AND NORTH 5.2' T149N  
1988

1934 CEDAR STUB S39W 6.71' OLD + NEW FSLP'S

RLS 14677

DOCUMENT #400660

MEANDER CORNER BET. SEC'S. 3+34

NOTES OF ORIG. GOV'T. SURVEY 1875

SET SPRUCE POST

TAM. 7 S15W 26 LKS. 17.2'

TAM. 9 N10W 43 LKS. 28.4'

NOTES BY JOHN J. ROSE 10-6-27 SURVEYOR

FOLDER #15 PAGE 37

FOUND BOTH B.T.S. - ONE TAM STUB STANDING

THE OTHER BT A TAM. IS DOWN - OLD POST GONE

SET NEW <sup>CEDAR</sup> ~~SPRUCE~~ POST 5"

GOV'T. FIELD NOTES DO NOT AGREE

10/2/85 CK-GB-JA

CHAINED N87E-1426' FROM S<sup>1</sup>/<sub>4</sub> TO SEC 34 - OUR LINE

FALLS 100' WEST OF EDGE OF BOG - VERY SOFT MARSH

OR FLOATING BOG - FOUND MANY STUMPS UNDER BOG MAT

NOT GOOD CONDITIONS FOR GOOD SEARCH - SHOULD

SEARCH AGAIN WHEN WATER IS DOWN

NO EVIDENCE WAS FOUND AT THIS TIME

NO APPROX. COR. WAS ESTABLISHED - JUST RIBBON

TIED ON BRUSH IN SEARCH AREA

ROSE'S DISTANCE FROM <sup>3</sup>/<sub>4</sub> E TO MC 1425.33/7/89 CK, GB - From EAST M.C. chained at  
571W 1022', Tied up ribbons for search area.

3/12/90 CK, GB -

Discovered in Rose's & Christensons notes that there was a error made in the tangent of the angle 81°21' (Folder 13, page 104). Distance should be 986' and not 1022'.

We chained from the South <sup>1</sup>/<sub>4</sub> corner of section 34 at N87E, 1425.3'. Then we chained from East MC 572W, 986' to intersect both lines. Set 8' s.p. at approx. corner location. Will search in summer.

8/1/90 CK, GB

Found the top of a 5" x 5" spruce post squared. Post was scribed "MC", "S3", "S34". Found post point. Total post length ± 5'. Fd. Tamarack st.p. under bog mat at S32W at 17.2'.

Fd. Tamarack approx 6" dia. at N10W at 30.2'.

Fd. a larger Tam. st.p. at N10W at 35'.

From corner position tied in 8" steel sign post set on 3/12/90 at N24W, 12'. \*Removed sign post and replace at M.C. position. Placed spruce post point on south side of sign post. Top of post laying on east side.



SECTION CORNER TO SECTIONS 3, 4, 33 &amp; 34

NOTES OF ORIG. GOV'T. SURVEY 1875

SET SPRUCE POST

SPRUCE 6 N40W 6 LKS. 4.0'

SPRUCE 6 S33W 14 LKS. 9.2'

SPRUCE 7 S47E 41 LKS. 27.1'

TAM. 8 N86E 78 LKS. 51.5'

NOTES BY JOHN J. ROSE - SURVEYOR - 10-6-27

FOLDER #15 PAGE 36

FOUND OLD POST - BADLY DECAYED

SET NEW POST SPRUCE 5"

## CERTIFICATE FILED

ROSE'S DISTANCES TO 1/4 COR'S,  
N TO 1/4 2839.5' - E TO 1/4 2609' - W TO 1/4 2625.3  
S TO 1/4 2579.6'

TIES FROM POST AT SEC. COR.

NORTH 250' N LV. SWP. NW-SE

EAST 85' E LV. SWP. NW-SE

5/11/88 KW-TW-GR-CK-GB

IN NE QUADRANT WE RECOVERED OLD TAM. LOG UNDER  
MOSS AND WATER WHICH SHOWS REMAINS OF REVERSE  
SCRIBE AND OVERGROWTH AND ALSO FOUND WIND FELL  
SPRUCE IN SE QUADRANT WITH OLD BLAZE, BUT  
FACE HAS ROTTED BADLY AND NO SCRIBE REMAINS  
KEN ACCEPT'S POSITION FROM EVIDENCE RECORDED  
WE SET COUNTY MONUMENT WITH ALUM. CAP MARKED  
FLUSH WITH SWAMPTISON  
533 | 534  
R27W 54 | 53  
T149N  
1988

WITNESSED BY

RLS 14677

TAM. 6 N9W 83.20' MKD T150N R27W 533 BT

TAM. 9 N24E 58.77' " T150N R27W 534 BT

TAM. 5 S5E 35.65' " T149N R27W 53 BT

TAM. 5 S32W 52.90' " T149N R27W 54 BT

8' STEEL SIGN POST EAST 4.0' AND SOUTH 3.0'

6' STEEL POST WEST 2.8'

DOCUMENT # 400659

QUARTER CORNER BET. SEC'S. 33+34

NOTES OF ORIG. GOV'T. SURVEY 1882

SET POST

SPRUCE 12 S31E 20 LKS. 13.2'

JACK PINE 15 N48W 20 LKS. 13.2'

NOTES BY JOHN J. ROSE 1928

FOLDER 15 PAGE 98

FOUND ROOTS + STUMPS OF ORIG. BT'S. TO 1/4

CORNER - SET NEW POST

PAGE 99

SET OVER SEC. COR. 3-4-33-34 SIGHT N ON RANDOM

LINE TURN ANGLE N1°52'W IN SPRUCE SWP.

2839.5' CROSS E+W 1/4 LINE - 1618' WEST OF 1/4

CORNER 33+34

874 + PLAT. OF GRATTAN LOOK-OUT TOWER SITE SURVEY

IN OCT 1936 BY J. A. GJELHAUG REGISTERED SURVEYOR

SCRIBED POST

ASPEN 5 SHOW 21 LKS. F.S. POSTER

RECENT HEAVY BURN - BT'S LOST

FOR MONUMENTATION SEE PAGE 2 BOOK #3

# CERTIFICATE FILED

874 DATED MAY 16, 1940 DON RIEGER

POPPLE POST - FAIR CONDITION - SCRIBED

CORNER IS LOCATED ON SMALL KNOLL - CORNER

HAS BEEN SCORCHED FROM A FIRE

5/13/88 CK-6B

START AT MONUMENTED SEC. COR. TO SEC'S. 3-4-33-34

IN SPRUCE + TAM. SWP. - RAN LINE AT N15W - 250' N 44

SWP. - CONTINUE THROUGH BRUSH AND HARDWOODS - ALONG

OLD BLAZED LINE AND AT 1421' N15W EST. APPROX. 5 1/16

PUT FELD ON 4" MARLE AS APPROX. 5 1/16 BET. SEC'S. 33+34

CONTINUE N15W TO VERY WET SWAMP NE+SW AT

STATION 2400' OUR LINE - TOO DEEP TO CROSS SO WE GO

BACK TO STATION 2200' AND MAKE OFFSET S75W 300'

AT THIS POINT WE CONTINUE CHAINING AT N15W TO STATION

2600' N THEN WE GO N75E 300' BACK TO LINE - WE

NOW CHAIN N15W 40' AND BEGIN SEARCH FOR 1/4 COR.

WITH METAL LOCATOR WE LOCATE OLD METAL TAG ON GROUND

AND PULL 4.5' SOUTH TO LOCATION OF ASPEN STUMP - FROM THIS

POINT WE GO N40E 13.7' AND PLACE PICKET AT DISTANCE

FROM THIS PICKET WE FIND WELL ROTTED J. PINE STUMP

AT N75W 13.2' - NO SCRIBE - BUT STUMP WAS BURNT

BADLY YEARS AGO - OUR DISTANCE CHAINED WAS 2857'

BUT LINE WAS RIGHT AT CORNER LOCATION ON ASPEN

KNOLL IN BRUSH OTHER PINE STUMPS IN AREA ALSO WHITE

SPRUCE TO NE+SE OF COR.

SEE PAGE 78 THIS BOOK

QUARTER CORNER BET. SEC'S. 34 & 35

NOTES OF ORIGINAL GOV'T. SURVEY 1882

SET WOOD POST

J. PINE 4 N32E 38 LKS. 25.1'

J. PINE 3 N33W 15 LKS. 9.9'

NOTES BY JOHN J. ROSE, SURVEYOR 1927

FOUNDER 15 PAGE 20

FOUND BOTH BT'S. AND POINT OF OLD POST

IN GROUND - SET NEW POST N. PINE 4"

2016.7' NORTH OF MC. ON NORTH SHORE OF LAKE

OR 2632.8' NORTH OF SEC. COR. POSITION IN LAKE

9/25/85 GB-JA

FROM BLM MONU. AT MC POSITION CHAINED NORTH

ROSE'S DISTANCE OF 2016' AND MADE SEARCH

FOR ABOVE INFORMATION - NONE FOUND

9/27/85 CK GB

FROM APPROX. 1/4 LOCATION WE CHAIN EAST ROSE'S.

DISTANCE OF 2744' TO C. OF N+S COUNTY ROAD

OUR CHAIN WAS 2819' E TO CENTER OF CO. #26 - OUR

LINE FELL 35' N OF FENCE CORNER - NOW GO BACK

TO STARTING POINT AND MOVE EAST 75' AND SEARCH

AGAIN FOR EVIDENCE OF ROSE'S. PINE POST OR ORIG. BT'S.

NONE WAS FOUND - MANY BURNED & ROTTED PINE STPS

IN AREA - WE THEN GO TO BLM MONUMENT AND

RUN NORTH 104' WHICH IS DIFFERENCE IN ROSE'S.

DISTANCE WHICH WAS 2016' MC TO 1/4 AND BLM'S.

DISTANCE WHICH WAS 1912.7' MC TO 1/4

10-1-85 CK-GB-JA

SEARCH AGAIN BUT NOTHING COULD BE FOUND OF POST

OR BT' STUMPS - SET 3" X 5" J. PINE POST AT

ROSE'S. DISTANCES ~~2016~~ NORTH FROM MC. 2016'

AND 2744' EAST TO CENTER OF CO. ROAD #26

PUT FSLP ON 11 J. PINE N54W - 15.5' FROM POST

BLM LINE NORTH FROM THERE 1/4 MONU. IS 8' E

OF OUR POST AND 92' SOUTH TO BLM 1/4 COR.

NOTES BY JA GJELHAUG 1937 - PLAT OF TOWER SURVEY

FD. ORIG. J. PINE STUMP 8 N32E 22 LKS. = 14.5'

PUT FSLP ON J. PINE 8 N20E 53 LKS. = 35.0'

SURVEY BY GJELHAUG FROM W 1/4 SEC. 34 TO E 1/4

W 1/2 2676.3 - E 1/2 2675.64 - OR 5352' TOTAL

AND TRUE BEARING OF S88°53'W

MEANER CORNER BET. SEC'S. 34 & 35

NORTH SHORE OF CODDINGTON LAKE

NOTES OF ORIGINAL GOV'T. SURVEY 1882

SET WOOD POST

SPRUCE 18 S38E 20 LKS. 13.2

ROSE 1927 Fd. DOWN

BIRCH 12 N3W 42 LKS. 27.7

ROSE 1927 Fd. STANDING

NOTES BY JOHN J. ROSE SURVEYOR 1927

FOLDER #15 PAGE 21

FOUND BOTH BT'S, BIRCH STANDING AND

SPRUCE DOWN - SET NEW POST CEDAR 4"

FOR MC FROM ORIGINAL BT'S.

NOTES BY B.L.M. 1960

POINT DETERMINED FROM EVIDENCE OF ORIGINAL  
BT'S.

FRAGMENTS OF LARGE SPRUCE STUMP BEARS S43E  
20 LKS. 13.2' ORIG. RECORDED AT S38E

ROTTED BIRCH STUMP 16 WITH OLD OVERGROWTH  
VISIBLE N2E 42 LKS.

Fd. OLD CEDAR POST, SQUARED WITH SCRIBE LYING  
NEAR CORNER - SET POST NORTH 1 LK.

BLM SET 2 1/2" X 28" IRON POST AT CORNER

WITH BRASS CAP MARKED

STRAIGHTEN MONUMENT UP - ICE

HAD PUSHED TO NORTH (TOP)

T7150NR27W

534 | 535

MC

1960

FROM WHICH

BALSAM 8 N57 1/2 E 43 LKS. 28.4'

1985 NOW BALSAM WINDFALL

BASSWOOD 8 N7 1/4 W 132 LKS. 87.12'

1985 NOW STANDING SCRIBE ROTTED OUT

9/25/85 CK-JA-66

Fd. BLM. MONU. IN 24" OF WATER - 15' IN LAKE

MKD TIES ASPEN 9 N33E 41.4' MKD MC 535 BT

CLUMP BIRCH 12 N54E 45.9' " " " "

SHORE LINE HAS ERODED TO SE NO EVIDENCE OF ORIG.

SPRUCE STUMP REMAINS

NEED TO LOOK FOR BIRCH STUMP NEXT TRIP IN

3/20/87 CK JA

WATER HAS DROPPED IN LAKE 1 1/2' SO MONUMENT IS  
NOW STANDING ON BEACH - PLACE 3 LARGE ROCK

AROUND MONUMENT - 6' STEEL POST IS 1' N OF MONU.

SOUTH  $\frac{1}{16}$  CORNER ESTABLISHED BY JOHN J. ROSE  
 IN 1927 BETWEEN SECTION CORNER 4-5-32+33  
 AND ~~#4~~ BETWEEN SECTION 32+33-28-29  
 FOLDER #15 PAGE 85  
 FROM CORNER TO SECTIONS 4-5-32+33 TURNED  
 $8^{\circ}35'$  WEST ON RANDOM LINE RUN BY ROSE  
 $445'$  N ENT. SPR. SWP. E4W  
 $1588''$  SOUTH SHORE OF SMALL LAKE - CHAIN ACROSS ON ICE  
 $1983''$  LEAVE LAKE ENTER SPRUCE  
 $2651''$  ~~LEAVE~~ CROSS R.R. BRANCH NE YW  
 $2727''$  LEAVE SWAMP - ENTER RIDGES NE YNW  
 $2737.9$  NOTE; NO TRACE OF GOV'T.  $\frac{1}{4}$  COR.  
 $3110'$  N LEAVE RIDGE - ENTER SPR. TAM. SWAMP NW-SE  
 $5408.4$  DROVE HOB ON SECTION LINE BETWEEN SECTIONS  
 $28+33$   $9.3$  EAST OF CORNER TO SECTIONS  
 $28-29-32+33$   
 $\frac{1}{4}$   $32+33$  AT STATION  $2704.2$  AND  $4.6'$  WEST  
 ESTABLISH TRUE  $\frac{1}{4}$  CORNER.

AND AT  $1352.1$  AND  $2.3$  WEST ESTABLISHED S  $\frac{1}{16}$   
 CORNER - SET SPRUCE POST

NO BT'S. RECORDED

874 BY G. SHERMAN 2/6/34

FD.  $3''$  DIA.  $\times 22''$  HIGH TAM POST SCRIBED  $\frac{1}{16}$  S32 +  $\frac{1}{16}$  S33

FD. BT'S. TAM. 3 SIW 23 LKS.

TAM. 3 N16E 26 LKS.

PLACE FSLP ON TAM - S65E 32 LKS.

10/9/85 CK-JA-6B

CHAINED N  $8^{\circ}$  W FROM SEC COR 4-5-32-33

TIE ALONG LINE CHECKED OK - FOUND OLD BRUSHED  
 OUT LINE IN SWAMP - FOUND ROSE'S POST ON  
 WESTERLY EDGE OF OPEN LINE IN SWAMP - POST  
 WAS  $1'$  LONG  $3''$  DIA. BELIEVE POST IS SPRUCE.

SET NEW TAM POST BESIDE OLD POST POINT  
 MKD TIES TO POST - PLACE  $40^{\circ}$  SPIKE NEXT TO POST

BLK. SPRUCE 4 S61W 10.5 BLAZED - NAIL - TAG

BLK. SPRUCE 4 N28E 15.7 " " "

BLK. SPRUCE 5 S61E 22.4 " " "

CORNER IS APPROX.  $70'$  N75W OF HIGHGROUND (ISLAND)

MEANDER CORNER BETWEEN SECTIONS 2+35  
ON ~~WEST~~ <sup>EAST</sup> SHORE OF CODDINGTON LAKE  
NOTES OF ORIGINAL GOVT. SURVEY 1875  
SET TAM. POST

TAM. 9 S68E 1.70 CHS. = 112.2'

TAM. 7 N72E 1.66 CHS. = 109.56'

ITASCA COUNTY ROAD SURVEY ODDA LAKE - PINETOP 1919  
FROM 1/4 BETWEEN SEC'S. 2+35 WEST TO LAKE A DISTANCE  
OF 2474.0' TO MC. CORNER - PLAT STATES COR. FOUND  
MAD NEW BT'S. See field notes for additional evidence  
SPRUCE 9 N80E 67.6'

TAM. 10 N7E 60.9' 8

Fd 600' BT Tam. 7" blaze faces (and scribe)  
to south. Notes for this corner call for  
post to set S72W 109.6' - This would  
throw corner to far into lake and not  
in direction which bearing tree faces  
George Lyng - surveyor for RM showed me  
where old cedar stake for corner had set 2  
years ago which was on line with Govt  
blazes

SEE PAGES 3 BOOKS FOR MONUMENTATION

Notes for J.J. Rose. Surveyed by E. Christensen  
1927 F.15 P.20

Indicates finding corner - nothing else mentioned  
5/19/88 CK GB

FROM APPROX. S 1/4 SEC. 35 WE CHAINED 2474' WEST (TRUE)  
COUNTY ROAD PLAT DISTANCE - ROSE'S DISTANCE WAS  
2468.7 BUT HE FELL 64.4' NORTH OF COR.

WE PLACED ASH PICKET 3" WITH RIBBON TO MARK END OF  
OUR CHAIN AND DISTANCE 2474' W

Fd OLD BLAZED CEDAR 14" NOW WINDFALL WHICH WAS BLAZED  
E+W ON SOUTH SIDE - THIS CEDAR IS 10' NORTH OF OUR  
LINE - SEARCH AREA IS FLOATING BOG - NEED HIP BOOTS +  
SNOW SHOES - OR WADERS - BELIEVE POST COULD BE UNDER BOG  
MANY OLD BURNT + ROTTED TAM, SPRUCE + CEDAR STUMPS  
IN AREA - NEED TO FIND POST

5/23/88 CK, GB

Found 3" squared by 5' long wood post scribed  
MC on two sides under bog mat, Post was  
laying under bog mat along with 1" x 12' long  
picket. Reset post and picket at corner  
position. Placed 8' steel sign post  
along side post and set flush with present  
water level. Set a 2" dry picket at corner.  
Found no evidence of county BT'S. Tamarack stps  
north of corner are well decayed. Corner ends  
up 4' west and 4' north of our chaining  
picket.

QUARTER CORNER BET. SEG'S. 4+33

NOTES OF ORIG GOV'T. SURVEY 1875.

SET ASPEN POST

ASPEN 8 N46W 8 LKS. = 5.3'

BIRCH 7 S14W 7 LKS. = 4.6'

NOTES BY JOHN S. ROSE 10/17/27

FOLDER #15 PAGE 43

FOUND 6" BIRCH STUMP = NO TRACE OF POST

SET NEW POST 4" MAPLE

MARKED NEW BT'S.

BIRCH 5 S30W 7.1'

BIRCH 9 N55W 12.6'

10/5/85 CK-GB

CHAINED ROSE'S. DISTANCE 2625.3' FROM SEC. COR.

3-4-33-34 (POST POINT FOUND) AND LINE RUN AT

DUE WEST TO AREA OF 1/4 CORNER - SEARCHED

3 HRS. - NO EVIDENCE WAS FOUND OF ORIGINAL OR

ROSE'S SURVEY

AT END OF CHAIN 2625.3' SET 3" X 36" PINE

POST FOR APPROX. 1/4 COR. - PLACE FSLP ON

14" MAPLE S77°E 21.0' FROM PINE POST

WOOD TRAIL NW-SE IS 250' W OF COR.

CONTINUED LINE N89W TO SEC. COR. 4-5-32-33

OUR LINE MEASURED WAS 2622' - ROSE'S DISTANCE

WAS 2608'

QUARTER CORNER BET. SEC'S 6-4-31  
 NOTES OF ORIG. GOV'T. SURVEY 1875  
 SET TAM POST

TAM 8 S9W 37 LKS. = 24.4'

TAM 9 N10W 25 LKS. = 16.5'

NOTES BY JOHN J. ROSE 5/16/28  
 FOLDER #13 PAGE 160

RANDOM LINE FROM TOWNSHIP CORNER, FELL  
 41.8' SOUTH OF 1/4 COR.

FOUND STUBS OF BOTH GOV'T. BT'S.  
 AND 1/4 CORNER SET BY JOHN BROWN FORMER  
 COUNTY SURVEYOR.

11/10/75 CK  
 CHAINED TRUE EAST FROM TSP. CORNER GOV'T CHAIN 37.90 CHS.  
 OR 2501' SEARCH FOR 1/4 COR. - FOUND 2" x 36" PRINTED  
 CEDAR STAKE, IN PLACE, IN SWAMP, 130'E AND 80' NORTH  
 OF END OF OUR CHAIN - NO OTHER EVIDENCE WAS FOUND  
 AT THIS TIME - SET TAM PICKET AT STA. 2500'E  
 AND PLACED FSLP ON BLK. SPRUCE 6" NORTH OF PICKET  
 14' - TAM PICKET IS APPROX. 1/4 COR. POSITION  
 CONT. LINE EAST TO SECTION CORNER

10/16/85 CK-JA-6B  
 FROM APPROX. SEC. COR. TO SEC'S. 5-6-31-32  
 CHAINED ROSE'S. DISTANCE OF 2596' AND SEARCH  
 FOR 1/4 COR. - SEARCH 1 HR. NO EVIDENCE WAS FOUND  
 10/17/85 SAME CREW  
 START AT NW CORNER OF SEC. 6 (TSP. COR.) AND  
 CHAINED ROSE'S. DISTANCE 2619.6' TO N 1/4 SEC. 6  
 OUR DISTANCE WAS 2628'E AND FELL 30' SOUTH  
 OF POST SET ON 10/16/85 - AGAIN SEARCH FOR 2 HRS.  
 BUT NO EVIDENCE OF ORIG. OR ROSE'S. SURVEY COULD  
 BE FOUND AT THIS TIME - POST POINT FOUND IN  
 1975 WAS BEST EVIDENCE FOR APPROX. LOCATION  
 WE COULD FIND AT THIS TIME - POST POINT FIT  
 ROSE'S. DISTANCE CHAINED FROM EAST, BUT FELL 8'  
 LONGER ON DISTANCE CHAINED FROM WEST  
 SET 3" x 6" TAM. POST ALONG SIDE 2" CEDAR STAKE  
 AS APPROX. N 1/4 SEC. 6 - PLACE FSLP ON 7" BLK. SPR.  
 N32W 15.2' FROM TAM. POST AS APPROX. 1/4 COR.



70 Also Bk 1 Pg # 19

SECTION CORNER TO SECTIONS 26-27-34-35

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

J. PINE 4 S64W 24 LKS. = 15.8'

J. PINE 3 N74W 30 LKS. = 19.8'

J. PINE 8 S82E 75 LKS. 49.5'

NO OTHER TREE NEAR

NOTES BY JOHN J. ROSE - 1927

FOLDER 15 PAGE 18

FOUND POST

874 CCC NOTES BY HARRISON ADAMS 7/24/34

NO POST FOUND

Fd. J. PINE SNAG S82E 20 LKS. = 13.20'

10-29-07 R. MAIN

GPS'D IRON PINE PLANTATION NORTH OF CORNER

SECTION CORNER TO SECTIONS 27-28-33-34

NOTES OF ORIG. GOV'T. SURVEY 1882

SET WOOD POST

TAM. 10 N49W 25 LKS. = 16.5'

TAM. 18 S29W 21 LKS. 13.9'

TAM. 12 N39E 40 LKS. 26.4'

TAM. 6 S37E 8 LKS. 5.3'


SEE BOOK 1 PAGE 21

B.L.M. MONUMENT SET IN 1990

QUARTER CORNER BETWEEN SECTIONS 27+34  
NOTES OF ORIG. GOVT. SURVEY 1882.  
SET WOOD POST

TAM. 8 N61W 10 LKS. 6.6'

TAM. 9 S83E 24 LKS. 15.8'

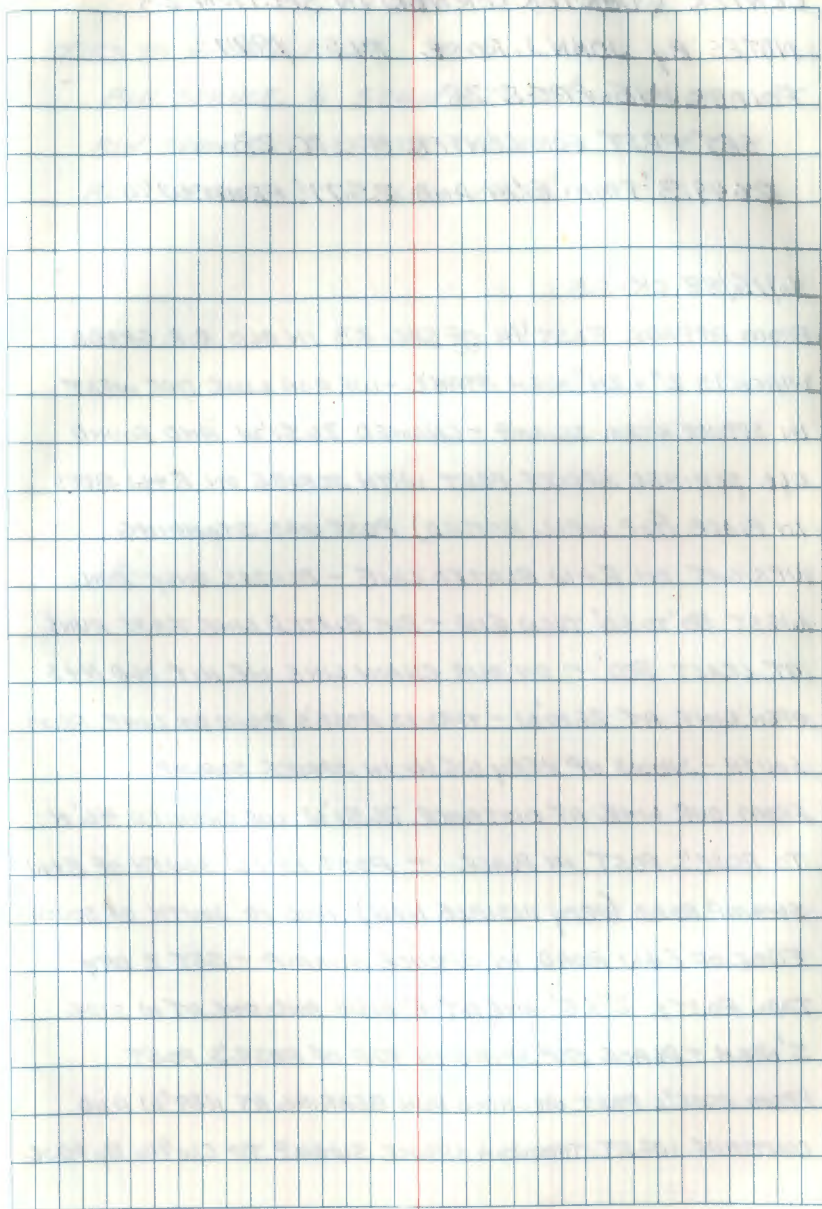

## CENTER QUARTER CORNER IN SECTION 23

NOTES BY JOHN J. ROSE RLS. 1927

FOLDER #45 PAGE 28.

SET POST FOR CENTER OF SEC. 23.

2649.3' FROM E<sup>1</sup>/<sub>4</sub> AND 2577' FROM W<sup>1</sup>/<sub>4</sub>

6/15/88 CK-GB

FROM APPROX. EAST <sup>1</sup>/<sub>4</sub> OF SEC. 23 IN OLD R.R. GRADE WHICH IS 2" X 24" HIGH STAKE. - WE RUN LINE DUE WEST IN SPRUCE TAM SWAMP - CHAINED 2651' W AND FOUND OLD SCRIBED SPRUCE POST WITH SCRIBE ON E+W SIDES IN PLACE (TOP WELL ROTTED) POST WAS STANDING UPRIGHT ON E+W BLAZED LINE - BLAZES ONLY RUN WEST 50' TO 60' THEN END - BUT BLAZED LINE EAST RUNS AT LEAST 800' - ON OUR CHAIN LINE WE HIT OLD N+S OPEN LINE AT 2610' W - THIS IS ROSE'S RANDOM LINE FROM SOUTH - SHOWS UP VERY WELL IN SPRUCE SWAMP FROM OUR LINE AT DISTANCE 2651' W WE CHAINED 46' N TO ROSE'S POST IN PLACE - POST IS 16' SOUTH OF E+W SWAMP ROAD (VERY VISIBLE NOW) AND 10' SOUTH OF SOUTH EDGE OF E+W ROAD IN SPRUCE SWAMP - SET 2 DRY TAM. POSTS 2" X 8' ONE AT E SIDE AND ONE AT W SIDE 5' HIGH - PLACE 50# SPIKE IN TOP OF ROSE'S POST FROM ROSE'S POST WE NOW RUN BEARING AT N89° W AND CONTINUE WEST THROUGH SPRUCE SWAMP TO CW<sup>1</sup>/<sub>16</sub> BY ROSE

## TIES TO ROSE'S POST

BLK. SPRUCE 6 S24W - 26.75' MKD C<sup>1</sup>/<sub>4</sub> 523 BT

BLK. SPRUCE 5 S33E - 12.90' " " "

BLK. SPRUCE 5 N36E - 10.70' " " "

CENTER WEST  $1/16$  CORNER IN SEC. 23

NOTES BY JOHN J. ROSE, RLS 1927

FOLDER #15 PAGE 28

SET SPRUCE POST 4" FOR  $1/16$  COR,

1288.5' FROM  $1/4$  COR. TO SEC'S. 22 & 23

MARKED BT'S.

SPRUCE 4 N70W 13.4'

N62W 13.4'

Fd. SPRUCE STUB 24" HIGH LOG ON GROUND WITH PIECES OF SCRIBE

SPRUCE 4 N60E 10.4'

Fd. STUMP 6" N68E 10.4' WITH T SCRIBE VISIBLE

6/15/88 CK-GB

FROM POST FOUND AT C  $1/4$  SEC. 23 WE RUN LINE AT

N89°W AND CHAINED 1288.5' AND FELL RIGHT ON

FOR DISTANCE AND BEARING - Fd. SPRUCE POST 4"

LEANING AND STILL FROZEN IN SWAMP - IN PLACE - TOP

IS WELL ROOTED WITH SIGNS OF FLAT SIDES AND FAINT

SCRIBE - SET 3" SQD. X 9' TAM POST AT SOUTHEAST OF

ROSE'S POST OR AT CORNER, IF ROSE'S POST WAS UPRIGHT

TAM. POST IS 6' HIGH AT TRUE CORNER (SPK AT BASE)

TIES TO TAM. POST

TAM. 5 N62W 14.5' MKD CW  $1/16$  S23 BT

TAM. 10 N28E 36.1' " " " "

SPRUCE 6 S69E 21.15' " " " "

CORNER IS IN SPRUCE & TAM. SWAMP.

CONTINUE LINE AT N89°W TO W  $1/4$  SEC. 23 WHICH WAS

FOUND LATER IN DAY

SOUTH QUARTER CORNER TO SECTION 36

NOTES OF ORIG. GOVT. SURVEY 1875

SET TAM. POST

TAM. 6 N72W 14 LKS. = 9.24'

TAM. 7 S26W 31 LKS. = 20.46'

4/14/89 GB-CK

FROM SW CORNER SEC. 36 (ITASCA CO. MOUND)

RAN LINE AT DUE EAST AND CHAINED 2640'E

WHICH END IN DIKE AREA - WHICH WAS FOR RICE PADDY

By HUGO & DON RIEGER - OUR CHAINING FELL IN OPEN

GRASS AREA - APPROX 120' EAST OF DITCH BANK TO WEST

AND 180' NORTH OF DITCH BANK TO SOUTH

NO EVIDENCE REMAINS OF POST OR BT'S.

RUN SOUTH TO WOOD ROAD E & W AND PLACE ESLP

ON 3" W. OAK 262' SOUTH OF APPROX. CORNER - TAG

IS 20' NORTH OF ROAD TO DON RIEGERS CABIN ON

BIG FORK RIVER

4/26/89 CK-68 PLACE TARGET AT APPROX. CORNER

PLACED 9'x9' PLASTIC TARGET OVER 3/8" X 5' ROD

IN GRASS MARSH FORMER RICE PADDY

WEST MEANDER CORNER ON BIGFORK RIVER  
 BETWEEN SECTION 1+36 - 20.80 CHS. OR 1372.8'  
 EAST OF S<sup>1</sup>/<sub>4</sub> SEC. 36  
 SET ASPEN POST

OAK 16 S60W 18.5 LKS. = 122.10'

ASPEN 7 N71W 190 LKS. = 125.4'

EAST MEANDER CORNER ON BIG FORK RIVER  
 BETWEEN SECTIONS 1436 - 15.40 CHS. OR 10164'  
 WEST OF TOWNSHIP CORNER

NOTES OF ORIG. GOVT. SURVEY 1875

SET OAK POST

OAK 20 S61E 170HS. = 112.2'

NO OTHER NEAR

1/4	13721.8'	RIVER	10164'	TSP.	77
	20.80 CHS.	25018'	15.40 CHS.	COR.	

DISTANCE OVER RIVER BY TRIANGULATION  
 31.80 CHS. OR 2501.8'



CONTINUED INFORMATION ON WEST QUARTER  
OF SECTION 34

PLACE PICKET AT CORNER LOCATION AND 50' SPIKE  
IN GROUND NEXT TO PICKET - ALSO PLACE 50' SPIKE  
UNDER OLD TAG - IN OLD J. PINE STUMP - AND AT STUMP  
LOCATION FOR 5" ASPEN BY GJELHAUG  
MARKED TIES FOR CORNER

ASPEN	7	547E	4.6'	SPK & TAG	
ASPEN	8	555W	14.7'	" "	RED PAINT

THE FLOODED IMPOUNDMENT IS 100'S AND 125' EAST  
OF CORNER - (STATE WILDLIFE AREA)

BLM 1/4 COR. IS APPROX. 250' NE OF OUR CORNER  
ON POINT OF RIDGE INTO SWAMP - MONUMENT IS IN  
WATER. + BT IS ON POINT

THERE IS AN OLD CAMP SITE APPROX. 400' SW OF THIS  
CORNER AND AN OLD TRAIL FROM CAMP SITE NE TO  
THIS CORNER LOCATION - WAS LUMBER COMPANY CAMP B+B

TOLD BY DON RIEGER ON 6/22/88

5/17/88 CK-KW-TW-GB-GR

SCRAPE GROUND IN AREA OF POST AND FOUND SOLID CORE  
OF WOOD IN HOLE, IN SQUARD SHAPE, LIKE POST POINT  
WHICH TAPERD 12" BELOW GROUND - FOUND EVIDENCE OF  
J. PINE STUMP AT N 66W 13.7' WHICH IS BADLY BURNED  
BUT TAP ROOT STILL WAS IN PLACE

FOUND OLD LOCATION TAG BY GJELHAUG 1936 ON GROUND  
UNDER DUFF, BUT COULDN'T FIND EVIDENCE OF LOG OR

SEE BOOK #3 PAGE 2 FOR MONUMENTATION

STUMP TO WHICH THE TAG WAS PLACED ON - VERY  
HEAVY BURN IN AREA YEARS AGO  
SAMPLES OF POST AND BEARING TREE WERE  
SENT TO WOOD PRODUCTS LAB. MADISON WISCONSIN  
AND ON 9/6/88 RECEIVED POSITIVE IDENTIFICATION  
OF POST (SPRUCE) AND BT. (JACK PINE)  
3/7/89 CK, GB

TIED IN BLM 1/4 CORNER FROM THIS CORNER -  
N39E 226' TO BLM MON.