

CORNER RESTORATION

T14N R31W

Book #5

K12

FIELD BOOK

82-0012

CORNER RESTORATION T14N R31W Book #5

R-8

1 E 1/2 cor Sec 20 & 29

(Million Lake Plat)

Survey by Schneider & Burton, 1977

Set 5' x 2", concrete filled, galvanized pipe with brass cap mkd.

T 1/4 N R 31 W

E 1/2 $\frac{S. 20}{S. 29}$

1977

R/S No. 5740

from which bears:

mkd

R. Oak 10" S 27° W 21.37' E 1/2 S 29 E T

NOW R. OAK STUMP & LOG CHEWED OFF BY BEAVER

R. Oak 14" N 77° W 26.81' E 1/2 S 20 E T

NOW DEAD R. OAK SNAG CHEWED AROUND AT BASE BY BEAVER

8' STEEL SIGN POST DUE NORTH 3.3 BOTH SIGNS

" " " " DUE EAST 3.3 " "

8/6/87 CK mlh

2" F.S. IRON IS AT EDGE OF WATER WITH ROCK PILED

AROUND MONUMENT TO STABILIZE IRON

BEAVER HAVE CHEWED OFF MOST OF THE OAK AROUND THE POND

12/15/92 GB-CK

CUT TOP OFF 1977 IRON PIPE & REMOVED

DROVE IRON FLUSH WITH MARSH

REMOVED BOTH SIGN POSTS PLACED IN 1977 ALSO

NEW MONUMENT BY LANDOWNER & ASSOC.

2

Q-8

SE 1/4 cor. Sec. 20

(Million Lake Plat)

Survey by Schneider & Buxton, 1977

Set 5' x 2" concrete-filled galvanized
pipe with brass cap mkd.

THIN A 31W

SE 1/4 S. 20

1977

R.S. No. 5740

From which bear:

N. Pine 28' S 71° W 25.16' SE 1/4 S 20 BT

8/6/87 CK MH NOW 23" N. PINE IN GOOD CONDITION

N. Pine 23" S 35° W 50.87' SE 1/4 S 20 BT

NOW 24 N. PINE IN GOOD CONDITION

N. Pine 21' S 10° W 47.20' SE 1/4 S 20 BT

NOW 22 N. PINE IN GOOD CONDITION

8' STEEL SIGN POST DUE SOUTH 3/4' WITH SIGN 54-2

12/15/92 GB-CK

CUT TOP OFF 1977 IRON PIPE & REMOVED

DROVE IRON FLUSH WITH GROUND

REMOVED TAGS FROM BOTH SIDES OF BT'S

STEEL SIGN POST - PAINTED OUT RED

PRINT ON BT'S, - REMOVED SIGN POST

ON LINE TO SOUTH & PAINTED OUT TREES

ALONG LINES

3

Q-9

S $\frac{1}{4}$ cor. Sec 20 & 21

(Million Lake, Plat.)

Survey by Schneider & Burton, 1977

Set 2" x 5' concrete filled, galvanized
pipe with brass cap mtd.

1/4 NW R 31 W

S $\frac{1}{4}$

S. 20 | S 21

1977

R 25 No. 5740

- from which bears

mtd

N. Pine 21" S 25° E 168.55' S $\frac{1}{4}$ S 21 BT

NOW 22" N. PINE IN GOOD CONDITION

R. Oak 8" N 89° E 47.10' S $\frac{1}{4}$ S 21 BT

NOW 9 R. OAK IN GOOD CONDITION

R. Oak 9" N 30° W 9.25' S $\frac{1}{4}$ S 20 BT

NOW 9 R. OAK IN GOOD CONDITION

8' STEEL SIGN POST DUE SOUTH 3.7' BOTH SIGNS

" " " " NORTH 9.0' " "

8/6/87 CK MH

CORNER IN HARDWOODS WITH ASPEN & BIRCH

OLD WOODS TRAIL SW OF CORNER

COUNTY HAS BLUE LINE PAINTED WEST & NORTH

E.S. MON IN GOOD CONDITION 18" HIGH

12/15/92 GB-CK

CUT TOP OFF 1977 IRON PIPE & REMOVED

DROVE IRON FLUSH WITH GROUND


REMOVED TAGS FROM BOTH SIDES OF B.T.'S.

STEEL SIGN POST TO SOUTH

4 Q-13
SOUTH $\frac{1}{16}$ SECS. 21-22

Corner position established by survey
of Krause, Hayes, Bruma & Scarborough on
3/28/80 and 5/13/80. This corner is
established at mid-point and on line
bet. ~~28/27~~ ^{21/22} cor. and W $\frac{1}{4}$ cor. sec. 22. (mid-point
distance is 1322.08')

Set a 2" dia. x 36" long galvanized
concrete filled pipe with brass tablet
stamped:

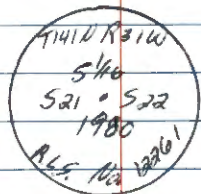

From which:

Jack Pine 14" N 30° E 57.52'
scribed S $\frac{1}{16}$ S22 BT

Jack Pine 11" N 83° E 35.97'
scribed S $\frac{1}{16}$ S22 BT

W. Oak 6" S 11° E 462.61'
scribed S $\frac{1}{16}$ S22 BT

8' long Steel Sign Post East 2.66'

8' long Steel Sign Post North 3.02'

F.S.L. Pon 8" Oak S28 $^{\circ}$ W 5.45' from corner

89-7150-4 by Hayes

M. C. H.

5 Angle Point 5, Sec. 5

Set a 2"x30" aluminum mon. with magnetic
pallet under cap and at base. Alum. cap mkd.
Mon. set 4" above grd.

T141N R31W

S. 5

A.P. 5

1983

RLS. NO 1226

Mkd. Bearing Trees:

Mkd.

1. W. Oak 5" S81W at 48.98 BT 50d nail

2. N. Pine 24" N54E 31.92 BT 50d nail

Placed a 8' steel sign post 2.35 W of corner.
with attention sign attached.

10/12/83 Gary Brana

6

Angle Point 4, Sec. 5

Set a 2" x 30" aluminum mon. with magnetic pellet under cap and at base. Alum. cap mkd.

Mon. set flush with grd.

T141NR31W

S. 5

A.P. 4

1983

R.L.S. NO. 1226*

Mkd. New BT'S:

Mkd.

1. R. Oak 5' 574W 11.50' BT 50d nail

2. W. Oak 8' 514E 15.21' BT 50d nail

Set a 8' steel sign post N38E at 2.6' from corner with attention attached

10/12/83 Gary Brama

6

7

Property Corner #1 Sec. 5

S Set a 2"x30" aluminum monument with magnetic
 pc pellet under cap and at base. Alum. cap mkd.

M. Mon. set 4" above grd. Property Corner
 T141N R31W

Property corner mkds. the west 5.5 / ~~LAND~~ U.S.A.
 boundary of Nat. Forest Land and west 1983
 side of the Heartland trail. R.L.S. No. 1226

M Mkd. Reference Trees for corner:

1. J. Pine 6" N71W 54.62 Lower blaze 50d nail

2. R. Oak 15" N32W 22.20 Lower blaze 50d nail

3 Placed a 8' steel sign post 1.45' N ^W $\frac{1}{8}$ of
 monument with both signs attached.

Line to Standard mkd. N E of corner

10/12/83 Gary Brana

Property Corner #2 Sec. 5

Set a 2"x30" aluminum mon. with magnetic pellet under cap and at base. Alum. cap. mkd Mon. set 3" above ground

Property corner mkds. the west boundary of National Forest land and east side of the Heartland trail

Property Corner

T14N R31W

S.5/U.S.A.
Land1983
R.L.S. No. 1226*

Mkd. Reference Trees:

1. W. Oak 7" S31E 73.40 Lower blaze + 50d nail

2. J. Pine 4" S61W 20.80 Lower blaze + 50d nail

Placed a 8' steel sign post S36°E at 2.5' from corner with both signs attached.

Line to Standard marked S W of corner

10/12/83 Gary Brama

9

Property Corner #3, Sec. 5

Set a 2" x 30" aluminum mon. with a magnetic
pebble under cap and at base. Alum. cap mkd.Property corner mkds. the east boundary of National
Forest Land and west side
of the Heartland Trail.Property Corner
U.S.A.
LAND 5.51983
R.L.S. NO. 1226

Mon. set flush with grd.

Mkd. Reference Trees:

1. R. Oak 3" N34E 18.05' Lower blaze, sod nail

2. W. Pine 5" S52E 18.90' Lower blaze, sod nail

Placed a 8" steel sign post 1.3' north with
both signs attached.

Line to Standard mkd. north from corner.

10/13/83 Gary Brune

Property Corner #4, Sec. 5

Set a 2" x 30" aluminum mon. with magnetic pellet under cap and at base. Alum. cap mkd.

Property corner mkds the east boundary of National Forest Land and east side

of the Heartland trail

Mon. set flush with grd.

Property Corner
T141N R. 31W

USA
LAND S. 5

1983
R.L.S. NO. 1226 1/1

Mkd. Reference Trees:

1. J. Pine 16" S10W 29.95 Lower blaze, sod nail

2. J. Pine 5" S17E 17.40 Lower blaze, sod nail

Placed a 8" steel sign post .65' south of corner with both signs attached.

Line to standard mkd. south of corner

10/13/83 Gary Brana

■ 10/30/97 RM + CK

MARKED NEW BT'S.

J. PINE 9 S31E 50.52 MKD PCSS BT

N. PINE 7 N88E 72.55 SPK + TAG

11 Special Meander Corner, #2 Sec. 5, E 1/4 Line

Set a 2" x 36" galv. conc. filled pipe
with B.C. mkd.

T141NR31W

Mon. set 4" above ground.

S | S

Corner set on east side of

S | S
SMC

National Forest Land.

1983
R.L.S. NO 1226*

Mkd New BT's:

Mkd.

1. N. Pine 15" N27W 71.4 SMC SSBT

2. J. Pine 6" N8W 30.90 SMC SSBT

3. W. OAK 8" S4E 75.67 S.MC SSBT

8' Steel sign post north 3.85'. Both signs

" " " " 55W 3.50 " "

12

ANGLE POINT 3, Sec. 5

Set a 2" x 30" Alum. monument with magnetic
pellet under cap and at base. Alum. cap mkd.

T141NR31W

S.5

A.P.3

1983

RLS NO 1226*

Mkd. New BT's:

Mkd

1. N. Pine 15" N26W 66.66' BT
(Same tree as for SMC)


2. J. Pine 16" S46W 52.03 BT

Placed 8' steel sign post east 2.75'
with attention sign facing corner. (Same
sign post used as tie for S.M.C., North 3.85).

13 Special Meander Corner (#1) on N-S 1/4 line Sec 5

At the intersection of the N-S Quarter line
and the adjusted original meander line set a

2"x60" galv., concrete filled iron pipe w/ brass
tablet marked:

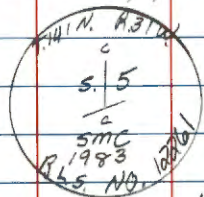

Corner is on
south facing slope.
Placed many large
rocks around monument

from which bears.

7" W. Oak N 79°W 25.82' to a 50d nail, single blade described

5" W. Oak N 26°E 33.03' ditto

6" W. Oak S 83°E 23.90' ditto

8' steel sign post North 3.4' w/ signs 54-9 & 54-2

8' steel sign post S 36°E 5.5' (on riparian line) w/ signs 54-9 & 54-2


10/11/83 TMC Hayes

14

Auxiliary Meander Corner #1 on the
westerly line of Gov't Lot 7, sec. 5

As an AMC on the westerly riparian (partition)
line of Gov't Lot 7, set a 2" x 60" galv. concrete
filled iron pipe w/ brass tablet stamped:

Corner is on ice berm 15' ± north
of water's edge and 65' ± south of G road.

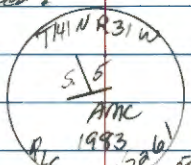

from which bears:


6" W. Oak S 81° W 37.27' db. blazed & scribed AMC 55 BT
50d nail
5" W. Oak N 49° W 18.22' db. blazed & scribed AMC 55 BT
50d nail
6" W. Oak N 2° W 21.22' db. blazed & scribed AMC 55 BT
50d nail
8' steel sign post N 36° W 3.0'

Monument is 4" 13"

10/13/83 MC Hayes

15 Auxiliary Meander Corner #2 on the easterly
line of Govt Lot 7, sec. 5

As an AMC on the easterly riparian (partition) line
of Govt lot 7, set a 2" x 60" galv. conctilled iron
pipe with brass tablet 15" above ground stamped:

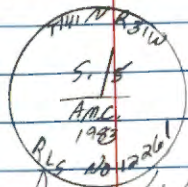

Corner is 6'± N7°E from lake shore and
80'± S7°W from county road

from which bears:

W. Pine 30" N43°E 35.12' to 50d nail

W. Oak 12" N35°E 111.35' to 50d nail

J. Pine 15" N38°W 3.28' to 20d nail (old B.M. tree)


3' steel sign post N7°E 2.05' w/signs 54-9° 54-2

10/13/83 M.L. Hayes

16 Special Meander Corner #3 on S $\frac{1}{2}$ line Sec 5

The intersection of the adjusted record original meander line and the S $\frac{1}{2}$ line of section 5 falls in the lake. A witness corner was set N 87° 59' 38" E. 105.74' which is a 2" x 60" galv. conc. filled iron pipe w/ brass tablet stamped:

Monument is up 14"

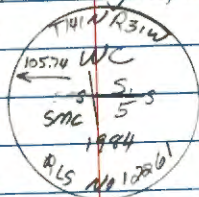

Cap. is at base of west facing slope and 30' (+) east of water's edge.

From which bears:

W. Oak 15" N 48° E 13.90' to sod nail


W. Pine 17" S 54° E 61.03' to sod nail scribed

8' steel sign post East 4.70'
WESMC 55 BT

3/29/94 by Krause Centered this book by 7002

17 South Sixteenth Cor. Secs. 4, 5 (W. C.)

The position for the $5\frac{1}{2}$ corner falls in the lake so a witness corner was set $S87^{\circ}39'38''W$ 294.11 ft from the true position. Set a $2" \times 60"$ galv. conc. filled iron pipe w/ brass tablet $162"$ above grd. stamped:

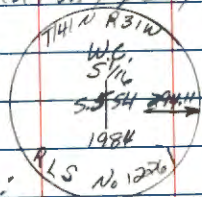

Monument is $127'$ north of creek, $75'$ west of water's edge and just east of a foot path.

from which bears:

W. Oak $10" S50^{\circ}W 271.0'$ to sod nail inscribed $S45.5 W 6 BT$

W. Pine $31" S87^{\circ}E 58.10'$ to sod nail inscribed $S4.55 W 6 BT$

$8'$ steel sign post East $3.0'$ w/signs $54-9 \& 54-2$

3/28/84 by Krause (entered by MEH)

18 West Sixteenth Con. to Secs. 5 & 8

From the cadastral survey of Sec. 5, midpoint and on line between the re-erected section corner westerly and the re-established $\frac{1}{4}$ cor. easterly, set a 2" x 60" galv. conc. filled iron pipe w/ brass tablet stamped:

T141111 R31W Monument was placed over a 2" x 48" tam. post and tablet projects 14" above surface of bog, approx. 210' (±) east of high ground.
W $\frac{1}{4}$ 5.5
5.8
R15 1983 NO 120' from which bears.

Tam. 9" S25°W 97.25' to 50d nail, single blaze scribed
W $\frac{1}{4}$ 5.8 BT

Tam. 4" S78°E 29.40' to 20d nail, single blaze scribed
BT

Tam. 6" N85°W 167.70' to 50d nail, single blaze scribed
W $\frac{1}{4}$ 5.8 BT


9' steel sign post North by 4.0'

8' steel sign post West by 4.4'

10/11/83 M. C. Hayes

19 Center Quarter Corner Sec. 5

At the intersection of the N-S and E-W
quarter lines set a 36" x 2" galv. concrete filled
iron pipe w/ brass tablet marked:

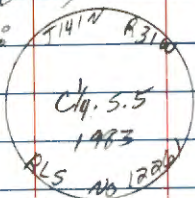

from which bears:

W. Oak 6" N31°W 10.20' scribed C/4 55 BT

W. Oak 5" N11°E 43.00' scribed C/4 55 BT

W. Oak 4" S55°E 15.15' scribed C/4 55 BT

8' steel sign post 4.2' north


8' steel sign post 4.0' south

9-21-83 by Krause (checked by MCH)

20 Center North Sixteenth Corner Sec. 5

At the proportionate distance between the N¹/₄ cor.
and the C¹/₄ cor, sec 5, set a 2" x 24" galv. conc. filled
iron pipe with brass tablet stamped:

(only a 24" pipe was set due to boulders
under surface)

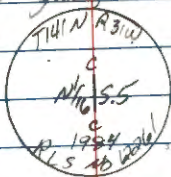

from which bears:

W. Oak 4" S 53° W 3.25' scribed C¹/₄ S 5 BT

R. Oak 10" N 16° E 34.35' scribed C¹/₄ S 5 BT

W. Oak 5" S 36° E 35.45' scribed C¹/₄ S 5 BT

8' steel sign post South 3.5'

8' steel sign post West 6.05'

3/28/84 by Krause (entered by me H)

21 Center East Sixteenth Corner Sec. 5

At the proportionate position between
the C $\frac{1}{4}$ and E $\frac{1}{4}$ sec. 5, this point being
a recovered 1" x iron pipe set in 1978 by
Walt Curo, RLS 11395 for this same corner position.


To perpetuate

7/18/84 CK GB JA

FD: 1" Iron pipe flush with surface

SET: 3' Brass Capped Iron Pipe up

1' with 1" Iron pipe below B.C.

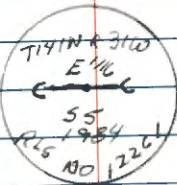

Witness by:

W. Oak	7"	N80E	27.65'	Blazed & scribed, tags spks, red rings
W. Oak	5"	S28E	24.47'	
W. Oak	10	S54W	44.15'	

Steel sign post 3" x 8" North 3.30'

Steel sign post 3" x 8" South 2.75'

Corner falls in hardwoods North Approx 300'
of Heartland trail running NE-SW


22. Northeast Sixteenth Cor. Sec. 5

At the intersection of the north and east one-sixteenth lines, this point being a recovered 1" x iron pipe set by Walt Curran, RLS 11395 in 1979 for this same corner position.

To perpetuate

7/17/84 CK GB JA

Ed. 1" Iron pipe - removed to set: 5' Brass capped Iron Pipe marked 142 1" with 1" Iron pipe on North side of B.C. flash

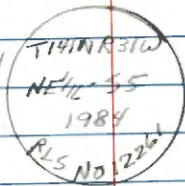

Witness by:

W. Oak 5" 536W 57.50' "BT" spl 109

W. Oak 7" 553E 76.75' NE 1/4 55 BT spl 109

W. Oak 6" N 09E 42.35' NE 1/4 55 BT spl 109


Steel sign post 3" x 8' SOUTH 4.0' ATT 9 Bdry

Steel sign post 3" x 8' EAST 4.1' ATT 8 Bdry

all accessories painted red

23. Southwest Sixteenth Cor. Sec. 5

At the intersection of the south and west one-sixteenth lines set a 2" x 36" galv. CONC. filled pipe with brass tablet mkd. Monument set 12" above grd.

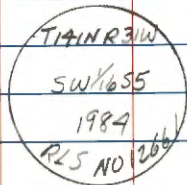

7/19/84-CK-GB-JA MKD. BT'S:

W. Oak 7" N82W 36.03 SW 1/6 55 BT

W. Oak 10" N44W 30.10' SW 1/6 55 BT


W. Oak 6" N19W 11.91 SW 1/6 55 BT

W. Oak 4' S83E 8.90' Nail on side

8' steel sign post 4.7 west and 5.9' south with both signs attached.

Line to standard south 9 west.


Corner on north side of 12" DBH birch stump.

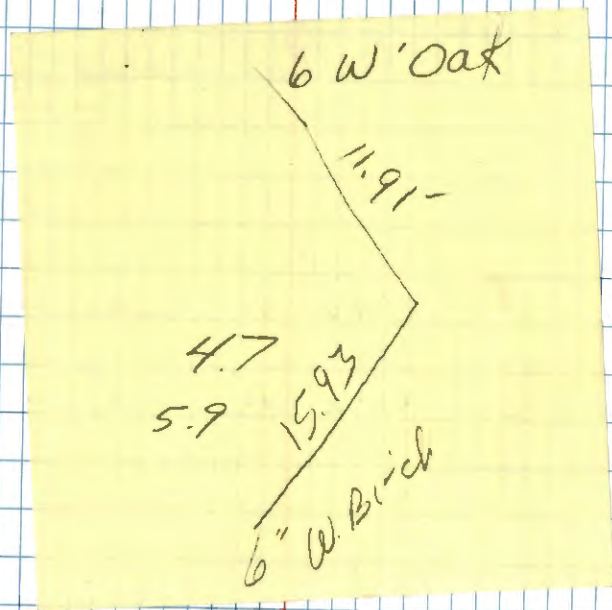

24

Quarter Corner bet. Sec's 4/5 (W.C.)

The position for the $\frac{1}{4}$ corner falls in the lake so a witness corner was set $N2^{\circ}08'11''E$ $123.00'$ from the true position. Set a $2" \times 24"$ galv. conc filled iron pipe w/ brass cap set below the road surface stamped:
Placed a magnetic pellet under monument

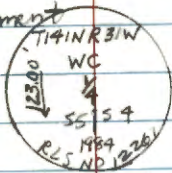

7/19/84 CK-JA-GB MKd. BT'S:

W. OAK	17	S54 W	66.13'	SPIKE & TAG
W. OAK	14	N62 E	121.15'	" "
W. OAK	12	S19 E	14.17'	" "

SEE Book # 2, page # 8

7/18/84 CK-GB-JA
4:00 p.m.

R.L.S. NO. 12664

4:30 p.m.

Changed to R.L.S.

12661

OK

25 J-20

E 1/16 BET. SEC'S. 11 & 14

10/22/85 - CK, GB, JA Fd.

2" X 5' LONG IRON PIPE WITH BRASS CAP MKD 8/30/85

TRAIN R 31 W

1/16 511

514

1985

LS 12684

BT'S. BY STEVENSON

ASPEN	9	N39E	35.77'	UPPER BLAZE SCRIBED BT
J. PINE	15	S73E	27.41	UPPER BLAZE SCRIBED BT
N. PINE	12	S19W	27.21	UPPER BLAZE SCRIBED BT

8' STEEL SIGN POST N 2.95' & S72W 2.8' BOTH SIGNS

BT NE COR. OF GRASS MARSH - OLD TRAIL 150' N BRS.

NW-SE

OLD MOND. WITH BRASS CAP ON 2" X 5' PIPE BRS. WEST 3.9'

CC Done

25

4- -08

FDIN PLACE AND GPS. FS 1 AND EAST IS
NOW YOUNG ASPEN. 1985 ASPEN IS GONE.
1985 J PINE IS NOW 8 FT SNAG. P. PINE NOW
A 15'.

26 J-19.20

INDIAN RESERVATION LINE

10/22/85-CK, JA, GB Fd:

2" x 3' LONG IRON PIPE WITH BRASS CAP MKD.

12" ABOVE GAD.

T1A1N R31W
R6S S11 E14
LINE
1985

RLS. 12684

BT'S. BY STEVENSON		IRON PIPE WITH BRASS CAP		9/5/85
BALSAM	6	S85E	38.97'	SCRIBED BT LOWER UPPER BLAZE
ASPEN	12	S20W	15.85'	SCRIBED BT LOWER UPPER BLAZE
W.OAK	6	N88W	76.45'	SCRIBED BT LOWER UPPER BLAZE

8' STEEL SIGN POSTS W 4.4' & E 2.6'

ON SIDE HILL SLOPE E&W IN ASPEN STAND

CC DOWD
11/85

27 J-18
WEST 1/4 BET. SEC'S. 11 & 14

10/22/85 CK, GB, JA Fd:
2" X 5' LONG IRON PIPE WITH CAP END.
19" ABOVE GROUND

TAIN R 3 1/2
1/16 S11
S14
1985
RLS 12684

BT'S BY STEVENSON

				UPPER BLAZE	
BALSAM	7	N31W	13.55'	BT	LOWER BLAZE
BIRCH	17	N57E	14.95'	"	"
BALSAM	9	S71E	16.35'	"	"

8' STEEL SIGN POSTS N 3.3' & W 3.1'

ON SIDE SLOPE ABOVE LAKE SHORE - GRASS MEADOW

BELOW HILL TO WATER

EAGLE NEST BRS S45W APPROX. 100 yds.

CC Done
11/85

28 H, J-17, 18 North Westerly 2184' to Mile Point 21, Sec. 11
Reference to Leach Lake Reservation

Gary Stevenson established this corner
by survey. He set on 7/19/85 -
2" x 2" x 36" Steel post with a 3" x 3"
aluminum cap on the reservation
line for a reference point.
Placed R.L.S. # on cap.

Marked New BT'S:

Blk. Spruce 9" ^{72 changed on 10/23/85} N65W 5.50' Spk

White Spruce 13" ³³ S25W 19.20 Spk.

Balsam 11" ¹⁴ N30E 26.54' Spk.

10/23/85 - CK, JA, GB

Found monument set 6" above ground.
Scribed BT on each tree recorded by
Stevenson. Made a correction on bearing
on each BT. See above

Mkd. New BT - Ash 7" N1E 22.50 BT

CC. Done

SOUTH EAST $\frac{1}{16}$ CORNER TO SECTION 12

NOTES OF GLO RE-SURVEY 1917

SET 1" x 36" IRON POST WITH BRASS CAP MARKED

SE $\frac{1}{16}$ S12

1917

FROM WHICH

POPLAR 10 N $56\frac{1}{2}$ E 83 LKS. 54.78'

POPLAR 12 N $45\frac{3}{4}$ W 120 LKS. 79.2'

SOUTHWEST 1/16 CORNER TO SECTION 1

NOTES OF GLO RESURVEY 1917

SET 1" X 3/16" IRON POST WITH BRASS CAP MKD.

8/11/87 CK MH' FD IRON & CAP - IN PLACE

IN GOOD CONDITION - 12" ABOVE GRD SW 1/16 S 1

AT W EDGE OF MOWED GRASS + RIGHT-OF 1917

WAY POST ON SOUTH SIDE OF Hwy 371 - 75'S OF Q. OF HWY.

FROM WHICH

N. PINE 10 N 16 3/4 E 175 LKS.

N. PINE 10 N 32 1/2 W 380 LKS.

MARKED NEW BT'S.

W. OAK 9 S 16 W 76.50' MK BT

W. PINE 10 S 85 W 57.95' MK BT

R. PINE 15 NORTH 17.00' MK BT

8' FG SIGN POST S 45 W 3.45' WARNING STICKER

6' ROW T POST SE 1.0'

CASS COUNTY LAND DEPT FOUND 1" GLO IRON, IN PLACE
NEAR HWY # 200 RIGHT OF WAY POST ON SOUTH SIDE
OF HWY. 200 - GARY STEVENSON LOCAL SURVEYOR
HAS ALSO TIED INTO THIS BRASS CAP IN LOCAL PLAT

ANGLE POINTS 1, 2, 4, 5

NOTES OF GLO RESURVEY 1917

SET 1" X 3/16" IRON POST WITH BRASS CAP MARKED

FO. IRON & CAP IN PLACE

10" ABOVE GROUND - IRON IS 6'

EAST OF WALKING TRAIL

80' NE OF EQ. OF SW. Q.

AP4	AP5
TR	TR
1216	1305
AP1	AP2
TR	TR
1595	1594

1917

NO B.T'S.

7/21/87

N. PINE	15	S29E	29.54'	MKD BT
N. PINE	18	N6W	15.44	MKD BT
N. PINE	16	S63W	34.32'	MKD BT

8' FGSP DUE EAST 2.75 FROM MONUMENT

THIS AP IRON POST IS ON CENTER LINE OF SEC. 12
MID POINT BETWEEN THE CENTER 1/4 AND THE
CENTER WEST 1/16 CORNER, 10.86 CHS. OR. 716.76 FT.

ANGLE POINT 3+4

NOTES OF GLO RESURVEY 1917

SET 1" X 36" IRON POST WITH BRASS CAP MARKED

AP4	AP3
TR	TR
1595	1594

1917

NO BT'S.

THIS AP IRON POST IS ON THE SOUTH $\frac{1}{16}$ LINE OF SECTION 12, BETWEEN THE CENTER SOUTH $\frac{1}{16}$ COR. AND THE SOUTH WEST $\frac{1}{16}$ CORNER. - CORNER IS ON LINE AND MID POINT BETWEEN $\frac{1}{16}$ CORNER'S GLO DISTANCE IS 10.42 CHS. OR 687.72 FT.

ANGLE POINT 243

NOTES OF GLO RESURVEY 1917

SET 1" X 3/16" IRON POST WITH BRASS CAP MARKED

AP2
TR1305

AP3
TR
1304

1917

NO B.T'S.

THIS AP IRON POST IS ON CENTER LINE OF SECTION 1/2
MID POINT BETWEEN THE CENTER 1/4 AND THE
CENTER NORTH 1/16 - 10.22 CHS. OR 674.52 FT.

ANGLE POINT 1 OF SECTION 12

NOTES OF GLO RESURVEY 1917

SET 1" x 3/16" IRON POST WITH BRASS CAP MARKED

512
TR 1304

API
TR 1305

1917

NO BT'S.

THIS ANGLE POINT IRON POST WAS SET MID POINT
ON LINE BETWEEN THE CENTER EAST 1/16 AND THE
NORTH EAST 1/16 CORNERS OF SECTION 12
GLO DISTANCE IS 10.06 CHS. OR 663.96 FT.

SOUTH 1/16 CORNER BETWEEN SEC'S. 1 & 2

NOTES OF GLO RESURVEY 1917

FOUND TO BE MARKED BY 2" GALVANIZED IRON PIPE

SET BY CASS COUNTY SURVEYOR JOHN CURE 1914

SET 1" X 36" IRON PIPE WITH BRASS CAP MARKED

FD. IRON CAP IN PLACE - IN GOOD COND. S'1/16

10" ABOVE GROUND. ALSO CO. 2" IRON S2 | S1

WITH CAP 20" HIGH AT SOUTH SIDE OF 1" P. 1919

RAISED MOUND OF STONES WEST OF CORNER

CASS COUNTY TIMBER DEPT. CHAINED AND RAN LINES

SOUTH AND EAST FROM THIS CORNER - LINE AND DISTANCES

CHECKED GOOD WITH GLO NOTES

8/10/87 CK MH

MARKED NEW BT'S.

W. OAK 9" IN CLUMP OF FOUR SOUTH MOST STEM

N 6° E 14.80' MKD. S'1/16 S1 BT

R. OAK 13 S 60° E S'1/16 S1 BT 53.80'

R. OAK 8 S 3° E S'1/16 S1 BT 58.92'

6' STEEL T POST DUE SOUTH 3.4' PAINTED RED

8' FGSP DUE EAST 3.2' WARNING STICKER

36 CONTINUED FROM BOOK 4 PAGE 29
EAST $\frac{1}{16}$ CORNER BET. SEC'S. 18 & 19

9/23/96 RM+CK

Fd. FOREST SERVICE MONUMENT

2" X 5' LONG IRON PIPE WITH BRASS
CAP - IN PLACE 34" HIGH MUST BE
SITTING ON LARGE ROCK - ALSO COUNTY
 $1\frac{1}{2}$ X 48" IRON PIPE - JUST NORTH OF
F.S. MONUMENT

REMAINS OF BT'S.

BOTH ASPEN BT'S. WILL BE CUT OFF
VERY SOON AS THEY WOULD BE ONLY
ASPEN LEFT STANDING ^{WHEN} ~~LOGGERS~~ FINISHES
IN AREA - WE REMOVED TAGS FROM ASPEN
R. OAK HAS DEAD TOP - BUT LOWER
PART HAS GREEN LIMBS - STILL USABLE.
WITNESS - 10" R. OAK STUB 544W 37.9'
MARKED NEW BT'S.

N. PINE 5 S30E 44.68' MKD BT'

W. PINE 9 S88E 25.83' MKD E $\frac{1}{16}$ S19 BT

W. PINE 6 S21W 23.65' MKD E $\frac{1}{16}$ S19 BT

8' STEEL SIGN POST NORTH 1.1'

REMOVED BENT UP 6' STEEL POST
CORNER ON E+W RIDGE ASPEN TO NORTH
PINE PLANTATION TO SOUTH
AREA E+W TO SOUTH OF CORNER WILL BE
LEFT AS IS NOW - AREA NORTH OF E+W
WLL BE LOGGED NOW MOSTLY ASPEN

END OF
BOOK.