

T146N R25W
CORNER
RESTORATION
BOOK #2

FIELD BOOK

82-0012

CORNER RESTORATION T146.25 BK2

LINKS IN FEET, 10THS AND 100THS OF FEET

Links	Feet	Links	Feet	Links	Feet	Links	Feet	Links	Feet	Links	Feet
1	0.66	18	11.88	35	23.10	52	34.32	69	45.54	86	56.76
2	1.32	19	12.54	36	23.76	53	34.98	70	46.20	87	57.42
3	1.98	20	13.20	37	24.42	54	35.64	71	46.86	88	58.08
4	2.64	21	13.86	38	25.08	55	36.30	72	47.52	89	58.74
5	3.30	22	14.52	39	25.74	56	36.96	73	48.18	90	59.40
6	3.96	23	15.18	40	26.40	57	37.62	74	48.84	91	60.06
7	4.62	24	15.84	41	27.06	58	38.28	75	49.50	92	60.72
8	5.28	25	16.50	42	27.72	59	38.94	76	50.16	93	61.38
9	5.94	26	17.16	43	28.38	60	39.60	77	50.82	94	62.04
10	6.60	27	17.82	44	29.04	61	40.26	78	51.48	95	62.70
11	7.26	28	18.48	45	29.70	62	40.92	79	52.14	96	63.36
12	7.92	29	19.14	46	30.36	63	41.58	80	52.80	97	64.02
13	8.58	30	19.80	47	31.02	64	42.24	81	53.46	98	64.68
14	9.24	31	20.46	48	31.68	65	42.90	82	54.12	99	65.34
15	9.90	32	21.12	49	32.34	66	43.56	83	54.78	100	66.00
16	10.56	33	21.78	50	33.00	67	44.22	84	55.44	101	66.66
17	11.22	34	22.44	51	33.66	68	44.88	85	56.10	102	67.32

STARTED 3/97


USFS

T146N R25W

BOOK#2

From _____ To _____
Region 9 Forest CHIPPEWA

5146 325 Ac.

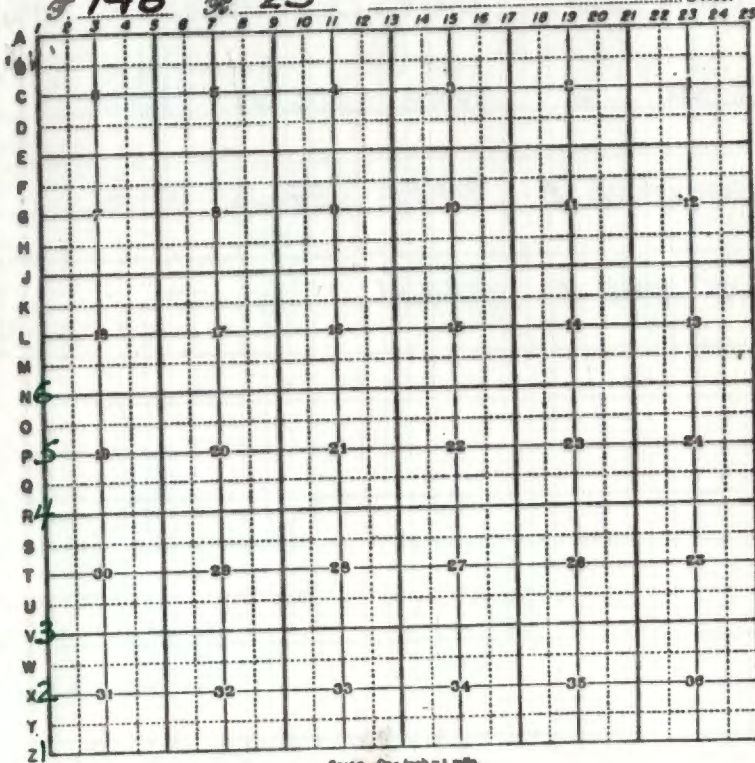

Z-1

TOWNSHIP CORNER TO SECTIONS 1-631-36
 ORIG. GOV'T. SURVEY 1876
 SET WOOD POST

CEDAR 8 N20E 145 LKS. = 95.70'

CEDAR 6 N4E 202 LKS = 133.32'

TAM. STUB 8 S87E 28 LKS = 18.48'

TAM. STUB 8 S88W — —

Index No. 2-1 ITASCA COUNTY LAND CORNER RECORD
 Location 1-6-31-36 T. 146 R. 25 P.M. 5
 Description County Monument
 Origin G.L.O. R.S. S.R. pg. 62 SUB. SET

Reference		Corner Perpetuation Record					
		Corner Mon.		Found/Date		Set/Date	
		Date	Wit.	Size	Bearing	Dist.	Rem.
1932 County Road survey							
1876	GLO Survey pg. 6	145-25					
	Cedar	8"	N20E	145	1ks.		
	Cedar	6"	N04E	202	1ks		
	Tam. Stub	8"	S87E	28	1ks.		
	Tam. Stub	8"	S88W				
1932	County Road. SR pg. 62						
		1932	Tam.	6"	N35E	40.50'	
		1932	Tam.	7"	S40W	58.50'	

Index No. A-1 ITASCA COUNTY LAND CORNER RECORD
 Location 1-6-31-36 T. 145 R. 25 P.M. 5th
 Description County Monument
 Origin G.L.O. R.S. S.R. SUB. SET

Reference		Corner Perpetuation Record					
		Corner Mon.		Found/Date		Set/Date	
		Date	Wit.	Size	Bearing	Dist.	Remarks
1876	GLO Survey pg. 6						
	Cedar	8"	N20°E	145	1ks.		
	Cedar	6"	N04°E	202	1ks.		
	Tam. Stub	8"	S87°E	28	1ks.		
	Tam. Stub	8"	S88°W				
1967	Feb. 2nd. Loose leaf notes for 145-26 pg. 86. Itasca Co. Surveyors Dept. set this from a 1932 Tam. witness. 10" S40°W 58.50'.	1967	Tam.	9"	N20°W	31.13'	
		1967	Tam.	7"	N35°E	37.00'	
		1967	Tam.	7"	825°E	19.42'	
1914	County ditch #3. SR pg 40. Govt corner.						
	Tamarack	4"	N30E	40.7'			
	Tamarack	5"	S33W	58.2'			
	Tamarack	5"	S17E	34.8'			
	Tamarack	4"	N46W	65.5'			

2 WEST RANGE LINE X-1

QUARTER CORNER BET. SECS. 31 & 36

ORIG. GOV'T. SURVEY 1876

SET WOOD POST

NO TREES WINDFALL SWAMP

Index No. X-1

ITASCA COUNTY LAND CORNER RECORD

Location 4 31 & 36

T. 106 R. 25 P.M.

Description


Origin G.L.O. R.S. S.R. 62 SUB. SET

Reference

Corner Perpetuation Record

1876 GLO Survey pg. 1 No trees near.
1932 County Road. SR pg. 62

Corner Mon.		Found/Date		Set/Dis
Date	Wit.	Size	Bearing	Dist.
1932	Top.	9"	N51E	41.20'
1932	B. of G.	7"	S87W	9.80'

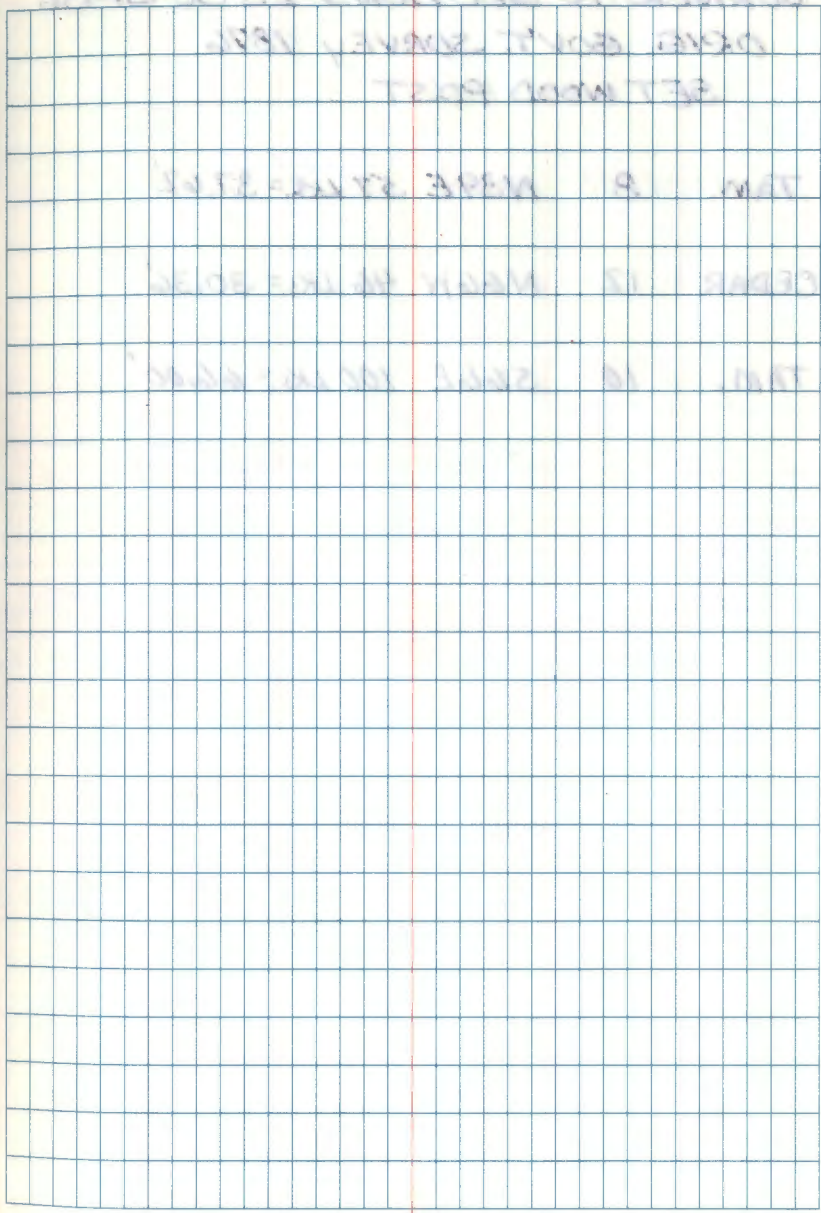

3 WEST RANGE LINE V-1

CORNER TO SECTIONS 25-30-31-36

ORIG. GOV'T. SURVEY 1876

SET WOOD POST

TAM. 8 N39E 57 LKS = 37.62'

CEDAR 12 N66W 46 LKS = 30.36'

TAM. 10 S66E 100 LKS = 66.00'

Index No. V-1
 Location 25-30-31-36
 Description C Monument
 Origin G.L.O. R.S. S.R. 12 SUB SET

ITASCA COUNTY LAND CORNER RECORD
 T. 146 R. 25 P.M. 5

Reference		Corner Perpetuation Record					
		Corner Mon.	Found/Date		Dist.	Remarks	
		Date	Wit.	Size	Bearing		
1876	GLO Survey pg. 2						
	Tam. 8" N39E 57 lks.						
	Cedar 12" N66W 46 lks.	1968	Cedar	5"	N63W	24.90	
	Tam. 10" S66E 100 lks.		" Cedar	7"	N65W	9.89 Tag	
1924	County road in Oteneagen Town		" Cedar	9"	S37E	12.94	
	SR. pg. 12		" Cedar	6"	S44W	26.15	
	Govt. Tam. N39E 37.6'						
	Govt. Tam. Stp. S66E 66.0'						
	Cedar 6" N27E 57.7'						
	Tam. 6" N35W 49.3'						
	Cedar 5" South 18.5'						
1968	IC loose leaf notes pg. 32						
	Find 1924 Tam. stp. N35W 49.3'						
	and 1924 Cedar stp. N27E 57.7'						
	Also find and old post point.						
	Set county monument and						
	rewitness.						
		1914	County ditch #3. SR pg 40.				
			Govt corner.				
			Tamarack 4"	NW		49.5'	
			Cedar 5"	NE		58.0'	
			Tamarack 4"	SW		46.8'	
			Spruce 6"	SE		63.0'	

5 WEST RANGE LINE P-1

QUARTER CORNER BET. SECS. 19+24
ORIG. GOVT. SURVEY 1876
SET WOOD POST

ASPEN 4 N11E 12 LKS = 792'

ASPEN 4 N80W 60 LKS = 39.60'

