

CORNER
RESTORATION
T147N R28W



MINING
TRANSIT BOOK


No. 3849

CORNER RESTORATION T147N R28W

FIELD NOTES OF NEW CORNERS ESTABLISHED

| Corners | Witness Trees | Inches Diam't | Courses They Bear | Dist. | Corners | Witness Trees | Inches Diam't | Courses They Bear | Dist. |
|------------------|---------------|---------------|-------------------|-------------------|---------------|---------------|----------------|-------------------|-------|
| 17-18-19-20 | Tam. | 12" | S. 33° E. 59.4 | Y4 Center | Poplar | 12" | N. 43° E. 62.2 | | |
| | | 9" | S. 65° W. 14.4 | Sec. 18 | " | 11" | S. 50° E. 51.7 | | |
| | Spruce | 6" | N. 40° W. 25.4 | Y16 N. 1 | Nat Set | | | | |
| | Cedar | 6" | N. 27° E. 30.5 | Y16 " 2 | Tam. Stub | 16" | N. 49° E. 57.1 | | |
| Y2-18-19 | Spruce | 10" | S. 27° E. 69.2 | Y16 " 3 | No other | | | | |
| | Poplar | 7" | N. 49° W. 43.2 | Y16 " 4 | Poplar | 10" | N. 47° W. 16.7 | | |
| Y4-7+18 | Spruce | 8" | S. 31° W. 37.3 | Y16 " 5 | " | 12" | S. 7° E. 7.5 | | |
| | " | 5" | N. 47° W. 30.8 | Y16 " 6 | Tam. | 2" | N. 41° E. 46.6 | | |
| N.T.C. Y4 Line | Elm | 8" | S. 8° E. 59.7 | Y16 " 7 | " | 6" | S. 47° E. 42.7 | | |
| 310 N. of Y16 #2 | No other | | | Y16 " 8 | " | 9" | N. 80° W. 22.4 | | |
| Y9-13+18 | Spruce | 6" | S. 38° E. 53.4 | N.T.C. 950' E. of | No trees near | 3" | N. 55° E. 28.5 | | |
| | " | 8" | N. 75° W. 74.6 | 12-13-7-18 | " | 8" | N. 75° W. 13.4 | | |
| N. Y16-13+18 | Poplar | 10" | S. 37° W. 60.6 | N.T.C. 585' E. of | " | 7" | S. 20° E. 24.9 | | |
| | " | 12" | N. 82° E. 55.3 | Y16 #2 | " | 10" | N. 27° E. 20.5 | | |
| 12-13-7+18 | Spruce | 7" | N. 87° W. 195.8 | N.T.C. of 17+18 | " | 8" | S. 61° W. 16.2 | | |
| | Stub | 8" | S. 2° E. 106.8 | 75.6' N. of Y9 | " | 8" | N. 16° E. 30.8 | | |
| | No other | | | N.T.C. 580.9' N. | Poplar | 14" | S. 24° W. 65.0 | | |
| S. Y16-12+18 | Poplar | 8" | S. 70° W. 32.7 | Y16 #3 | No other | 7" | S. 5° E. 14.8 | | |
| | " | 10" | N. 76° W. 45.6 | N.T.C. 624' N. of | Poplar | 7" | S. 44° W. 12.8 | | |
| 2-B-17+18 | " | 6" | S. 83° W. 33.0 | Y16 #3 | " | | | | |
| | " | 6" | S. 51° E. 40.7 | | | | | | |
| | " | 6" | N. 63° E. 36.4 | | | | | | |
| | " | 6" | S. 31° W. 54.4 | | | | | | |
| 18-19-12-24 | " | 15" | N. 18° E. 61.1 | | | | | | |
| | " | 13" | N. 67° W. 65.1 | | | | | | |
| | " | 9" | S. 28° W. 28.8 | | | | | | |
| | " | 9" | S. 55° E. 68.6 | | | | | | |
| S. Y16-12+18 | " | 11" | N. 58° W. 50.9 | | | | | | |
| | " | 9" | N. 49° E. 47.9 | | | | | | |
| E. Y16-18-19 | " | 10" | S. 10° W. 34.8 | | | | | | |
| | Tam. | 5" | N. 1° W. 32.3 | | | | | | |
| N. Y16-18-19 | " | 12" | S. 40° W. 25.8 | | | | | | |
| | No other | | | | | | | | |

- ⊙ Govt. Corners.
- ⊙ Re-established Corners.
- Iron Monuments.

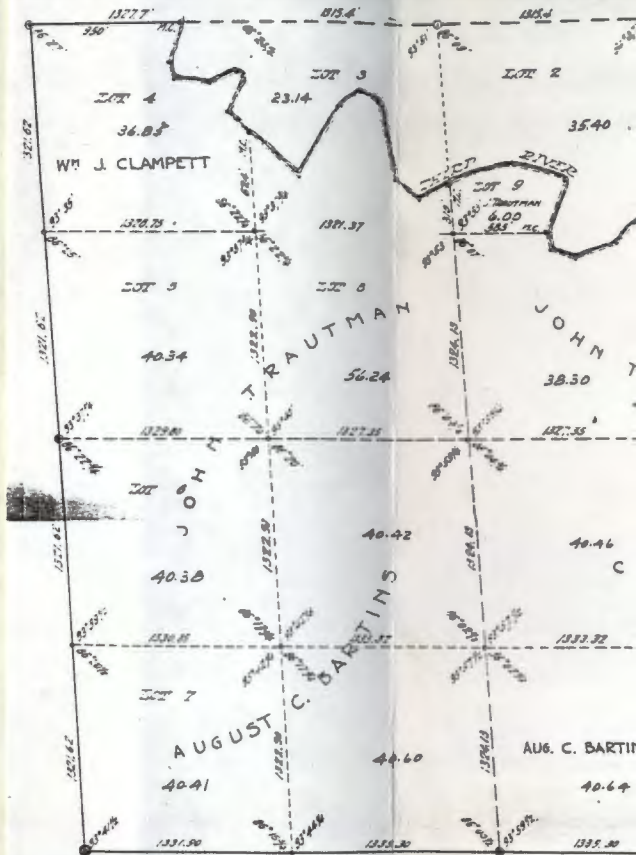


SEC. 16 TWP. 162 NORTH RANGE 29 WEST OF 5th P. M. ITASCA COUNTY, MINN.

SURVEYED AUG. 4th 1921 BY E.W. JOHNSON DEPT. CO. SURVEYOR.

5th P.M.

| Times Trees | Inches Diam't | Courses They Bear | Dist |
|------------------|------------------|----------------------|------|
| plow | 12" | N. 93° E. | 62.2 |
| " | 11" | S. 50° E. | 51.7 |
| 1 set w. 5th. | 16" | N. 49° E. | 57.1 |
| other plow | 10" | N. 47° W. | 16.2 |
| " | 12" | S. 7° E. | 7.5 |
| " | 7" | N. 41° E. | 46.6 |
| " | 6" | S. 47° E. | 42.7 |
| " | 9" | N. 80° W. | 22.4 |
| " | 3" | N. 55° E. | 28.5 |
| rucc | 8" | N. 75° W. | 13.4 |
| " | 7" | S. 20° E. | 24.9 |
| plow | 10" | N. 27° E. | 20.5 |
| " | 8" | S. 61° W. | 16.2 |
| " | 8" | N. 16° E. | 30.8 |
| tree near | 8" | S. 8° E. | 40.9 |
| " | " | " | " |
| " | " | " | " |
| plow | 14" | S. 24° W. | 65.0 |
| other plow | 7" | S. 5° E. | 14.8 |
| " | 7" | S. 44° W. | 12.9 |

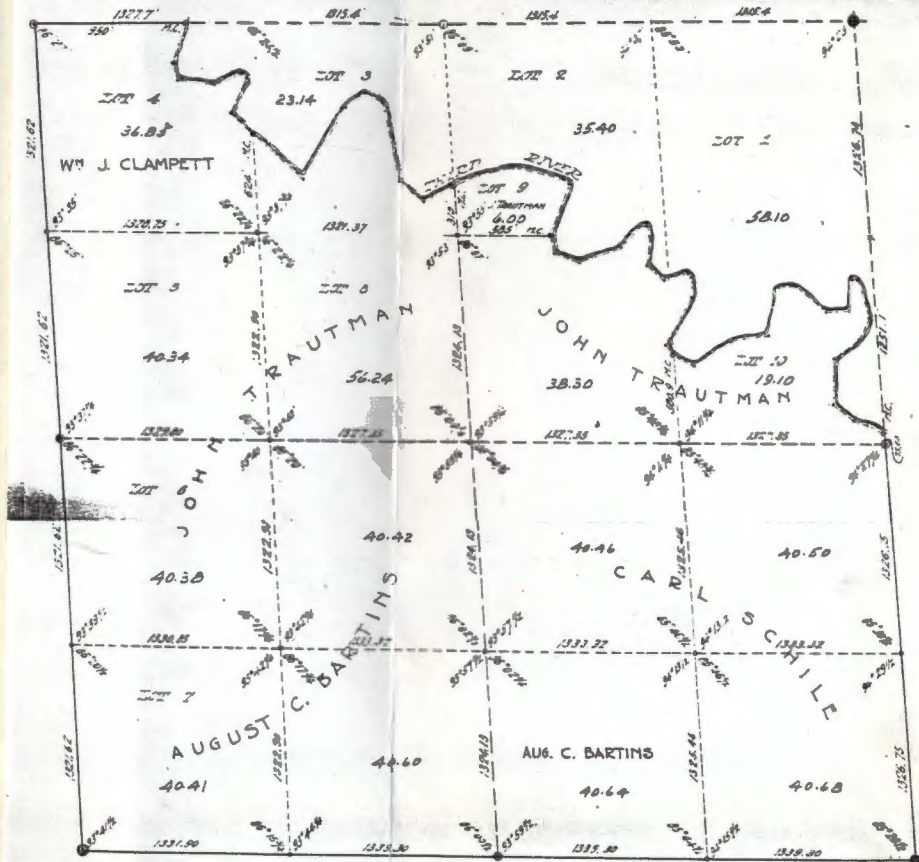



USFS Book 1

T147N R28W

5th P.M.

23 22 21 20

6 27 5 25 4 24 3 52 2 40 1

67 26 19 50 51

7 66 8 62 9 18 10 49 11 12

6 3 8 65 61 17 57 47 48 35 36 37

5
4 13 34 17 60 16 16 15 46 14 39 13

10 7
9 12 2 11 1 64 15 56 44 45 32

19 20 59 21 14 22 43 23 31 29

63 58 55 41 42 29 30

29 28 54 27 26 28 25

53 38

31 32 33 LAKE 34 35 36

WINNIE

Colored Numbers, refer to
Page ON which Notes for
that Corner may be found.

SURVEY BY P.H. CONGER

FEB. 23 1874

MAR. 6 1874

N-5 R9-5680-11
affidavit 12/8/78

Section Cor. Sec's 17-18-19-20
Survey of P.C. Warner in 1921.
Plat is recorded in Itasca
Co. Courthouse.

Iron Monument. Found a pipe w/
Aluminum Cap set by Itasca Co.

Tam 12" S33°E 59.4' (Now 14" Tam.
stump S26°E true 59.4 feet scribe "BT")

Tam 9" S65°W 14.4' (Now 16" Tam stump
S72°W true 14.4' scribe "BT") Fd. 1991

Spruce 6" N40°W 25.4'

Fd well rotted stp. w N32W w 25.4

Cedar 6" N27°E 38.5'

4/8/91 Found rotted cedar stp w N33E w 35.5

Recent County bearing trees
Tam. 12" N3°W 24.8' MKD S18 BT
NOW DEAD SNAG

Cedar 7" S88°E 39.8' " S20 BT
NOW WINDFALL


Cedar 12" S17°E 39.2' " S20 BT
NOW BROKEN OFF SNAG

I placed Bearing tree shields on these
trees.

Set a 4"x4"x6' Red topped cedar post w/
ES standard signs 54-2, 54-9 attached
North

May 8, 1970 Robert H. Donald
on map
AKS
1976

ORIG. BT'S. TAM. 4 N40W 76 LKS. = 50.2' Fd no evidence
TAM. 6 S53W 19 LKS. = 12.5' Fd no evidence
TAM. 8 N33E 70 LKS. = 46.2' Fd no evidence
PINE 20 S28E 86 LKS. = 56.8' - Fd. Pine stp. 059.3

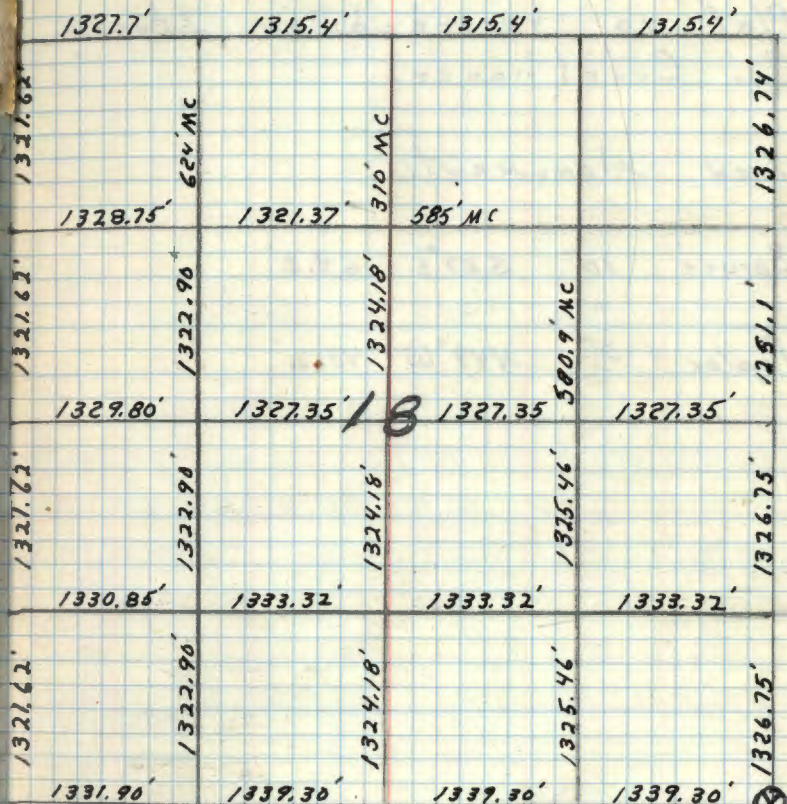

3/18/91 CK

FD. COUNTY IRON & ALUM. CAP - IN PLACE - IN SWAMP

MARKED NEW BT'S.

GEDAR 9 N34W w 53.9' MKD S18 BT
GEDAR 10 N57E w 41.7' " S17 BT
CEDAR 9 S80E w 59.5' " S20 BT

B STEEL SIGN POSTS NORTH 3.0' AND EAST 3.0'
CORNER IS 100' NORTH OF FR 2171

Quarter Cor. Sec's 18-19
Survey of P.C. Warner in 1921.
Plat is recorded in Itasca
Co. Courthouse.

Iron Monument:

Spruce 10" S27°E 69.2'

Poplar 7" N49°W 43.2'

9-21-2009 R. MAIN

SEARCH FOR IRON FALLS IN NORTH
DITCH AREA OF THIRD RIVER ROAD.

Quarter Cor. Sec's 7-18
 Survey of P.C. Warner in 1921.
 Plat is recorded in Itasca
 Co. Court house.

Iron Monument.

NO IRON FOUND - SWAMP FROZEN & SNOW COVERED

Spruce 8" S11°W 37.3'

3/27/91 Fd. SPRUCE STP AT S18W 37.3' SCRIBE VISIBLE

Spruce 5" N47°W 30.8'

Fd. ROTTED SPRUCE STP. AT N40W 31.0' BAD SHAPE

3/21/91 GB - Measured from M.C. (west) 1693

at 384E. Found no evidence of corner. Had
 locator. Found older F.S.L.P. on 9" Black spruce
 with no information. Tag is approx 12' north
 of my distance & line. Placed a new F.S.L.P.
 at end of my line on 7" tamarack for approx
 corner. No living spruce near area, but many
 nice tamarack.

3/27/91 GB-OK

NO IRON WAS FOUND - SWAMP FROZEN - SET 60° SPK. AT DISTANCE
 AND BEARING FROM CO. BT'S.

MAKED NEW TIES

TAM. 13 NSSE 17.45' TAG & SPK.

TAM. 8 N71W 3.9 " "

SPRUCE 9 N44W 18.47 OLD F.S.L.P. & NAIL

CHAINED AT NZE FROM CORNER ACROSS 3RD RIVER
 1324 AND FEN 15' W BE COR. - DISTANCE OK
 F.S.L.P. BY GB 15 ON TAM TIE N71W 3.9'

874 CCC NOTES By Wm H. PLITCHER 11/26/28

Fd. CEDAR POST 4'X4'X 24" SCRIBED

Fd. SPRUCE 8 S10W 54 LKS. = 35.64'

Fd. SPRUCE 5 N47W 46 LKS. = 30.36'

PUT POSTER ON SPRUCE 6 ON NW SIDE OF CORNER
 CORNER BRS. S52E 26 LKS. = 17.16'

L-1

Quarter Cor. Sec's. 13-18
Survey of P.C. Warner in 1921.
Plat is recorded in Itasca
Co. Courthouse.

Iron Monument:

Spruce 6" S38°E 53.4'

Spruce 8" N75°W 74.6'

Searched 2 hours for this corner - No
evidence found. placed F.S metal
location poster on a 7" aspen at
approx. corner. I had chained south
1321.6' from N¹/₁₆ 5/7/20 *Patricia D. Dault*

4/8/91 GB-CK

Fd. 1" IRON PIPE LYING ON GROUND - AT 1332' AT N84W
FROM IRON FOUND AT CW¹/₁₆ - Fd. TAG ON ASPEN 11
MKD TAG N84E 19.5' FROM IRON LYING ON GROUND
Fd. SMALL PINE STUMP AT S28E - S3'E HAS CHOP MARKS
NO SCRIBE - NO OTHER EVIDENCE COULD BE FOUND
FSLP ON WEST SIDE OF ASPEN - APPEARS DISTANCE
FROM NORTH IS WITHIN 2.0'

384 50%

5 K-1 Affidavit 12/18/78

North $\frac{1}{16}$ Cor. Sec's. 13-18

Survey of P.C. Warner in 1921.
Plat is recorded in Itasca
Co. Courthouse.

Iron Monument Found a 1" ϕ iron
pipe marking corner.

Poplar 12" S 37° W 60.6' (Now aspen stump
S 44° W True bearing 60.6')

Poplar 10" N 82° E 55.3' (Now aspen stump
N 89° E True bearing 55.3')

Set a 2" inside dia. 5' long galvanized steel
pipe filled w/ concrete and capped w/
a 3" ϕ bronze tablet stamped:

T147N
R29W R28W
N $\frac{1}{16}$
S 13 S 18
1970
RLS No 6807

Elm 7" S 89° E 33.8 Feet MKD N $\frac{1}{16}$ S 18 BT

Elm 12" S 85° W 11.1 Feet MKD N $\frac{1}{16}$ S 13 BT

Steel sign post 72" long w/ F.S. standard
signs 54-2 & 54-4 attached set South 3.7'


5/17/70 by ~~Richard McDonald~~

3/21/91 BEAMA - Found monument + 2'
above ground. Both Elm found dead.

T147N R9-7150-4

R29W

R28W

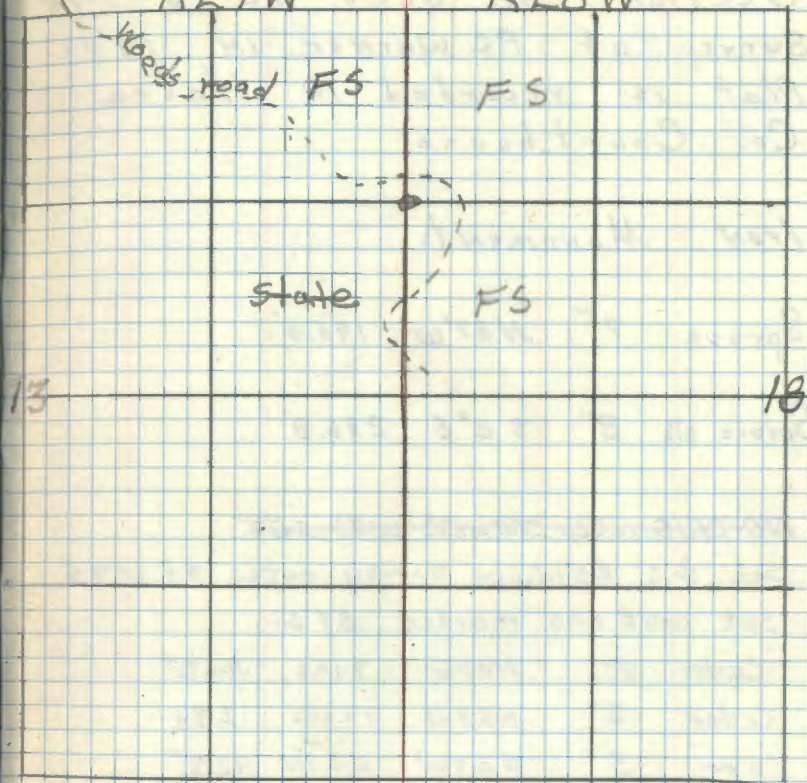

old woods road is approx. 150' North of
corner.

orig
MKD
RLS, 1920

Section Cor. Sec's. 12-13-7-18
 Survey of P.C. Warner in 1921.
 Plat is recorded in Itasca
 Co. Court house.

IRON MONUMENT:

Spruce 7" N87°W 195.0'

Spruce stb 8" S 2°E 286.8'

~~NO ORIGINAL CORNER WAS SET~~

See B.C. Baldwin survey notes of 1875

Set post and marked BT's:

Cedar 5" N80E 71ks. 4.62'

Cedar 5" N53W 191ks. 12.54

Tam 5" S23W 631ks. 42.9'

Cedar 5" S21E 181ks. 11.98'

3/21/91-GB - Measured 1322' at NZE from
 N¹/₆. Found no evidence. Then measured
 from approx. S.C. 950' at S84E to M.C.
 Found M.C. @ 977'. Place a FSLP
 on 3" Balm of Gilead @ N12E @ 40' from
 approx S.C. Corner falls in willow
 swamp that has been recently disc. for
 a wild life opening. High open ridge west.

South $\frac{1}{4}$ Cor. Sec's. 17-18

Survey of P.C Warner in 1921.

Plat is recorded in Itasca Co. Courthouse.

Iron Monument:

Poplar 8" S78°W 32.7'

NO EVIDENCE AT S84W 32.7' SNOW 1' DEEP

Poplar 10" N76°W 45.6'

NO EVIDENCE AT N69W 45.6' SNOW 1' DEEP

3/19/91 GB-CK

RAN LINE AT N1°E AND CHAINED 1327' CAME OUT AT 1" DIA.

IRON PIPE - IN PLACE - 6" ABOVE GROUND

TIES FOUND

| | | | | |
|--------|----|------|--------|-----|
| ASH | 11 | N63E | 20.42' | N+T |
| W. OAK | 8 | S48E | 57.35' | N+T |
| W. OAK | 5 | S8W | 26.0' | N+T |

AREA SW & NW OF COR. IS CUTOVER ASPEN REGENERATION
CORNER ON DOWN SLOPE 20' S OF ENTER LOWLAND NW

8
Section Cor. Sec's 7-8-17-18
Survey of P.C. Warner in 1921.
Plat is recorded in Itasca
Co. Courthouse.

Iron Monument

1 Poplar 6" S83°W 33.0'

1 Poplar 6" S51°E 40.7'

Poplar 6" N63°E 36.4'

Poplar 6" S31°W 54.4'

ORIG. GOV'T. TIES

| | | | |
|------|---|------|------------------|
| TAM. | 6 | S73W | 27 LKS. = 17.82' |
| TAM. | 6 | S60E | 22 LKS. = 14.52' |
| TAM. | 6 | N9W | 26 LKS. = 17.16' |
| TAM. | 6 | N14E | 18 LKS. = 11.88' |

3/28/91 GB-CK
CHAINED LINE AT S84E FROM N¹/₄ SEC. 18
A DISTANCE OF 2631' - END OF CHAIN FALLS
IN ROTTED DOWN WINDROW - IN N. PINE PLANTATION
PLACE FSLP ON 5" ASPEN S84E 5.0' FROM END
OF CHAINING - NO EVIDENCE OF IRON OR BT'S.
WILL CHAIN UP FROM E¹/₄ ON LATER DATE

3/29/91 GB-CK
FELT IRON AT E¹/₄ SEC. 18 - RAN LINE AT N1E ACROSS THIRD RIVER
2631' FELL 15' W OF STA. 2631' ON THURSDAY - WE SEARCH
WITH LOCATER IN AREA - NO IRON FOUND
BY INTERSECTING LINES WE ESTABLISH APPROX. SEC. COR.
PLACE FSLP ON N. PINE 10" N3E + 21.0' FROM APPROX.
LOCATION BASED ON COUNTY DISTANCES FROM N¹/₄
AND E¹/₄ TO SECTION 18 PLAT
TAG ON ASPEN REMOVED
SEARCH AREA AT EDGE OF WINDROW ROTTED DOWN
AND EDGE OF N. PINE PLANTATION NW-SE
PLACE FSLP ON 4" ASPEN - ON EAST SIDE OF WOODS ROAD
272' S84E TO APPROX. SEC. COR.
CORNER IS 300' E OF WOODS ROAD NW-SE

-9 N-1 Affidavit R9-7150-4
12/8/78

Section Cor. Sec's 18-19-13-24
Survey of P.E. Warner in 1921.
Plat is recorded in Itasca
Co. Courthouse.

Iron Monument: (Found a 1" dia. iron
pipe marking corner)
Poplar 15" N18°E 61.1'

Poplar 13" N67°W 65.1' (Now a Aspen
windfall mostly decayed N67°W 65.1' w/ window facing
corner)
Poplar 9" S28°W 28.8'

Poplar 9" S55°E 68.6'

Found a 6" dia. concrete brass capped mon. on South
side and adjacent to the iron pipe. Cap is
stamped: U.S.G.L.O.


T197N
R29W R28W
S13 S18
S24 S19
1932

MKD new BT
ELM 6" ROTTED WINDFALL S63°W 85.5' MKD S24 BT
Birch 12" NEW WINDFALL WINDFALL N82°E 51.8' MKD S18 BT

Cedar Post 4" x 4" x 72" penta-treated w/ red
top North 2.7' 8-20-62
SEE PAGE 33 FOR HISTORY

Affidavit PHM
SEE PAGE 33 FOR HISTORY THIS BOOK

13 09-15-2009 R. MAJN
FD MONUMENT IN PLACE AND GPS. 1987 CARSONITE
POST IS SHATTERED NOW 3' TALL. 1962 4x4 IS GOOD. 18

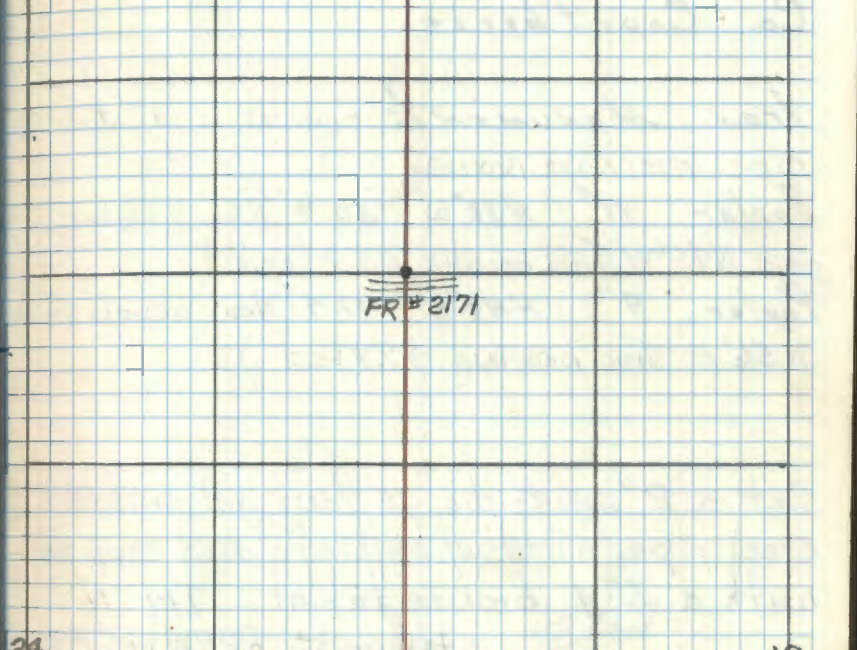

24 Corner is on top of ditch back slope on
North side of third River Road. 19

10/15/86 GB, JA - Removed 6" x 24" concrete cyl
for road construction. Placed a magnet
2 1/2" down on bottom of hole.
FD. both BT's recorded by McDonald
in 1962.
New BT's:
Aspen 9 7/4" N 36 E 40.35 Tag, spike scribed
Aspen 9" H" S 32 E 98.93 " " 518 BT
E.C. Dome 2/5/87 GB S19 BT
Reset 6" x 24" concrete cyl. flush
with ground on our slope of ditch.
Placed a carsonite sign post east 3.2 with a/sign
Corner set approx. 15.5' north of C of road.

M-1 Affidavit R9-5630-1
12/8/78

South $\frac{1}{6}$ Cor. Sec's 13-18
Survey of P.C. Warner in 1921.
Plat is recorded in Itasca
Co. Courthouse.

Iron Monument: Found a 1" ϕ iron
pipe marking corner

Poplar 11" N52°W ^{Mag.} 50.9 (Now a stump
hole. N45°W True bearing 50.9 feet.)

Poplar 9" N49°E ^{Mag.} 47.9 (Now aspen stump
N56°E True bearing 47.9 feet.)

Set a 2" inside dia., 5' long galvanized
steel pipe filled w/ concrete and capped
with a 3" ϕ bronze tablet T147N

stamped: R29W | R28W

S $\frac{1}{16}$
S13 | S18

1970

RLS No 6807

Elm 11" N12°E 74.9 feet MKD S $\frac{1}{16}$ S18 BT

Birch 12" S42°W 56.4 feet MKD S $\frac{1}{16}$ S13 BT


Steel sign post 72" long w/ F.S. standard
signs 54-2 & 54-9 attached set North 4.5'

5-8-70 *Paul H. McDaniel*

Affidavit RHM T147N

R29W

R28W

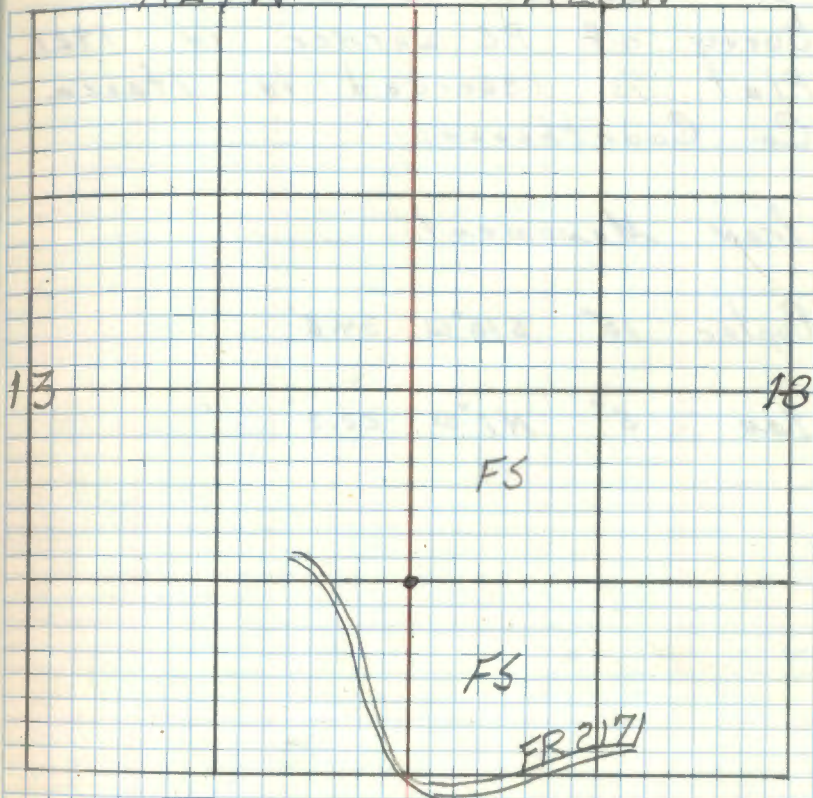

RLS
1970
12261

11
East $\frac{1}{4}$ Cor. Sec's 18-19
Survey of P.C. Warner in 1921.
Plat is recorded in Itasca
Co. Courthouse.

Iron Monument:

Poplar 10" S10°W 34.8'

tan 5" N1°W 22.3'

West $\frac{1}{6}$ Cor. Sec's. 18-19.
Survey of P.C. Warner in 1921.
Plat is recorded in Itasca
Co. Courthouse.

Iron Monument:

tan. sp. 12" S40°W 25.8'

Center Quarter Cor. Sec. 18.
 Survey of P.C. Warner in 1921.
 Plat is recorded in Itasca
 Co. Courthouse.

Iron Monument:

FD. 1" IRON PIPE LEANING SOUTH IN ASH SWALE

Poplar 12" N43°E 62.2'

NO EVIDENCE AT N50E 62.2'

Poplar 11" S50°E 51.7'

NO EVIDENCE AT S42E 51.7'

3/27/91 GB+CK

FD. 1" OD IRON PIPE LEANING SOUTH - IN ASH SWALE

5" ABOVE GROUND

CHAINED AT N2E 1324 - FELL 8' W OF IRON

PLACE FSLP ON 5" ASH NORTH 12.0' FROM IRON

CONTINUE N2E TO CN'16

4/8/91 PLACE FSLP ON 3" ASPEN ON EAST SIDE OF FR 3139

C'14 IS 325' S84E FROM TAG

14
Quarter Corner Sec's 21-22

Notes of original Gov't. Survey of 1874

Pine $30''$ N 17° W 80 lks. (52.80')

Cedar $10''$ S 16° E 17 lks. (11.22')

15
Corner Sections 15-16-21-22

Notes of orig Govt. Survey of 1874

Cedar 10° S 16° W 73 Iks. (48.18')

Cedar 8° S 33° E 27 Iks. (17.82')


Tamarack 4° N 18° W 26 Iks. (17.16')

Poplar 3° N 20° E 19 Iks. (12.54')

Quarter Corner Sections 15-16
Notes of original Govt. Survey 1879

Tamarack 4" S 19° W 36 lks. (23.76')

Cedar 5" N 18° E 20 lks. (13.20')

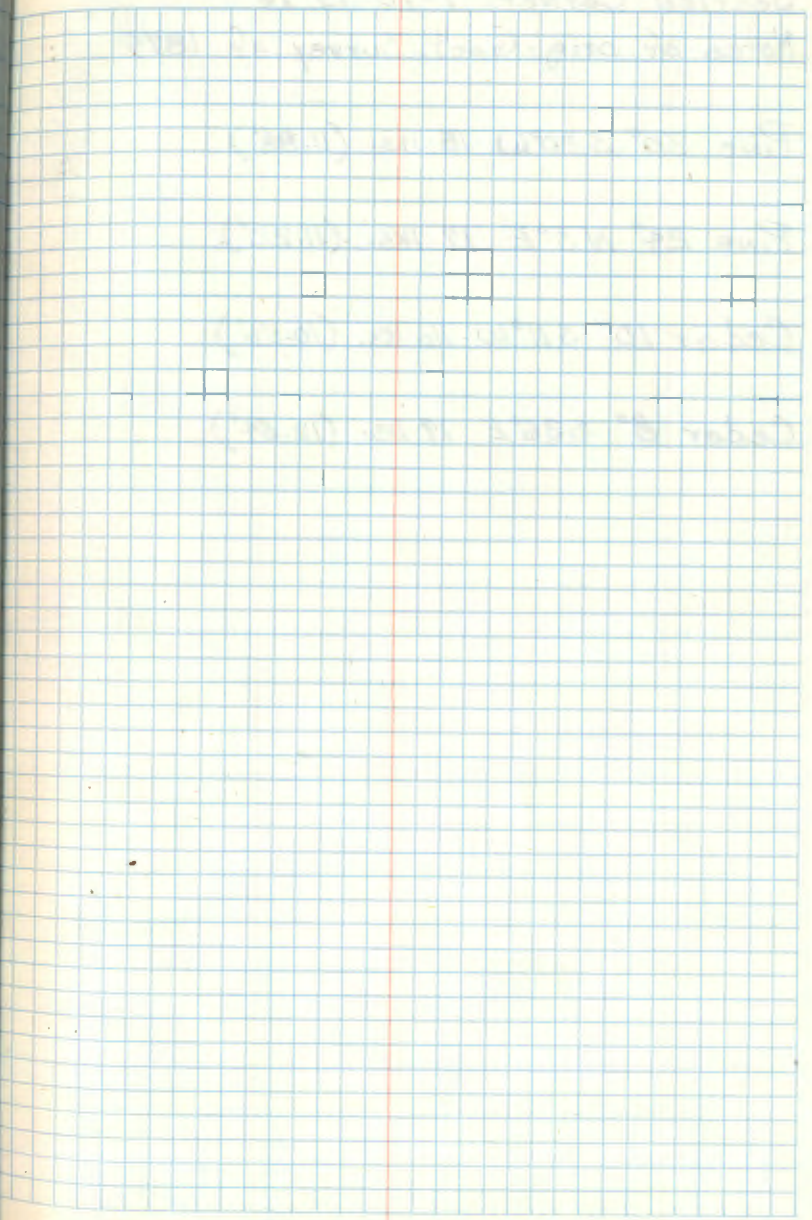


Section Corner 9-10-15-16
Notes of orig. Govt. Survey of 1874

Pine 30" S20°W 18 kcs. (11.88')

Pine 24" N3°E 17 kcs. (11.22')

Cedar 10" S11°W 16 kcs. (10.56')

Cedar 8" S36°E 19 kcs. (12.54')

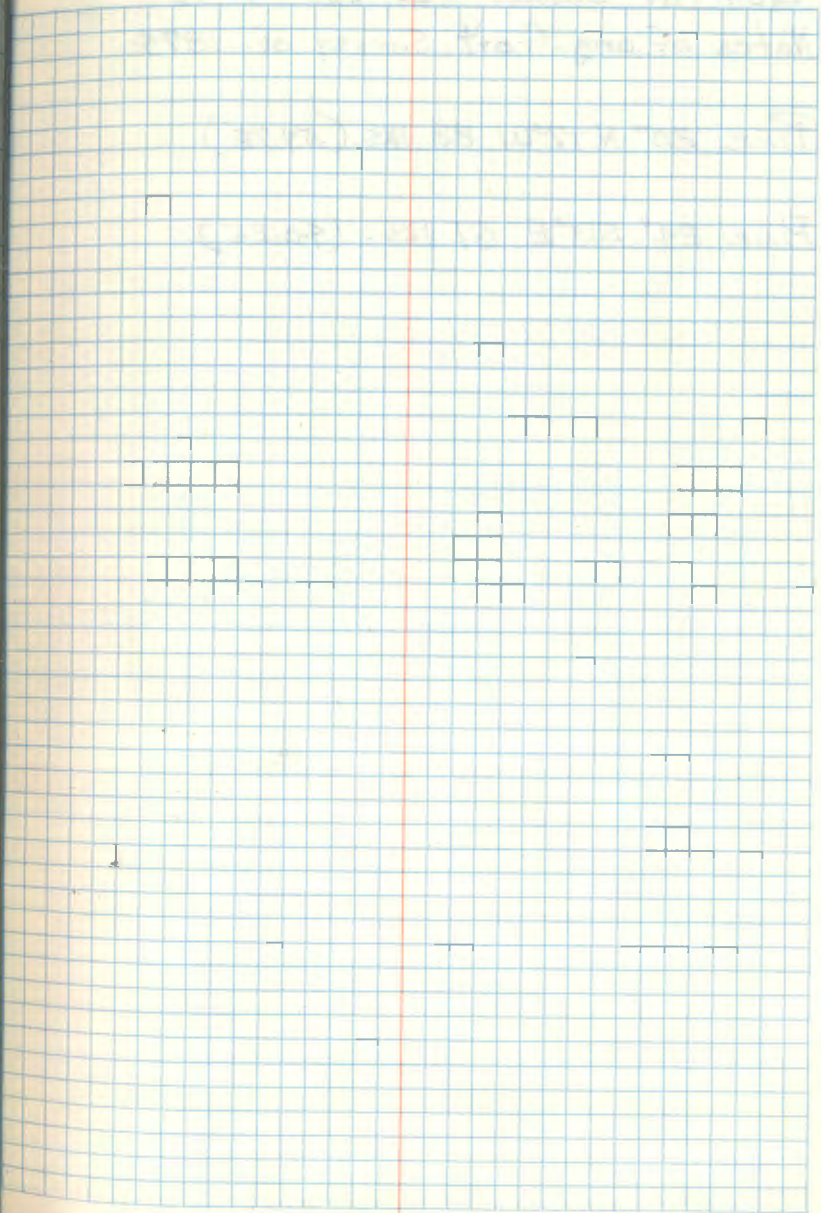

18
Quarter Corner Sections 9-10
Notes of orig. Govt. Survey of 1874

Pine 20" N 17° W 83 lks. (54.78')

Pine 24" S 13° E 61 lks. (40.26')

Corner Sections 3-4-9-10

Notes of orig. Gov't. Survey of 1877

Pine 26" S17°W 36 lks. (23.76')

Pine 20" S23°E 80 lks. (52.80')

Cedar 6" N64°W 19 lks. (12.54')

Cedar 6" N10°E 46 lks. (30.36')

Quarter Corner Sec's 3-34 T147-148N

Notes of orig. govt. survey

Post

Cedar 6" S11°W 19 Iks

Cedar 6" N48°E 27 Iks

SEE PAGE 13, BOOK 2, 148-28

Sec Corner 3-4-33-34 T147-148N

Notes of orig. Gov't. Survey

Post

Poplar 3" S 18° W 96 Iks.

Poplar 4" S 80° E 21 Iks.

Poplar 4" N 29° W 37 Iks.

Poplar 3" N 3° E 16 Iks.

Quarter Cor. Sec's. 4-33 T148-147N

Notes of orig. govt. survey

Post

Pine stub 8" S 90° W 21 Iks.

Pine stub 7" N 11° E 13 Iks.

23
Corner sections 4-5-32-33 T147-148N

Notes of orig. gov't. survey

Post

Pine 10° S60°W 48 1ks.

Pine 6° S86°E 38 1ks.

Spruce 4° N61°W 24 1ks.

Ash N 31°E 67 1ks.

874 CCC NOTES By C.B. STOTT 10-20-28

FD. SQUARD STAKE - PROPERLY MARKED

NO BT's. FOUND

PUT FSLP ON SPRUCE 6" NEXT TO CORNER

IN CEDAR-SPRUCE+TAM. SWAMP


ABOUT 10 CHS. SOUTH TO HIGHLAND

Quarter Corner Sect's. 3-4
Notes of the orig. Gov't. Survey.

Post

Cedar 6" S23°W 90 Iks.

Poplar 8" N13°E 9 Iks

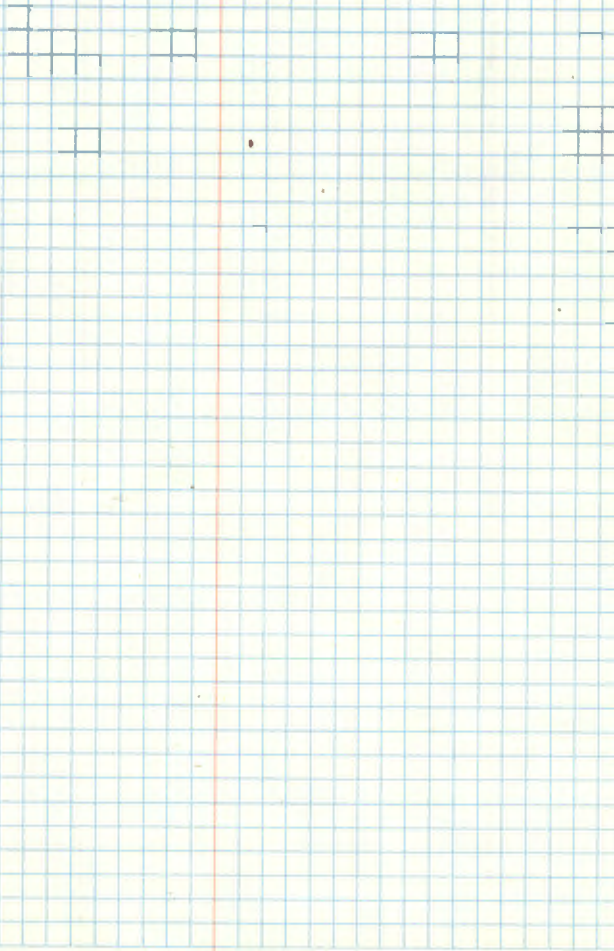


Quarter Corner sections 4-5

Notes of orig. gov't. survey

Post

Jack pine $10^{\circ} 51' 0'' W$ 63 lks.

Elm $6'' N 12^{\circ} E$ 5 lks.

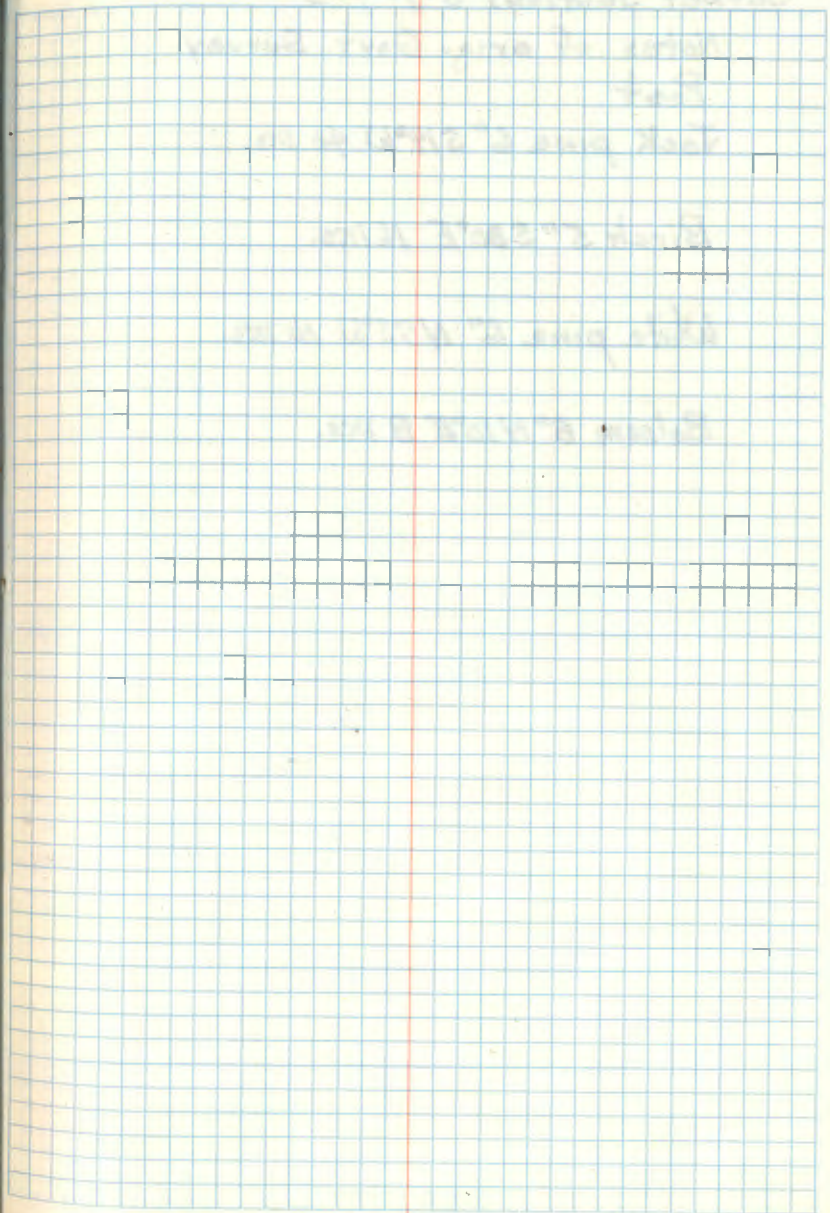

Corner Sections 8-9-4-5
Notes of orig. Govt. Survey
Post


Jack pine 6" S19°W 40 kcs.

Birch 5" S80°E 16 kcs.

White pine 6" N73°W 10 kcs.

Balsam 8" N10°E 8 kcs.

Quarter Corner sections 5-6
Notes of orig. Govt. survey 1874
Post

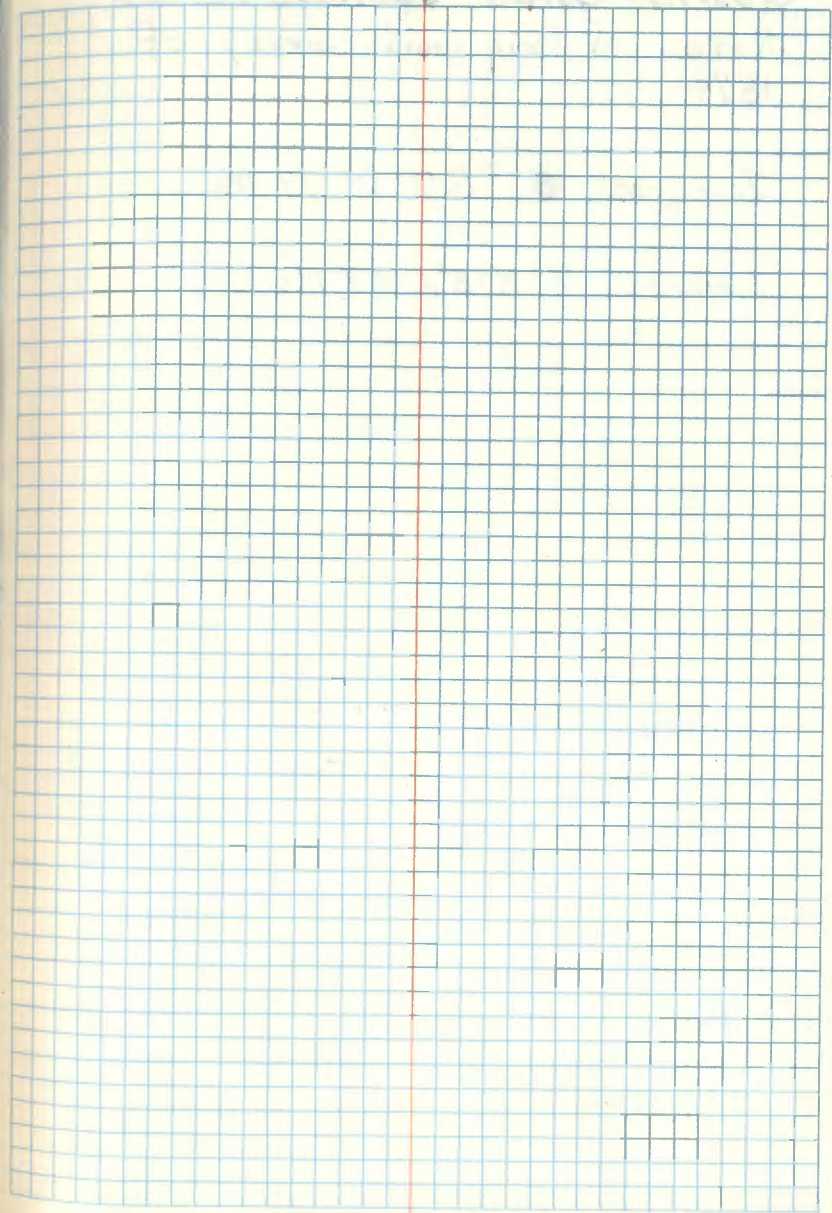

Quarter Corner Sections 25-26
Notes of orig. Govt. survey of
1874

Tamarack 8" S 7° W 19 1/2 k.


Tamarack 7" N 18° E 33 1/2 k.

Section Corner of 23-24-25-26
Notes of orig. Govt. Survey of 1877

Cedar 6" S19°W 36 lks.

Cedar 4" N11°W 27 lks.

No other trees

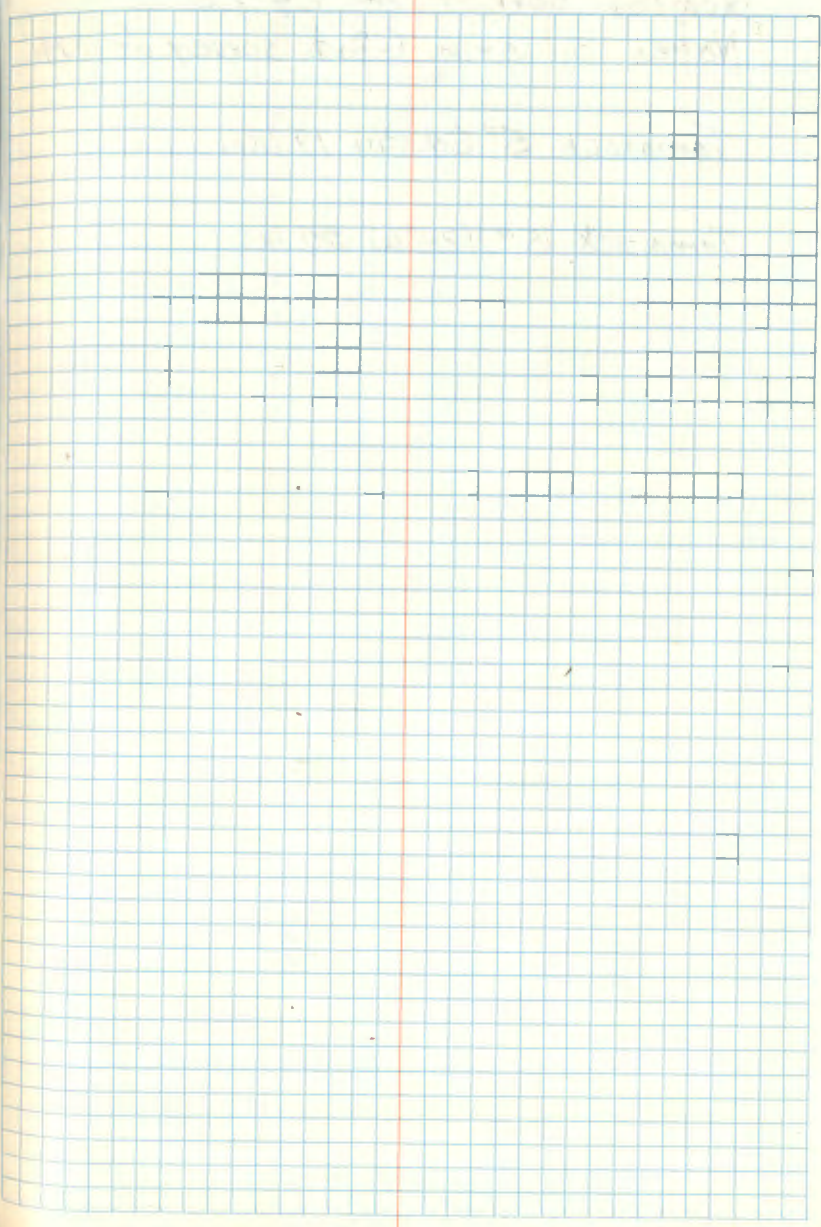

Quarter corner of 24-25
Notes of orig. Gov't. survey of 1874

Tamarack 5" S43°W 19 1/2 ks.

Tamarack 5" N28°W 27 1/2 ks.

Quarter Corner of 23-24
Notes of orig. Govt. Survey of 1874

Pine 6" S71½°E 821ks

Pine 5" N3°W 221ks.


Quarter Corner Sec's 13-24

Notes of orig. Govt. survey of 1874

N. Pine 6" S70°E 191ks.

N. Pine 12" N70°W 311ks.

NS+P1815 310753 ST 12115

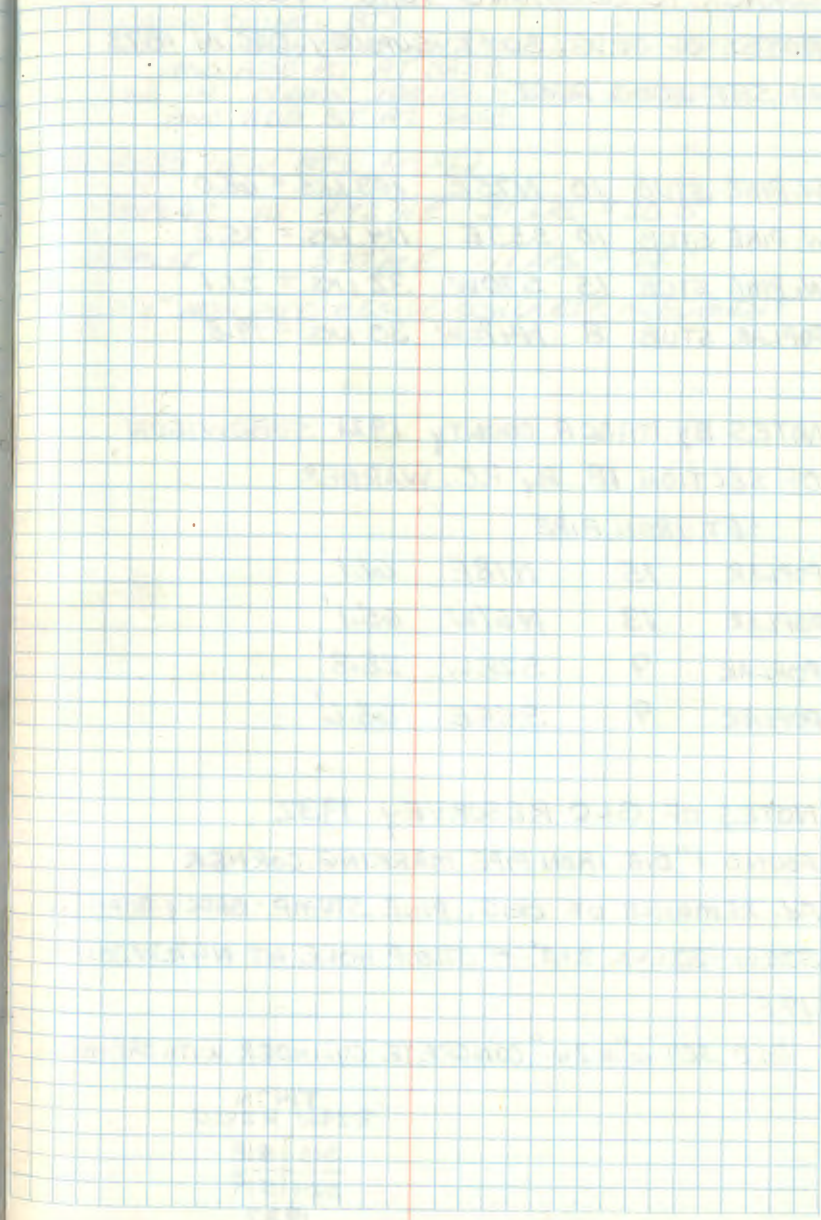

CORNER TO SECTIONS 13, 18, 19 & 24

NOTES OF ORIG. GOV'T. SURVEY DEC. 14 1873

SET WOOD POST

W. PINE STUB 10 N75E 103 LKS. = 68.0'
 W. PINE STUB 10 S53E 114 LKS. = 75.2'
 W. PINE STUB 15 S70W 32 LKS. = 21.1'
 POPLAR STUB 8 N4½W 30 LKS. = 19.8'

NOTES BY ITASCA COUNTY 1921 SUBDIVISION
 OF SECTION 18 BY P.C. WARNER

SET IRON PIPE

POPLAR 15 N18E 61.1'
 POPLAR 13 N67W 65.1'
 POPLAR 9 S28W 28.8'
 POPLAR 9 S55E 68.6'

NOTES OF GLO RESURVEY 1932

FOUND 1" DIA. IRON PIPE MARKING CORNER

Fd. REMAINS OF ORIG. PINE STUMP - BADLY BURNED
 S75W - 32 LKS. 21.1' - STUMP HOLE AT N4½W 30 LKS.
 19.8'

GLO SET 6" X 24" CONCRETE CYLINDER WITH CAP MKD.

| | |
|-------|------|
| T147N | |
| R29W | R28W |
| S13 | S18 |
| S24 | S19 |
| 1932 | |

GLO FOUND COUNTY BT'S.

POPLAR 12 S34¾W 44 LKS. = 29.0' Fd. SCRIBE INSIDE
 AND ADD BT AT BASE
 POPLAR 14 N60W 100 LKS. = 66.0' Fd. SCRIBE INSIDE
 AND ADD BT AT BASE

MARKED NEW BT'S. (1932)

POPLAR 16 N72¼E 31 LKS. = 20.5'

POPLAR 5 S37¼E 111 LKS. = 73.3'

SET 1" IRON PIPE BESIDE CONCRETE MONUMENT

QUARTER CORNER BET. SEC'S. 17+18

NOTES OF ORIG. GOV'T. SURVEY 1874

NO ORIG. CORNER WAS SET

NOTES BY ITASCA COUNTY 1921

SET IRON MONUMENT

PROPORTIONAL DISTANCE

NO TREES NEAR

3/29/91 GB-CK

Fd. IRON IN BOG - FROZEN IN ICE & MUD

BUT WE GOT STRONG DRAW WITH LOCATOR

CHAINED S84E 1327' FROM C¹/₄ SEC. 18

Fd. CE¹/₁₆ COR. - THEN CONTINUE AT S84E 1327'

LINE FELL 15' NORTH OF IRON AT ¹/₄ COR.

DISTANCE CHECKED GOOD

3/19/91 GB-CK

CHAINED N1E FROM IRON FOUND AT S¹/₁₆ BET. 17+18

1327' - SNOW COVERED NO IRON LOCATED

PLACE SPIKE & RIBBON AT DISTANCE IN BOG

NO IRON COULD BE FOUND AT MC. 75.6'

NORTH OF ¹/₄

3/29/91

CHAINING FROM SOUTH FIT WITHIN 1.0' AND LINE

FELL 8' EAST OF IRON FOUND TODAY

TIED RIBBON ON BRUSH CLUMP 30'S OF IRON

NOTHING IN OPEN BOG TO PLACE TAG ON
CORNER IS 70' SOUTH OF THIRD RIVER - IN
OPEN BOG MARSH

RAN LINE N1E - 2653 TO SEC. COR. TO NORTH
NO IRON COULD BE LOCATED AT NE COR.
CHAINED ACROSS THIRD RIVER TODAY - COULD
OPEN VERY SOON - SOME AREAS ARE WIDE OPEN

5-5-2005 ITASCA COUNTY. REFER TO CERT

SET ¹/₂" X 4' REBAR WITH 2¹/₂" CAP. NO
TREES NEAR.

LAT 47° 32' 54.461"
LONG 94° 15' 53.069"

CORNER TO SECTIONS 11, 12, 13 + 14

NOTES OF ORIG. GOV'T. SURVEY 1874

SET WOOD POST

TAM. 8 N20E 10 LKS. = 6.60'

TAM. 6 N26W 15 LKS. = 9.90'

TAM. 3 S24E 27 LKS. = 17.82'

TAM. 4 S31W 80 LKS. = 52.80'

874 CCC NOTES By W. BANKS 9-18-34

Fd. SQUARD STAKE - FAIR CONDITION - 2 1/2' HIGH

NO BT's. RECORDED

FSLP ON DEAD BLK. SPRUCE 7" CORNER BEARS

SOUTH 8.0'

CORNER LOCATED IN BLK. SPRUCE STAND

NOTES IN OLD CCC FIELD BOOK #124

SECTION 12

FOUND DEAD TAM. 3 N82E 5 LKS.

DEAD TAM. 3 S66W 3 LKS.

QUARTER CORNER BET. SEC'S. 12+13

NOTES OF ORIG. GOV'T. SURVEY 1874

SET WOOD POST

J. PINE 8 S9W 50 LKS. = 33.0'

N. PINE 8 N40E 37 LKS. = 24.42'

874 CCC NOTES BY W. BANKS 9-18-34

FOUND 2 SIDED STAKE - GOOD CONDITION

3.5" DIA. X 2 1/2' HIGH

BLK. SPRUCE 4 1/2" N42E 6.0'

FSLP ON 6" BLK SPRUCE - CORNER BRS. N13E - 8.0'

CORNER IS IN BLK. SPRUCE SWAMP

CORNER STAKE IS A BLK. SPRUCE STUMP LEANING

EAST AT 45° ANGLE

ORIG. LINE BET SEC'S. 12+13 80.12 CHS. = 5287.92'

CORNER TO SECTIONS 7, 12, 13 & 18

NOTES OF ORIG. GOV'T. SURVEY 1874

SET WOOD POST

N. PINE 18 S55E 250 LKS. = 165.00'

N. PINE 16 S48E 268 LKS. = 176.88'

CEDAR 10 NORTH 216 LKS. = 142.56'

NO OTHER

874 CCC NOTES BY W. BANKS 9-17-34

FOUND SQUARD STAKE - FAIR CONDITION

2 1/2' HIGH

B. SPRUCE 5" N37E 7.0'

B. SPRUCE 6" S70W 6.0'


CORNER LOCATED IN BLK. SPRUCE SWAMP

THE TWO BLK. SPRUCE CONSIDERED AS WITNESS
TREES WERE NEVER SCRIBED, BUT WERE BLAZED
FACING THE CORNER AND IN SUCH A MANNER
AS TO INDICATE THAT THEY WERE INTENDED
AS WITNESS TREES.

CORNER TO SECTIONS 25-26-35+36 + M.C.
 ORIG. GOV'T. SURVEY 1874
 SET WOOD POST

OAK 6 N10W 208 LKS = 137.28'


NO OTHER TREES

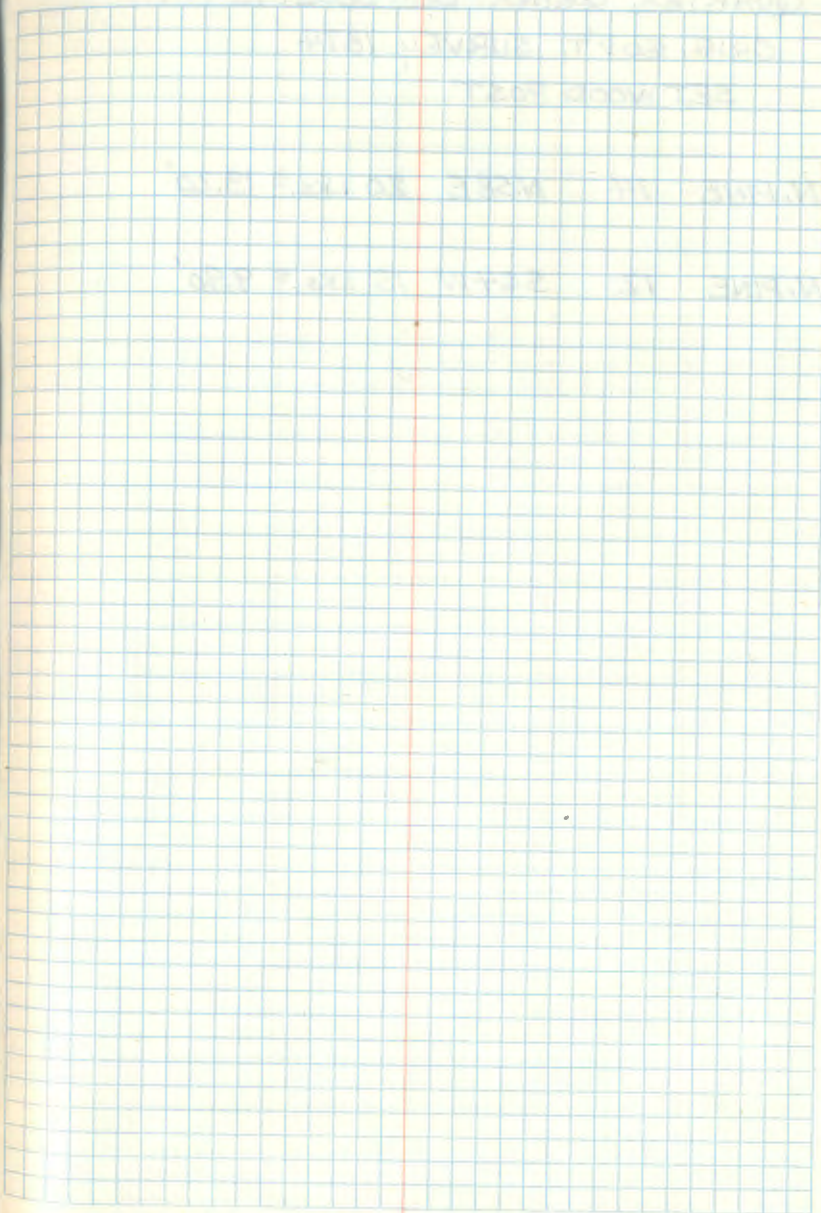

QUARTER CORNER BET. SEC'S. 13 + 14
 ORIG. GOV'T. SURVEY 1874
 SET WOOD POST

N. PINE 14 N58E 20 Lks. = 13.20'

N. PINE 12 S64W 15 Lks. = 9.90'

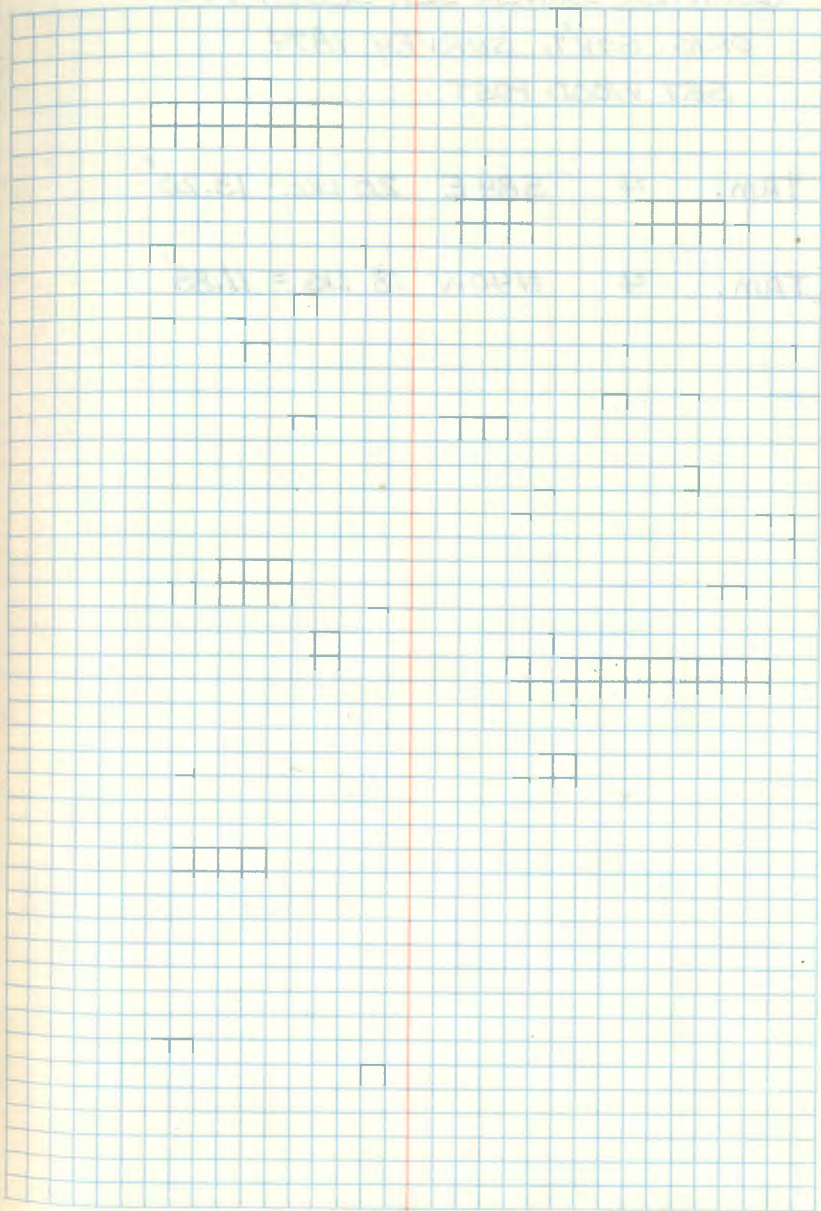

QUARTER CORNER BET. SEC'S. 1 & 2

ORIG. GOV'T. SURVEY 1874

SET WOOD POST

TAM. 4 S84E 20 LKS. = 13.20'

TAM. 4 N40W 18 LKS. = 11.88'

CORNER TO SECTIONS 22-23-26+27

ORIG. GOV'T. SURVEY 1874


SET WOOD POST

CEDAR 8 N71W 16 Lks. = 10.56'

CEDAR 5 N60E 9 Lks. = 5.94'

TAM. 6 S9E 38 Lks. = 25.08'

TAM. 6 S21W 19 Lks. = 12.54'

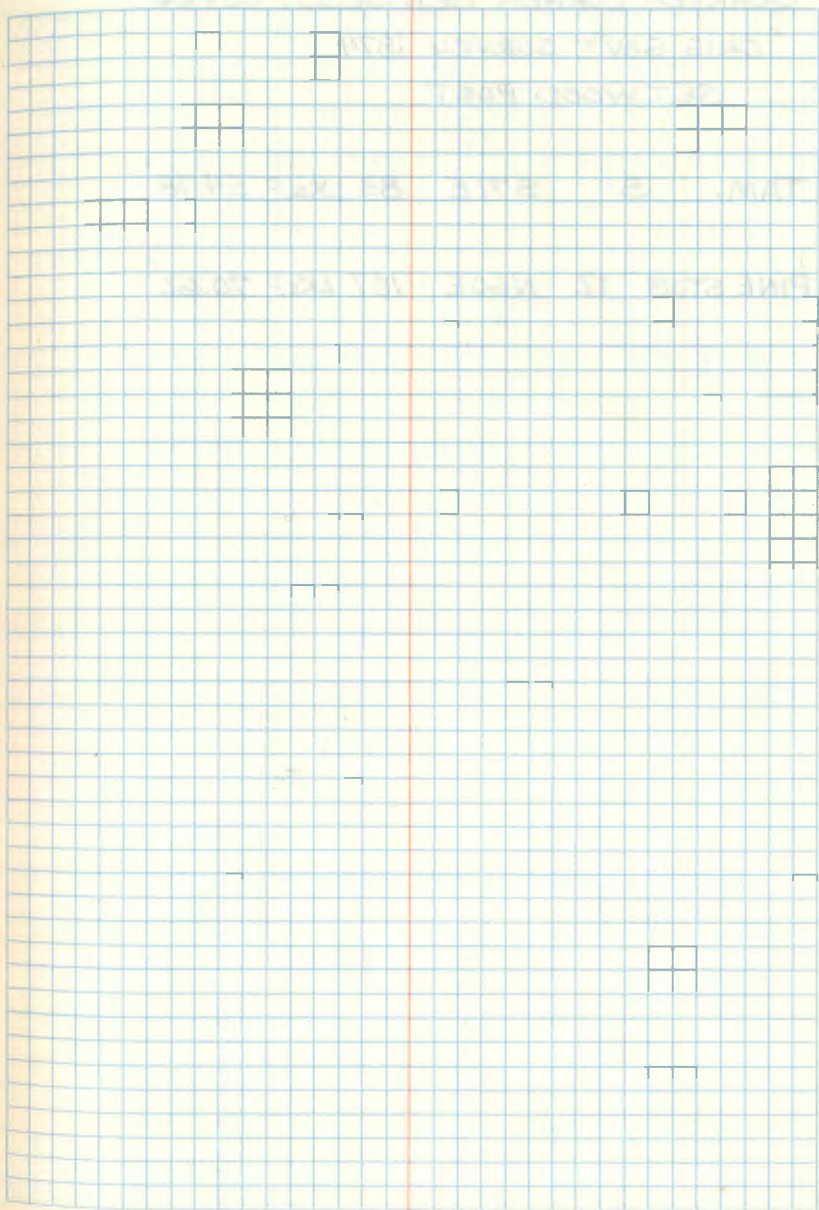

QUARTER CORNER BET. SEC'S. 23+26

ORIG GOV'T SURVEY 1874


SET WOOD POST

TAM. 5 S71E 83 LKS. F 54.78'

PINE STOB 12 N60E 107 LKS. F 70.62'

TAM. 6 S71E 83 LKS. F 54.78'


TAM. 7 S71E 83 LKS. F 54.78'

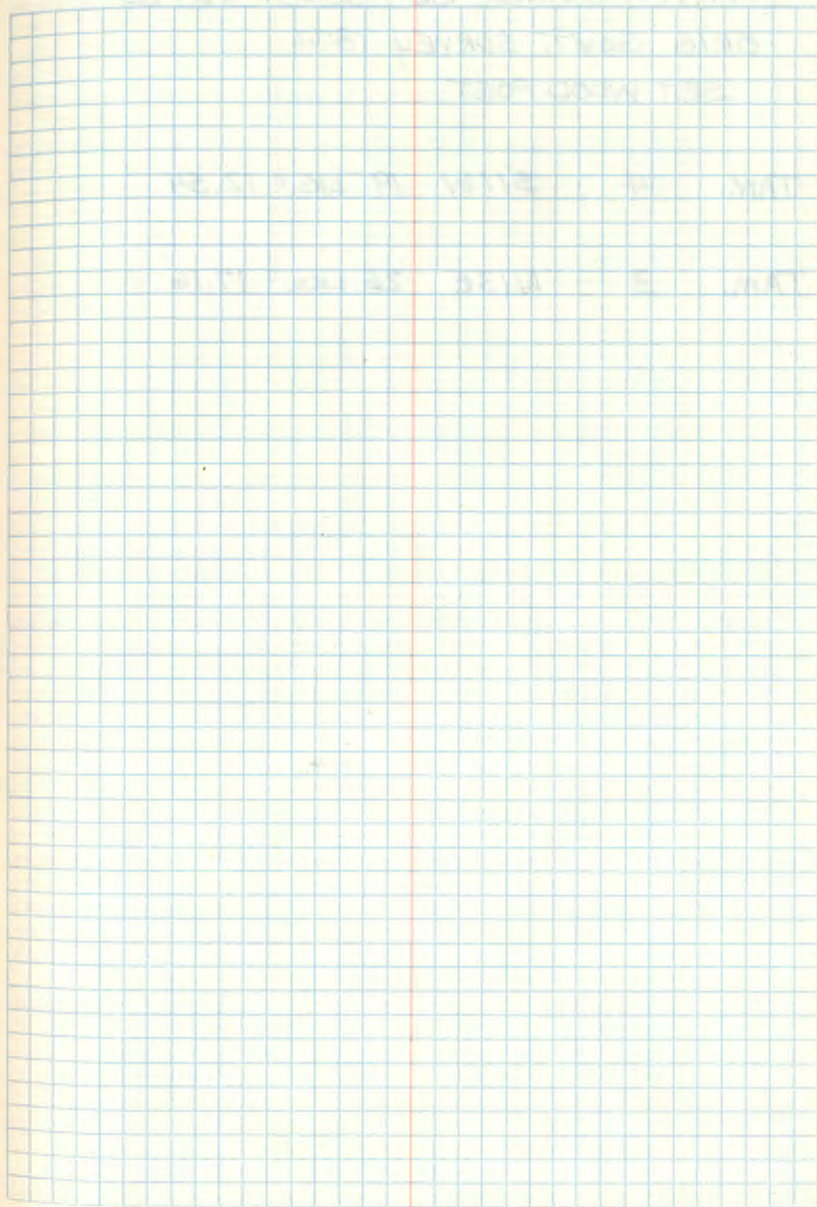

QUARTER CORNER BET. SEC'S. 22+23
 ORIG. GOV'T. SURVEY 1874
 SET WOOD POST

TAM. 4 S11W 19 LKS. = 12.54'

TAM. 3 N13E 26 LKS. = 17.16'

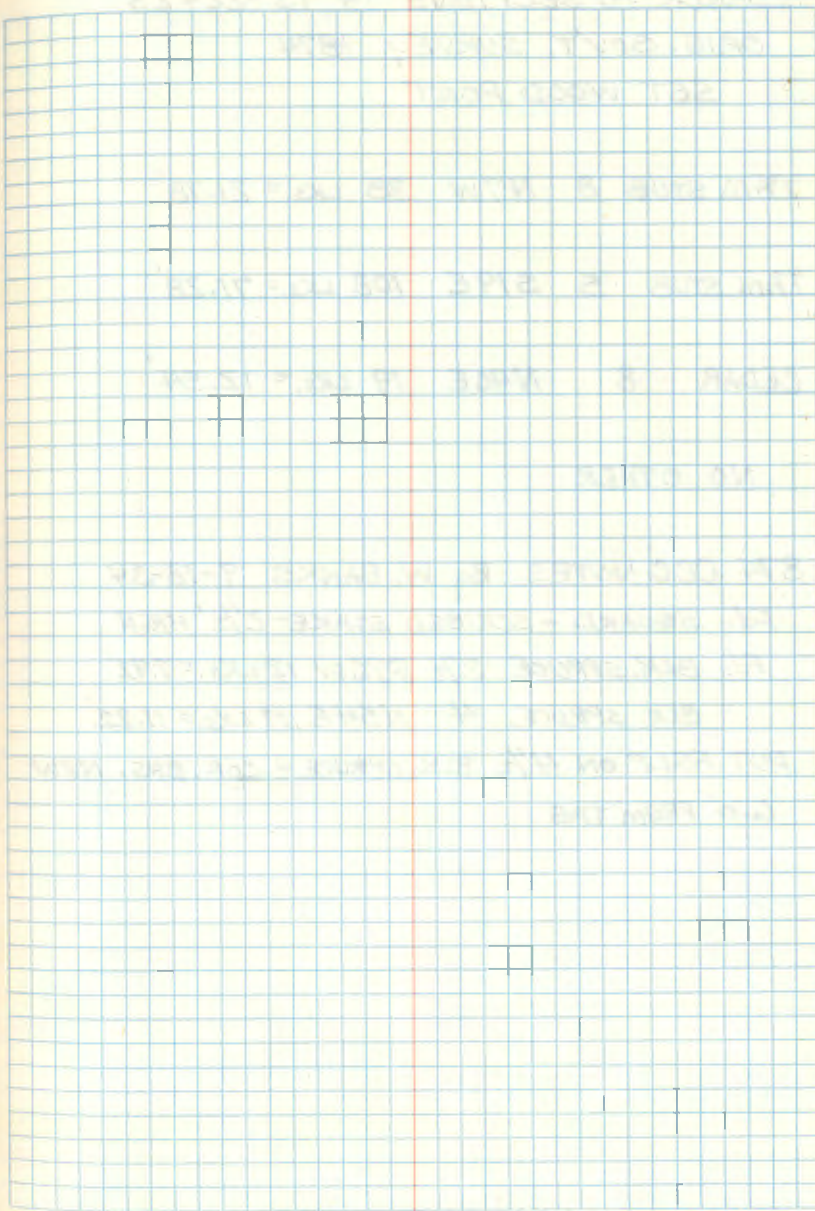

CORNER TO SECTIONS 14-15-22+23

ORIG. GOV'T. SURVEY 1874

SET WOOD POST

TAM STUB 8 N7W 33 Lks. = 21.78'

TAM STUB 5 S19E 108 Lks. = 71.28'

CEDAR 8 N40E 19 Lks. = 12.54'

NO OTHER

874 CCC NOTES By W. BANKS 9-18-34

Fd. SQUARD - SCRIBED STAKE - 2 1/2' HIGH

Fd. BLK. SPRUCE 2 1/2 S76W 12 Lks. = 7.92'

BLK. SPRUCE 4 N54E 17 Lks. = 11.22'

PUT FSLP ON 4 1/2 BLK. SPRUCE - COR. BRS. N8W

6.0' FROM TAG


QUARTER CORNER BET. SEC'S. 14+23

ORIG. GOV'T. SURVEY 1874

SET WOOD POST

CEDAR 8 S45E 25 LKS. = 16.50'

ASH 5 N60E 30 LKS. = 19.80'

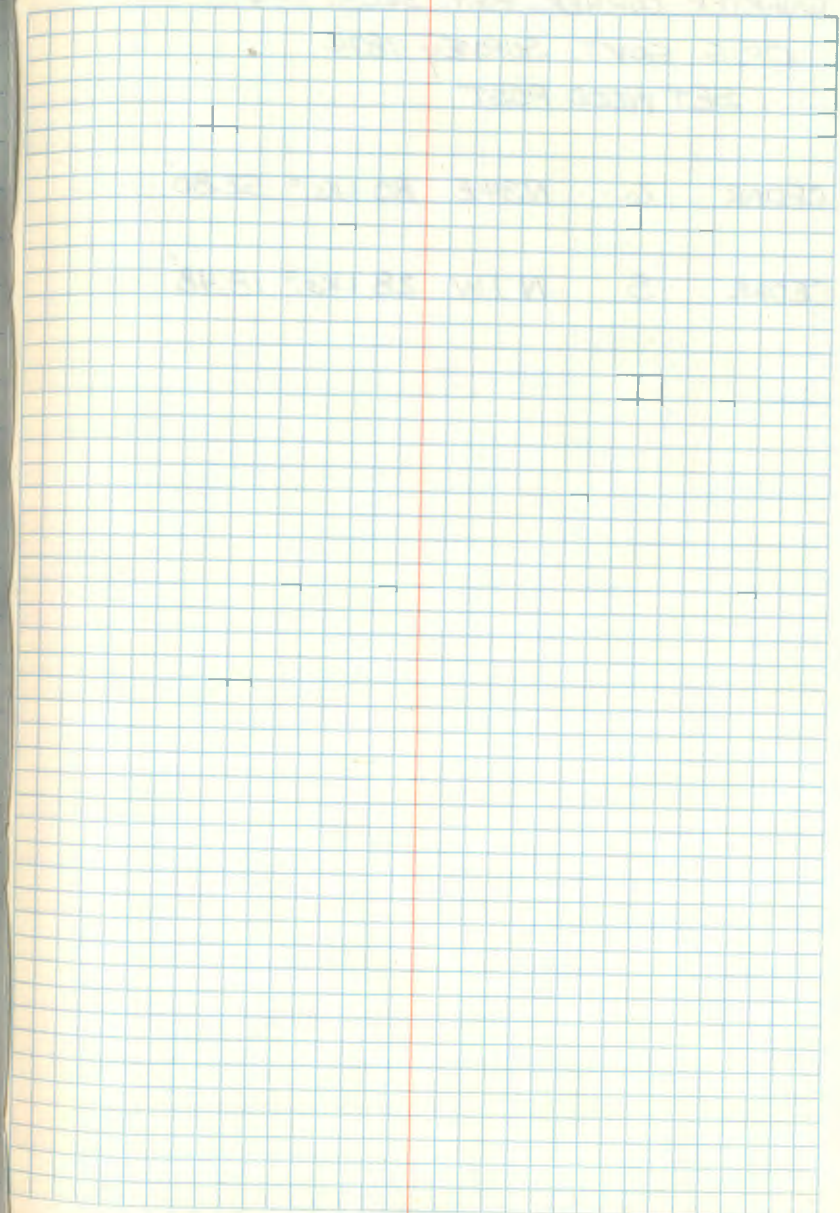

QUARTER CORNER BET. SEC'S. 14 & 15
ORIG. GOV'T. SURVEY 1874
SET WOOD POST

CEDAR 6 N34E 80 Lks. = 52.80'

CEDAR 5 N7W 28 Lks. = 18.48'

CORNER TO SECTIONS 10-11-14+15
 ORIG. GOV'T. SURVEY 1874
 SET WOOD POST

CEDAR 12 N55W 80 Lks. = 52.80'

CEDAR 18 S18E 32 Lks. = 21.12'

CEDAR 10 N15W 100 Lks. = 66.0'

CEDAR 4 S22W 90 Lks. = 59.40'

QUARTER CORNER BET. SEC'S. 11+14

ORIG. GOV'T. SURVEY 1874

SET WOOD POST

CEDAR 4 S70W 90 LKS. = 59.40'

CEDAR 8 N30E 72 LKS. = 47.52'


QUARTER CORNER BET. SEC'S. 10 & 11

ORIG. GOV'T. SURVEY 1874

SET WOOD POST

PINE STUB 12 SIBE 20 LKS. = 13.20'

CEDAR 6 N26W 40 LKS. = 26.40'

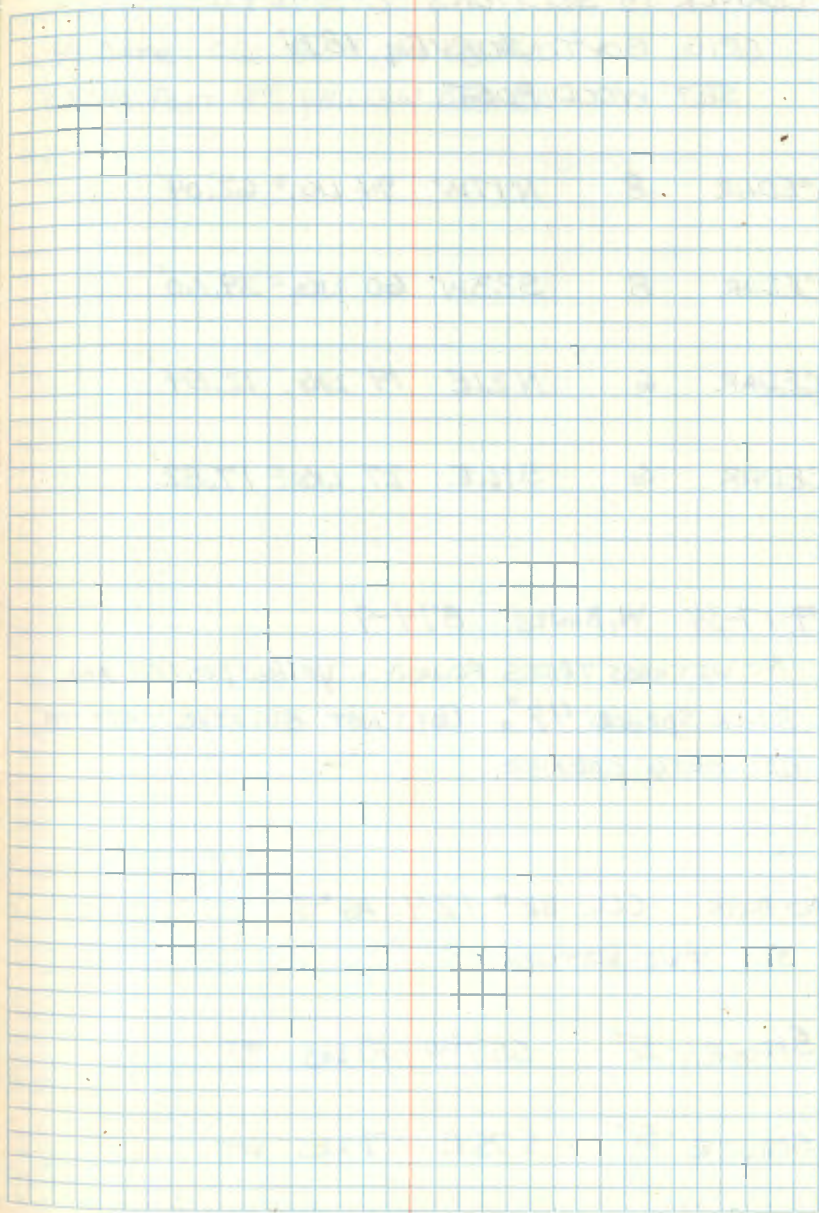

CORNER TO SECTIONS 2-3-10+11

ORIG. GOV'T. SURVEY 1874

SET WOOD POST

CEDAR 8 N17W 94 LKS. = 62.04'

CEDAR 8 S33W 60 LKS. = 39.60'

CEDAR 6 N21E 19 LKS. 12.54'

CEDAR 6 S16E 27 LKS. = 17.82'

9-17-34 W. BANKS 874-9

NO WITNESS TREES FOUND. YELLOW POSTER ON
BLACK SPRUCE 4½". DOES NOT BELIEVE THIS TO
BE ORIG CORNER.

NO DATE CLL BK # 124 PG # 3

SET TWO WITNESSES

SPRUCE 5" S57°W 10 LKS WT

SPRUCE 5' S75°E 7 LKS WT


NO DATE CLL BK # 124 PG # 10

CEDAR POST 4" YELLOW POSTER

QUARTER CORNER BET. SEC'S. 2 + 11
 ORIG. GOV'T. SURVEY 1874
 SET WOOD POST

TAM. 4 SZOW 15 LKS. 9.90'

TAM. 4 NZZE 26 LKS. = 17.16'

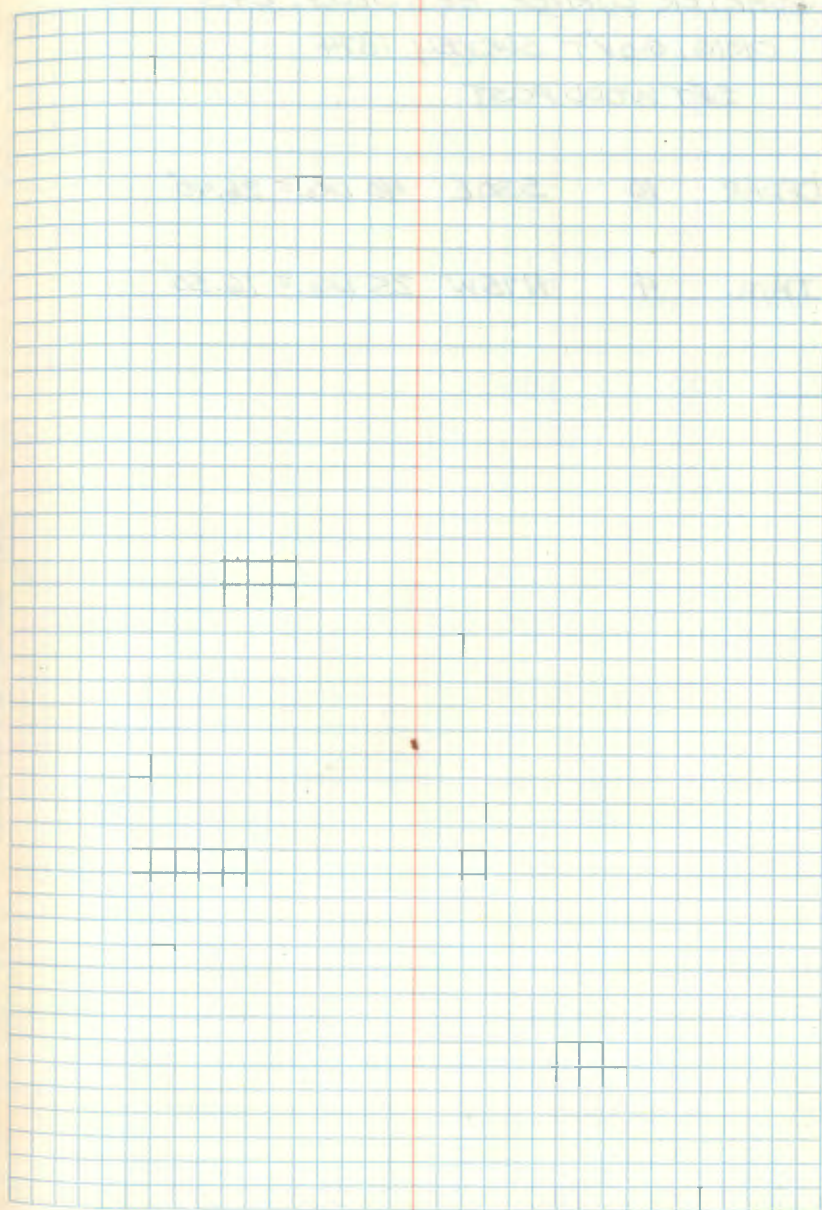


QUARTER CORNER BET. SEC'S. 2+3

ORIG. GOV'T. SURVEY 1874

SET WOOD POST

CEDAR 10 S30E 40 LKS. = 26.40'

TAM. 4 N75W 25 LKS. = 16.50'

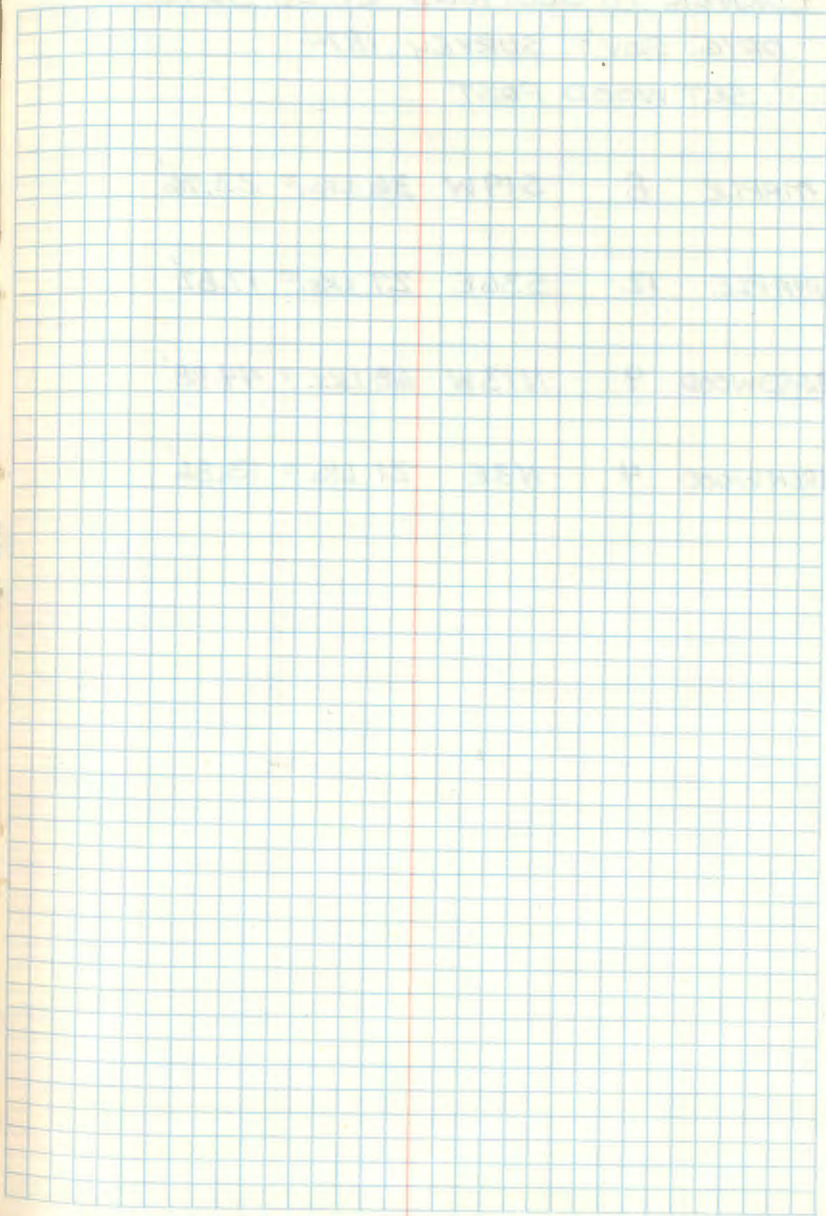


CORNER TO SECTIONS 27-28-33+34
ORIG. GOV'T. SURVEY 1874
SET WOOD POST

MAPLE 8 S19W 36 Lks. = 23.76'

MAPLE 12 S36E 27 Lks. = 17.82'

BASSWOOD 9 N13W 68 Lks. = 44.88'

IRONWOOD 4 N3E 21 Lks. = 13.86'

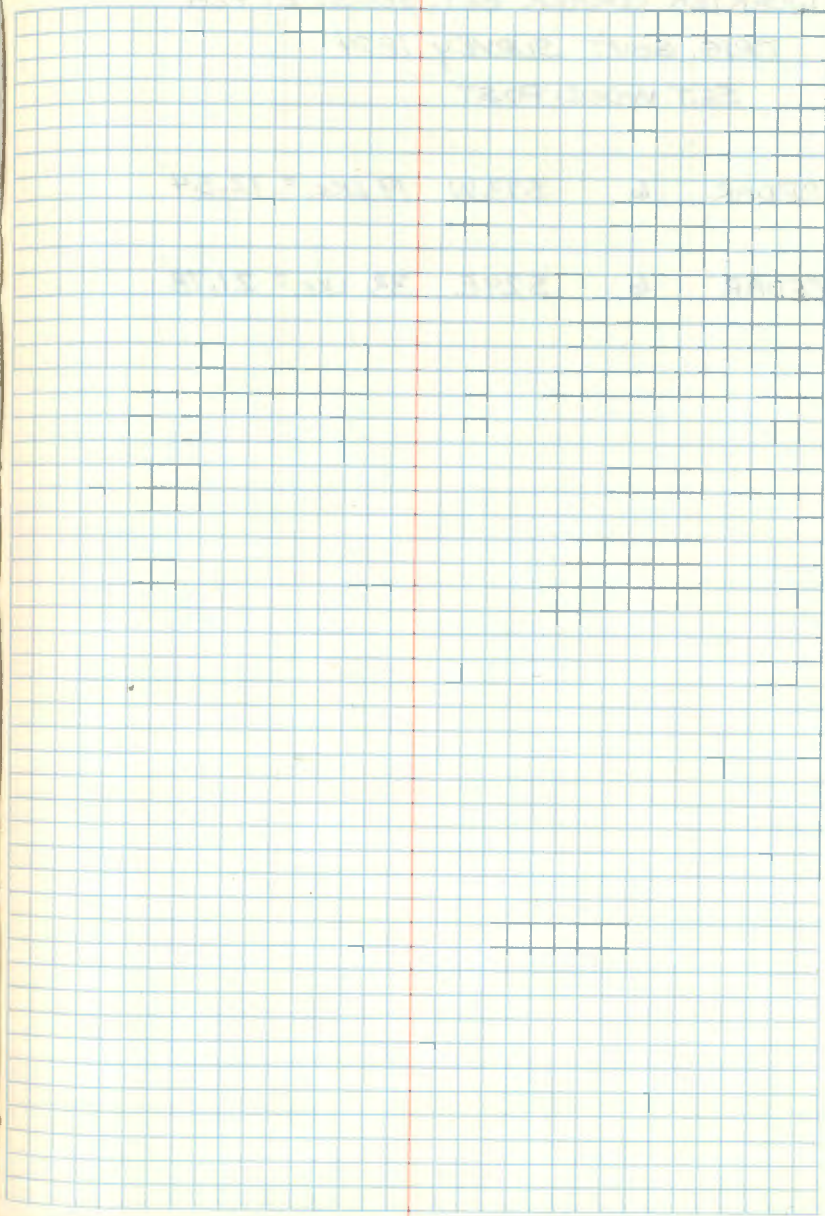


QUARTER CORNER BET. SEC'S. 27 + 28

ORIG. GOVT. SURVEY 1874

SET WOOD POST

CEDAR 6 S73W 19 LKS. = 12.54'


CEDAR 6 S29E 33 LKS. = 21.78'

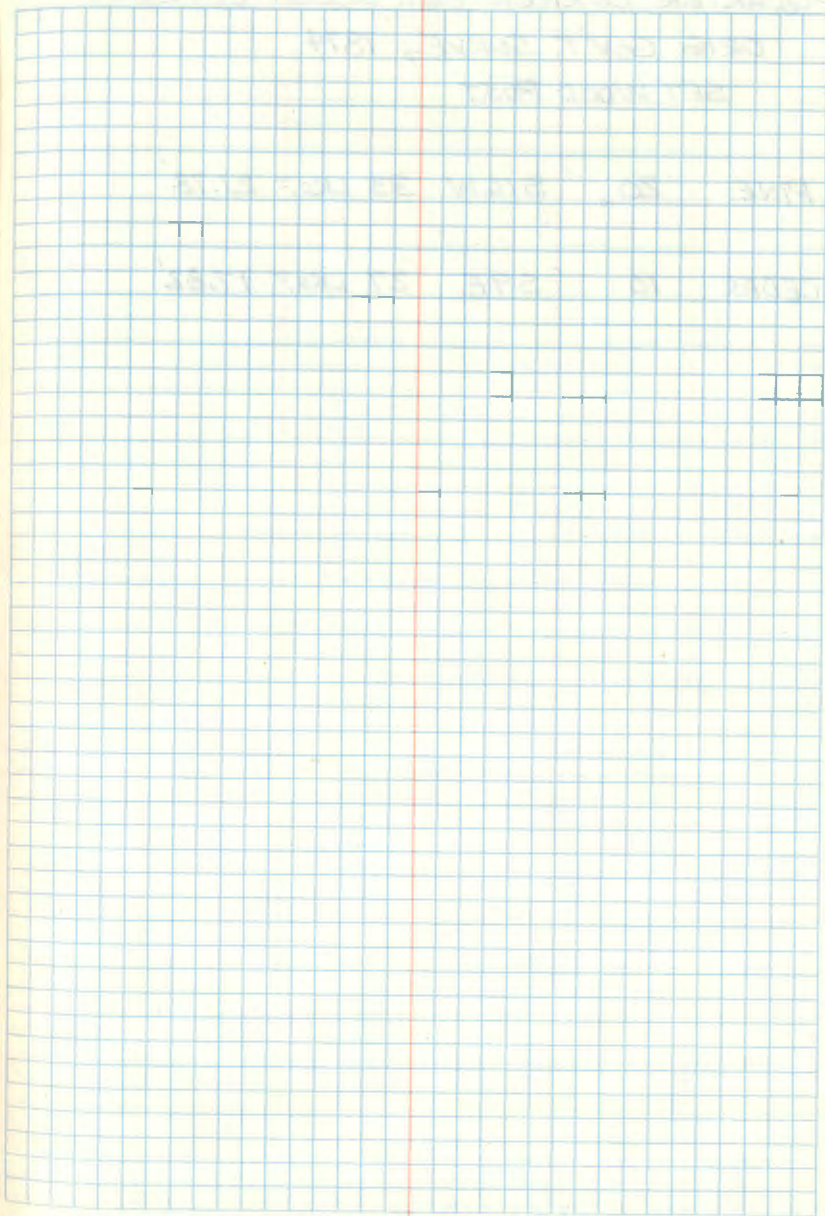

QUARTER CORNER BET. SEC'S. 22+27
ORIG. GOV'T. SURVEY 1874
SET WOOD POST

PINE 20 S16W 33 LKS. = 21.78'

CEDAR 10 S9E 27 LKS. = 17.82'

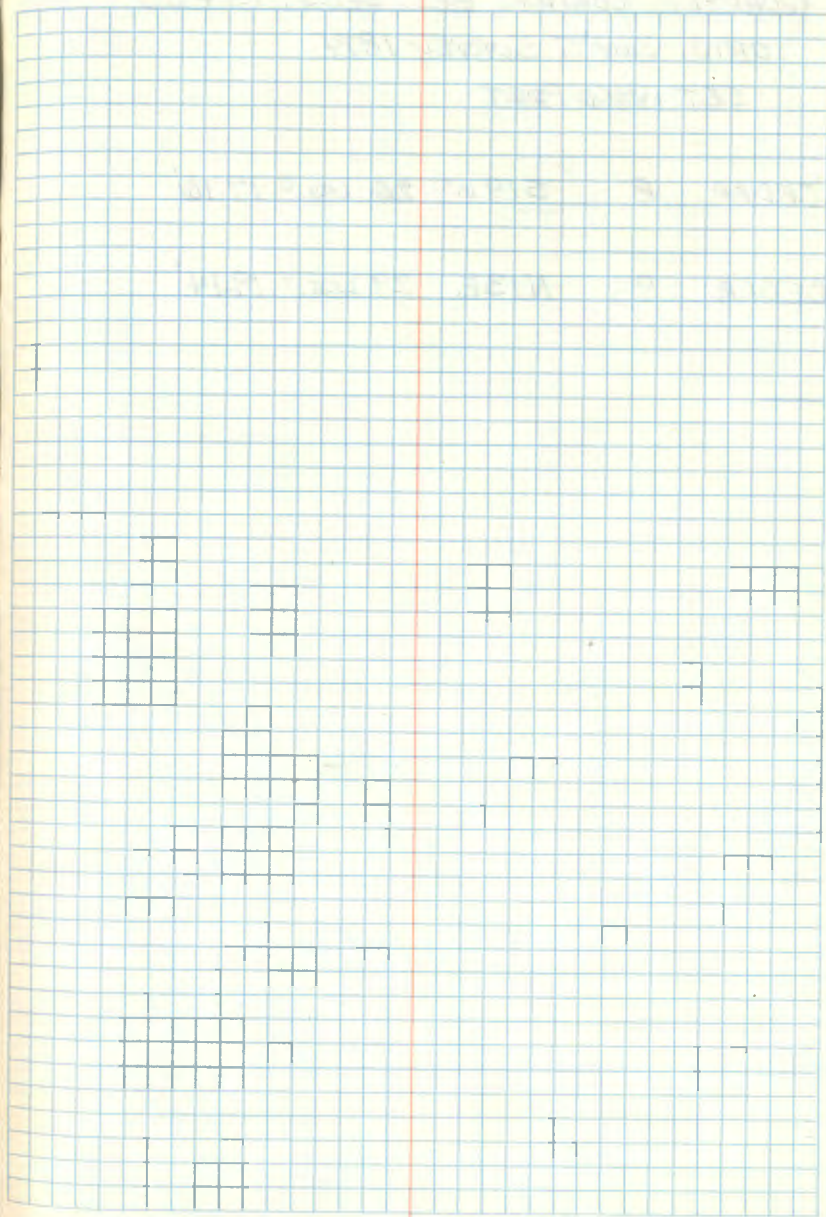

QUARTER CORNER BET. SEC'S. 15 + 22
ORIG. GOV'T. SURVEY 1874
SET WOOD POST

CEDAR 8 S19W 26 LKS. = 17.16'

CEDAR 9 N13E 29 LKS. = 19.14'


QUARTER CORNER BET. SEC'S. 10 + 15

ORIG. GOV'T. SURVEY 1874

SET WOOD POST

TAM. STUB 6 S17W 18 Lks. = 11.88'

CEDAR 8 N37~~W~~E 19 Lks. = 12.54'

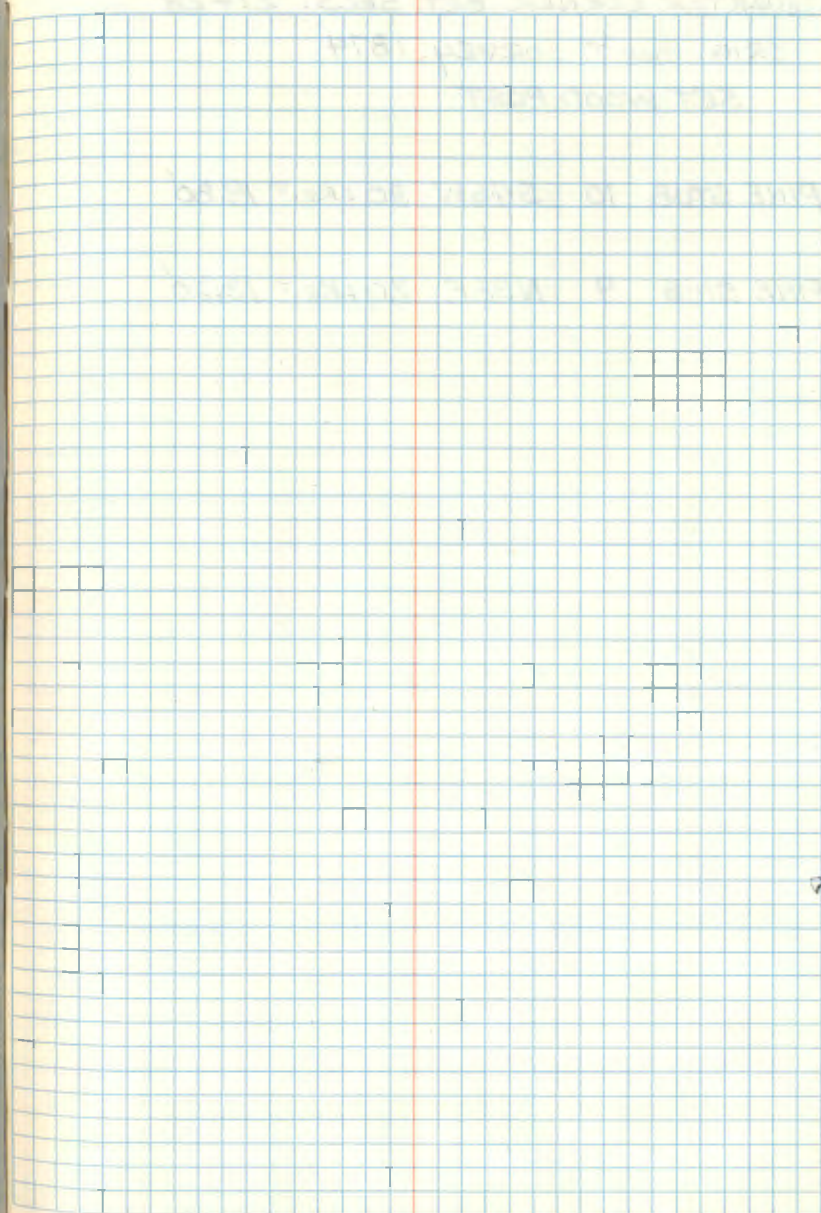

QUARTER CORNER BET. SEC'S. 21+28

ORIG. GOV'T. SURVEY 1874

SET WOOD POST


PINE STUB 10 S46W 30 LKS. = 19.80'

PINE STUB 9 N38E 20 LKS. = 13.20'

QUARTER CORNER BET. SEC'S. 20 + 21
ORIG. GOV'T. SURVEY 1874
SET WOOD POST

TAM. 4 N18W 60 LKS. = 39.60'

TAM. 4 S71E 50 LKS. = 33.00'

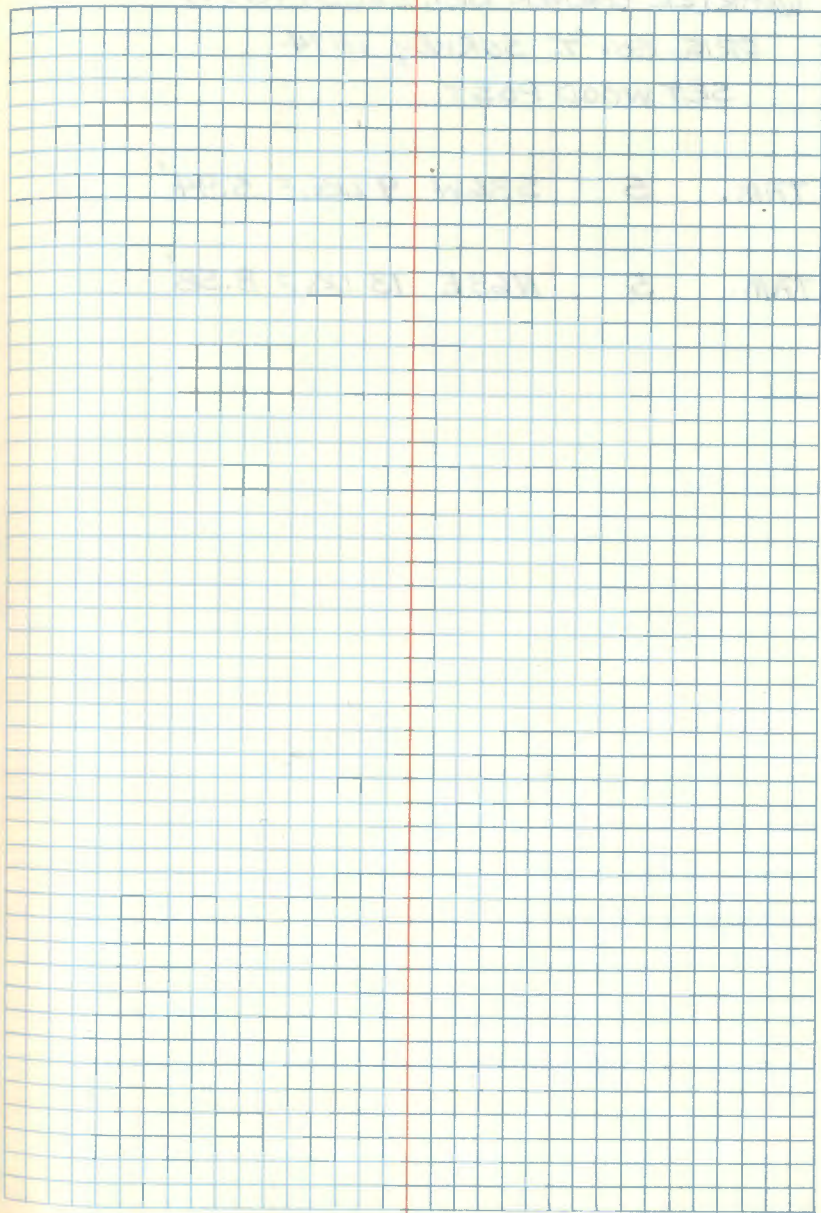

QUARTER CORNER BET. SEC'S. 16 & 17
ORIG. GOV'T. SURVEY 1874
SET WOOD POST

TAM. 5 S36W 9 Lks. = 5.94'

TAM. 5 N63E 13 Lks. = 8.58'

CORNER TO SECTIONS 8-9-16+17

ORIG. GOV'T. SURVEY 1874


SET WOOD POST

TAM. 9 S26E 16 LKS. = 10.56'

TAM. 8 S30W 42 LKS. = 27.72'

TAM. 5 N10E 13 LKS. = 8.58'


TAM. 4 N12W 10 LKS. = 6.60'

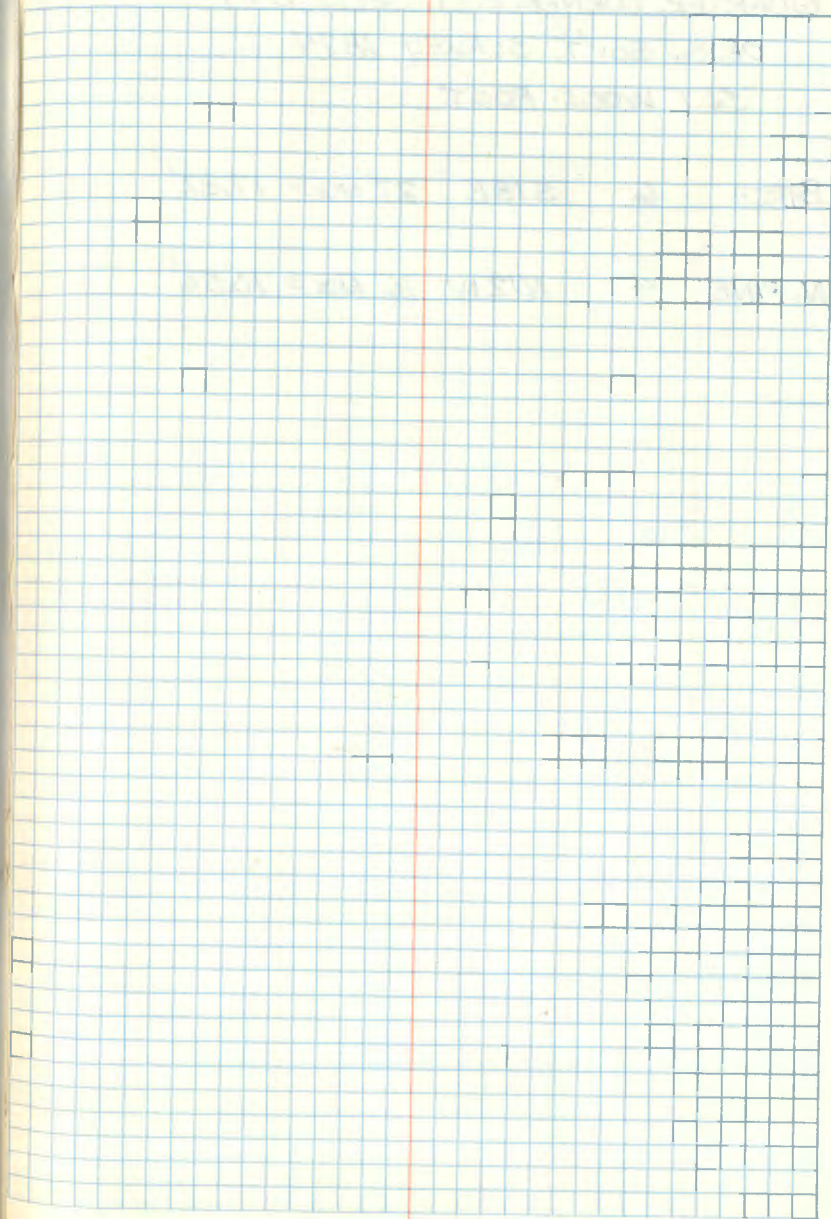

QUARTER CORNER BET. SEC'S. 8+9
 ORIG. GOV'T. SURVEY 1874
 SET WOOD POST

BIRCH 6 S18E 27 LKS. = 17.82'

N. PINE 4 N12W 16 LKS. = 10.56'

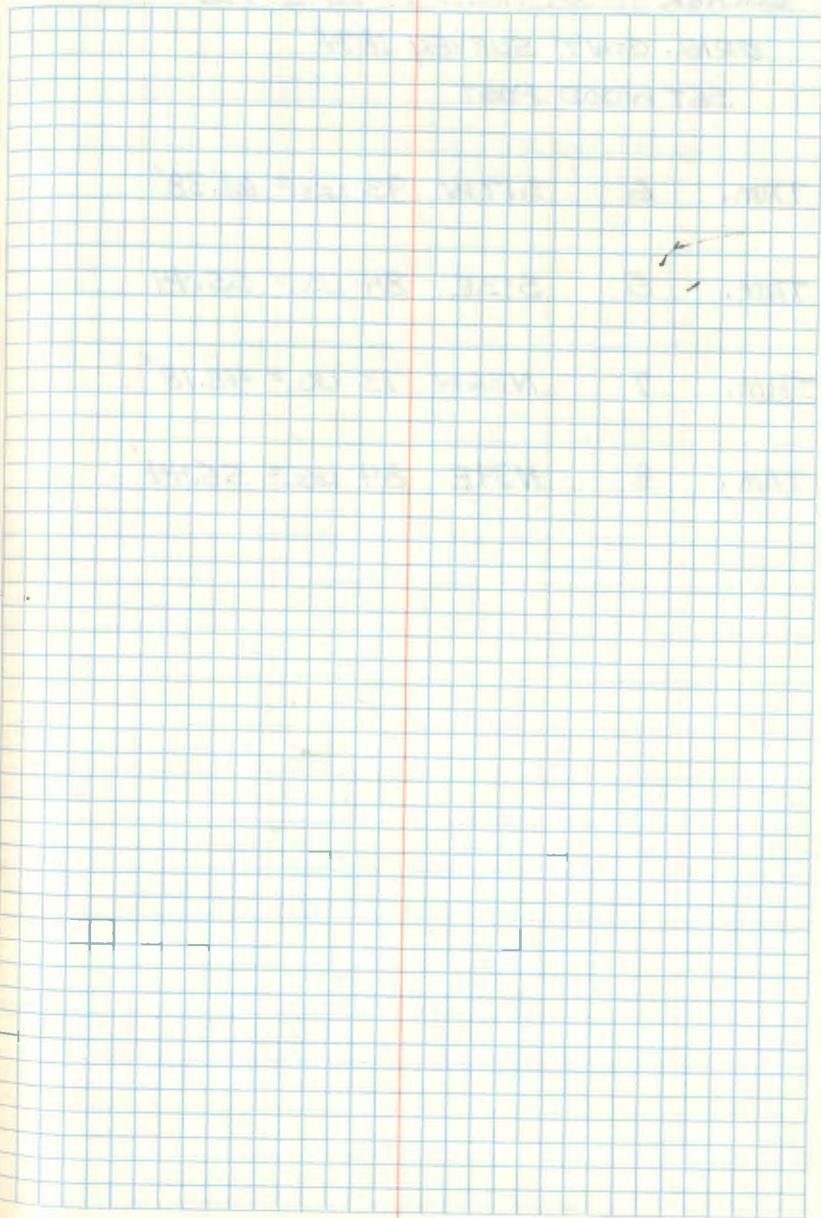

CORNER TO SECTIONS 19-20-29+30

ORIG. GOV'T. SURVEY 1874

SET WOOD POST

TAM. 6 S17W 93 Lks. = 61.38'

TAM. 5 S13E 84 Lks. = 55.44'

TAM. 7 N26W 73 Lks. = 48.18'

TAM. 8 N39E 84 Lks. = 55.44'

QUARTER CORNER BET. SEC'S. 17 & 20

ORIG. GOV'T. SURVEY 1874

SET WOOD POST


PINE 24 N73W 29 LKS. = 19.14'

PINE 26 S10W 106 LKS. = 69.96'

QUARTER CORNER BET. SEC'S, 8+17
 ORIG. GOV'T. SURVEY 1874
 SET WOOD POST

TAM. 5 S19W 34 Lks. = 22.44'

CEDAR 6 N13E 20 Lks. = 13.20'

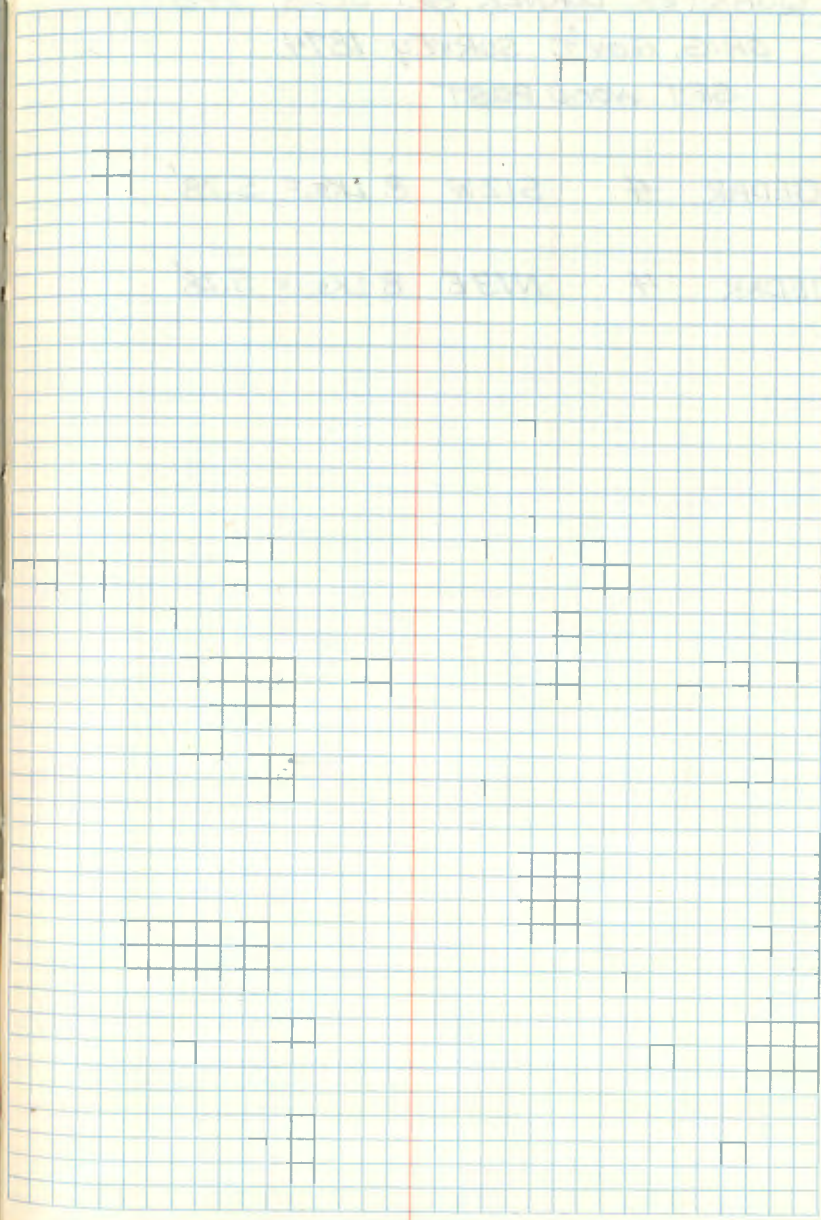

66

QUARTER CORNER BET. SEC'S. 7 & 8


ORIG. GOV'T. SURVEY 1874

SET WOOD POST

CEDAR 4 S12W 8 Lks. = 5.28'

CEDAR 4 N13E 8 Lks. = 5.28'

66

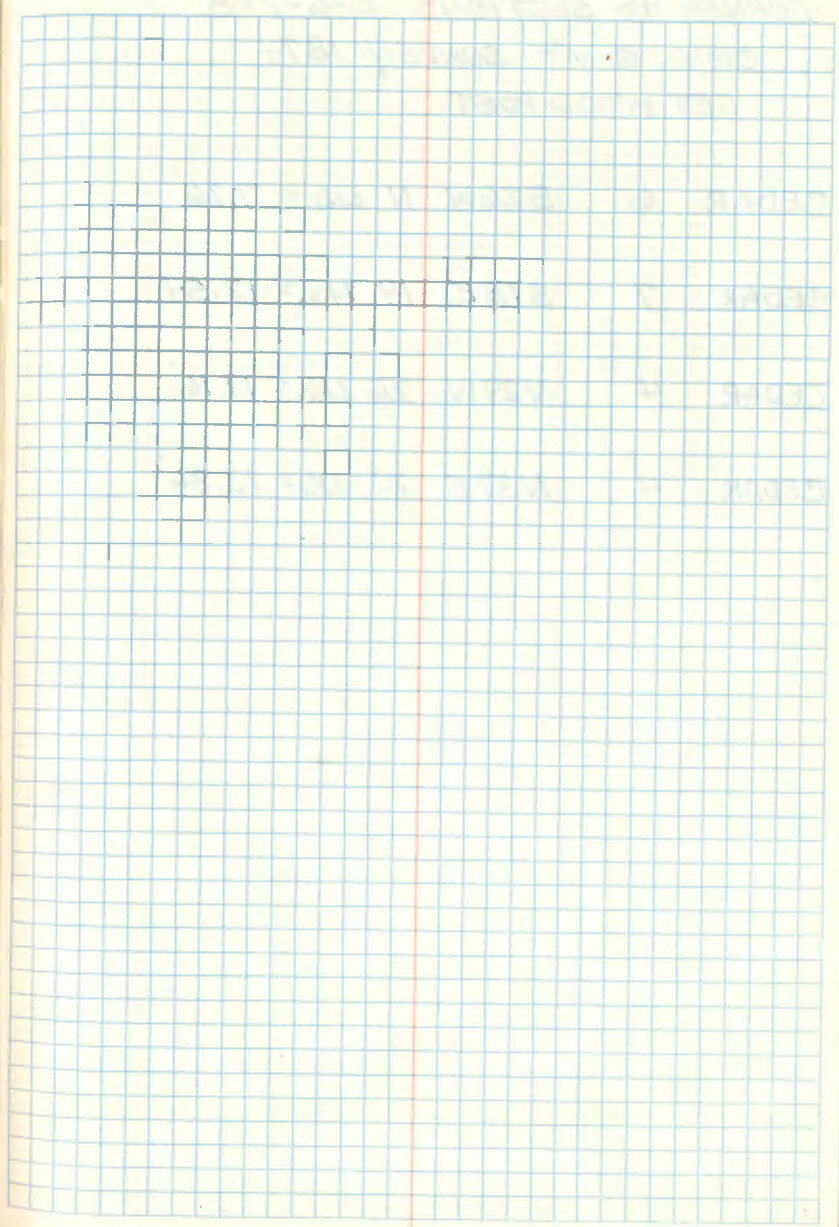


CORNER TO SECTIONS 5-6-7+8
ORIG. GOV'T. SURVEY 1874
SET WOOD POST

CEDAR 6 S26W 11 LKS. = 7.26'

CEDAR 7 S13E 19 LKS. = 12.54'

CEDAR 4 N29W 26 LKS. = 17.16'

CEDAR 4 N37E 21 LKS. = 13.86'

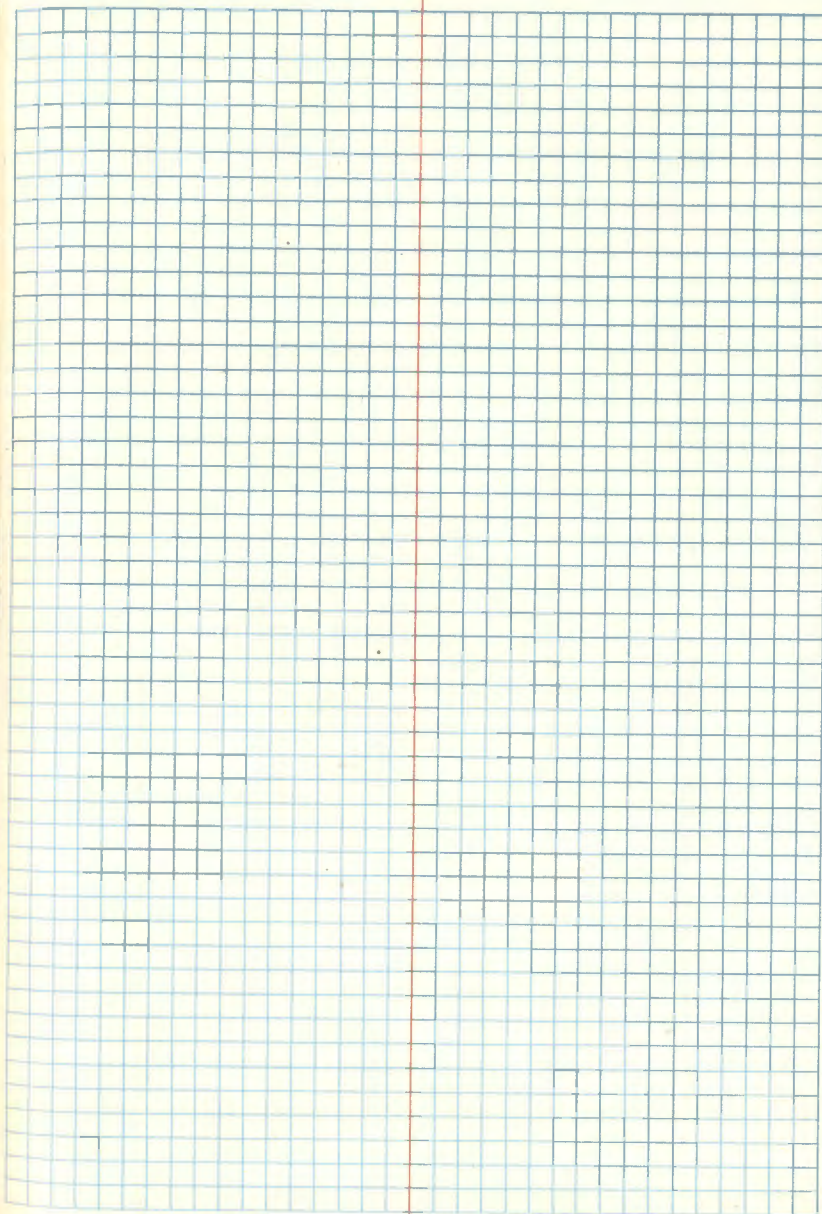

REMAINDER OF
BOOK IS EMPTY