

T149 N R26 W Corner Book 3

T149 N R26 W

CORNER

RESTORATION


BOOK #3

FIELD BOOK

82-0012



Book # 3  
 T-149 R-25

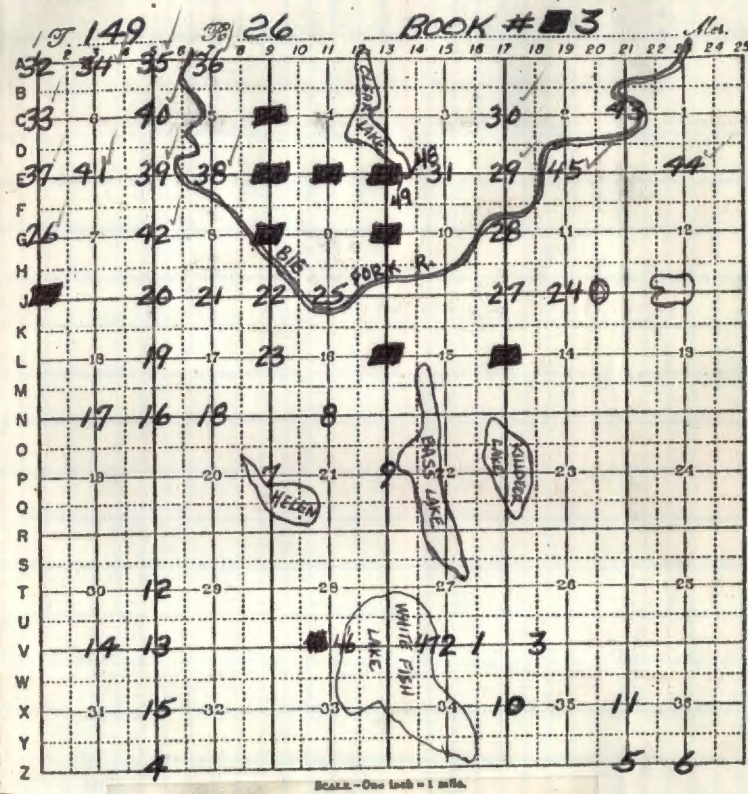

EAST 1/4 BETWEEN SECTIONS 27+34

NOTES BY ITASCA COUNTY 1918 - L.W. JOHNSON

SET IRON MONUMENT 1" I.P. FLUSH

WITH GROUND AT FENCE CORNER

PINE STP. 36 S82E 83.9'

ARE LYING HERE

THIS STUMP HAS BEEN PUSHED OUT OF PLACE AND PIECES

PINE STP. 30 S44E 61.1'

FD. PINE STP. BURNED & ROTTED S38E 61.0' SCRIBED BT

1-7-85 OK-JA-60

CHAINED WEST FROM SEC. COR. (SE OF S27) ALONG FENCE

LINE TO E 1/4 DISTANCE 1309 (OK) FD. 1" I.P. WITH

MUSHROOMED TOP FLUSH WITH GROUND - ROCK ON BOTH

SIDES AT FENCE COR. POST WITH WIRE FENCE N & W

ROAD IS 15' E OF FENCE COR. BRG N & SW

CONT. IN TO 1/4 COR.



QUARTER CORNER BETWEEN SEC'S. 27 & 34  
 NOTES BY ITASCA COUNTY 1918 - L.W. JOHNSON  
 SET IRON MONUMENT

ASH 8 S20W 22.2'

CEDAR STP. — S38E 38.0'

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST

CORNER FALLS IN CREEK 1918 - FROM ELM BT.

CEDAR 6 S50E 9 LKS.

ELM 12 N25E 14 LKS.

1918 ITASCA COUNTY FOUND THIS BT

ORIG. NOTES

WEST TRUE

37.50 CHS. ENT SWP.

39.80 " CREEK 10 LKS.

40.00 " 1/4 POST

40.30 " CREEK 10 LKS.

40.50 " ENT. MARSH NE-SW

1-785 CK-JA-6B

CHAINED WEST FROM SEC. COR. (SE-27) ALONG FENCE LINE  
 TO 1/4 COR. LOCATION - FOR AN I.P. IN FENCE LINE (NOT CO.)

AS DISTANCE WEST IS 10' W OF IRON - WE FELL APPROX.

18'S OF CREEK AND COUNTY STATED CORNER TO BE

IN CREEK - NO BT'S. FOUND OF COUNTY SURVEY

FOUND BT'S. BY IOWA STATE ENG. CAMP 1950'S. TO I.P.

IN AND UNDER E+W FENCE LINE

OLD R.R. GRADE IS AT E EDGE OF E CREEK BANK

SAW SOME FENCE POSTS E AND IN A LINE (NO WIRE)

THAT IF BACK UP WEST WOULD FALL IN CREEK - POSSIBLE

TO WHERE PIPE WAS - SHOULD CHAIN DOWN FROM N

3

WEST 1/16 BET. SEC'S. 26 &amp; 35

NOTES BY ITASCA COUNTY 1918. L.W. JOHNSON

SET IRON MONUMENT

TAM. 14 N5E 26.1'

TAM. 11 N37W 36.9'

8

1316.3 E4W



STANDARD SECTION CORNER TO SEC'S, 31-32  
 NOTES OF ORIG. GOV'T. SURVEY 1871  
 SET POST

TAM. 7 N85E 4,30LKS.=283.8'

NO OTHER AVAILABLE

NOTES BY ITASCA COUNTY 1917 ROAD SURVEY  
 PLAT ON FILE BY B. CRAIG

SET NEW POST FOR WOOD POST WHICH CHECKED  
 WITH COUNTY DISTANCE TO CLOSING CORNER 5+6

POPLAR 8 N14E 51.5'

NOW 2" ASPEN N22E 10.5' - NO SCRIBE

POPLAR 10 N22W 51.5'

NOW 14" ASPEN WINDFALL PARTLY DELAYED AT N1SW  
 51.5' SCRIBE T149 VISIBLE

CHECKED DISTANCE E TO CLOSING CORNER TO SEC'S,  
 5+6 IS 190.08' RHM 12-27-62

SET A 2" X 5' IRON PIPE WITH BRASS CAP MKD

T149NR26W

S C

531 | 532

1962

WITNESSED BY

RLS NO 3628

TAM. 8 N24W 110.0' MKD 531 BT

BLK. SPRUCE 4 N27E 47.5' MKD 532 BT

6' STEEL SIGN POST - WEST 7.2' BOTH SIGNS

THIS CORNER IS RECORDED 12-27-62 RHM

IN FIELD BOOK # OF T148NR26W PAGE 68

AFFIDAVIT BY PETER J. MEYER #3628 12-27-62



5

STANDARD SECTION CORNER TO SEC'S. 35+36

NOTES OF ORIG. GOVT. SURVEY 1871

SET WOOD POST

W. PINE 20 N40E 48 LKS. = 31.7'

W. PINE 28 N10W 39 LKS. 25.7'

NOTES BY ITASCA COUNTY 1921

PLAT ON FILE - BY P. C. WARNER

SET IRON MONUMENT FOUND 1" DIA. IRON

PIPE MARKING CORNER

PINE STP. 30 N14W 38.9'

NOW PINE STUMP N2W 38.9' SCRIBE CHOPPED AWAY

PINE STP. 30 N38E 31.6'

NOW PINE STUMP N46E 31.6' SCRIBE BT VISIBLE

SET 2" DIA X 5' LONG IRON PIPE WITH CAP MARKED

T49NR26W

SC

535 | 536

S2

1962

RLS NO 3628

WITNESSED BY

ASPEN 11 N36E 24.75' MKD SC 536 BT

CEDAR 12 N38W 128.40' MKD SC 535 BT

6' STEEL SIGN POST - NZW - 4.0' BOTH SIGNS

10-19-62 RHM

3-5-98 RMAIN

8' STEEL SIGN POST 30.7 FT NORTH 30.55 WEST



STANDARD QUARTER CORNER TO SECTION 36  
 NOTES OF ORIG. GOVT. SURVEY 1871  
 SET WOOD POST

BIRCH 7 N35W 7 LKS. = 4.6'

W. PINE ~~20~~<sup>6</sup> ~~N33E~~<sup>N33E</sup> 34 LKS. = 22.4'

NOTES BY ITASCA COUNTY 1921

PLAT ON FILE - BY P. C. WARNER

SET IRON MONUMENT ED. 1" IRON PIPE  
 MARKING CORNER

W. PINE 10 N54E 64.1'

NOW BADLY BURNED PINE STUMP N62E 64.1'

BALSAM 12 N48W 58.2'

NOW A DECAYED STUMP N40W 58.2'

SET 2" X 5' LONG IRON PIPE WITH CAP MARKED

T149NR26W

SC

1/4 536

1963

RLS NO 6807

WITNESSED BY

W. PINE 20 N39W 44.7' MKD SC 1/4 536 BT

MAPLE 4 N5E 21.2' MKD X BT

6' STEEL SIGN POST - WEST 4.0' BOTH SIGNS



QUARTER BETWEEN SECTIONS 20 & 21  
 NOTES OF ORIG. GOV'T. SURVEY 1875  
 SET WOOD POST

CEDAR 7 579W 4 LKS. = 2.6'  
 NO EVIDENCE found in 1985

FIR 6 EAST 5 LKS = 3.3'  
 NO EVIDENCE

3/20/85 CB JA

SET CORNER LOST - SEE SECTION SUBDIVISION  
 OF SECTION 21 DONE 1985 BY USFS.

SET: 2 1/2" x 5" Brass Capped Iron Pipe up

1" in wet area: marked T149NRZLW

10/16/91 BRAMA+WOTZKA removed

U.S.F.S. monument AND RESET

BTS:

Ash 10" NB2W 41.06'

10/16/91 Destroyed scribed

Maple 7" N05W 35.01'

(Bark Blazed)

Destroyed scribed

Maple 4" S80E 15.34'

(Bark Blazed)

Destroyed dead snag

Steel sign post 3" x 8" SOUTH 2.55'

Removed sign post.

Blazed & scribed,

tags, red ring

spks

Removed tags  
 spikes driven  
 out of sight

Att. sign

CORNER Falls 75' SOUTH OF RIDGE and  
 150' NORTH OF LAKE HELEN - ASH LOWLAND

N  
 ↑

LAKE HELEN

Notes of J.A. Gjelhaug 1936 (2/14/36) CCC.

found Cedar 7" East 5 lks. mark 1/4 5 RT

Set cedar post 36" high

Placed a FSLP on Cedar Stub 5' high

5 LKS from EAST of corner

REFER TO BOOK 2, PAGE 8 for  
 Monumentation.



8 N-11

QUARTER CORNER BETWEEN SECS. 16 & 21  
NOTES OF ORIG. GOVT. SURVEY 1875  
SET WOOD POST

CEDAR 10 N40E 102 LKS. = 67.3'

CEDAR 12 S24W 125 LKS. = 82.5'

3/16/81 CK-BT-TB

FROM NW CORNER OF SECTION 21 RAN LINE AT  
S88°30'E - 2655' - Fd. TAG BY J.A. EIJELHAUG  
2/11/36 ON 16" BALMIE 30' HIGH SNAG AS APPROX.  
1/4 CORNER - TAG IS 6' WEST OF OUR CHAINED  
DISTANCE - OUR DISTANCE IS SPLIT OF MILE  
ACROSS TOP OF SECTION 21 - 5310' FOR MILE  
NO ORIGINAL EVIDENCE COULD BE FOUND  
PLACE FSLP ON 4" ELM APPROX. CORNER IS  
S20E 6.0' FROM TAG

DRAFT CERT DONE  
1/21/92 CK

100

B/21/85 CK JA G.B.  
SET CORNER POST - SEE SECTION SURVEY OF  
SECTION 21 DONE 1985 BY U.S.F.S.

SET: 2" x 3/8" BRASS CAPPOCK IRON PIPE  
UP 6" ABOVE GROUND

BTS:

Aspen 8" N35E 60.60'

Cedar 13" N86E 84.95'

Balsam 6" S60E 66.05'

Steel sign post 3" x 8" EAST 4.0' (both signs)

Corner falls 30' SE of a Ash swale  
line to standard east & west

Re-copied from Traverse Book 1 page 51

marked  
T1494R26  
516  
1/4  
521  
1985  
RLS NO.

Placed & described  
spks tags red ring



QUARTER CORNER BETWEEN SEC'S. 21-22  
 NOTES OF ORIG. GOV'T. SURVEY 1875  
 SET WOOD POST

LINDEN 7 S74E 56 LKS. = 37.0'

W. BIRCH 10 N57W 30 LKS. = 19.8'

3/5/85 CK-GB-JA

SEARCH IN AREA OF CHAINED DISTANCE FROM NORTH  
 TIMBER NOW IN AREA IS NOT OLD ENOUGH FOR ORIG.  
 STAND - FIRE DESTROYED ANY EVIDENCE - BADLY  
 BURNT PINE STUMPS AROUND AREA OF CORNER

NO EVIDENCE OF ORIG. SURVEY COULD BE FOUND  
 WILL SET PROPORTIONATE POSITION FROM  
 TRAVERSE BETWEEN NE & SE CORNERS

8/27/85 GB JA

SET CORNER POST - SEE SECTION SUBDIVISION of 21

done by U.S.F.S. 1985

SET: 2" x 36" Brass capped Iron Pipe up 12" marked  
 1375'

T149 NR 260

maple	5"	N88W	9.45'	Blazed section spac 75' marking 115 NO.	521/522 1985
maple	14"	N34E	37.48'		
Crosswood	10"	N67E	33.33'		

Steel sign post 2" x 8" South 3.5' AH sign

Corner falls in mixed hardwood stand on high ground  
 re-copied from traverse bk. 1 pg. 53  
 C.C. Done




QUARTER CORNER BETWEEN SEC'S. 34 & 35

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

W. PINE 8 N38W 5 LKS. = 3.3'

H. SPEN 10 N48E 27 LKS. 17.8'

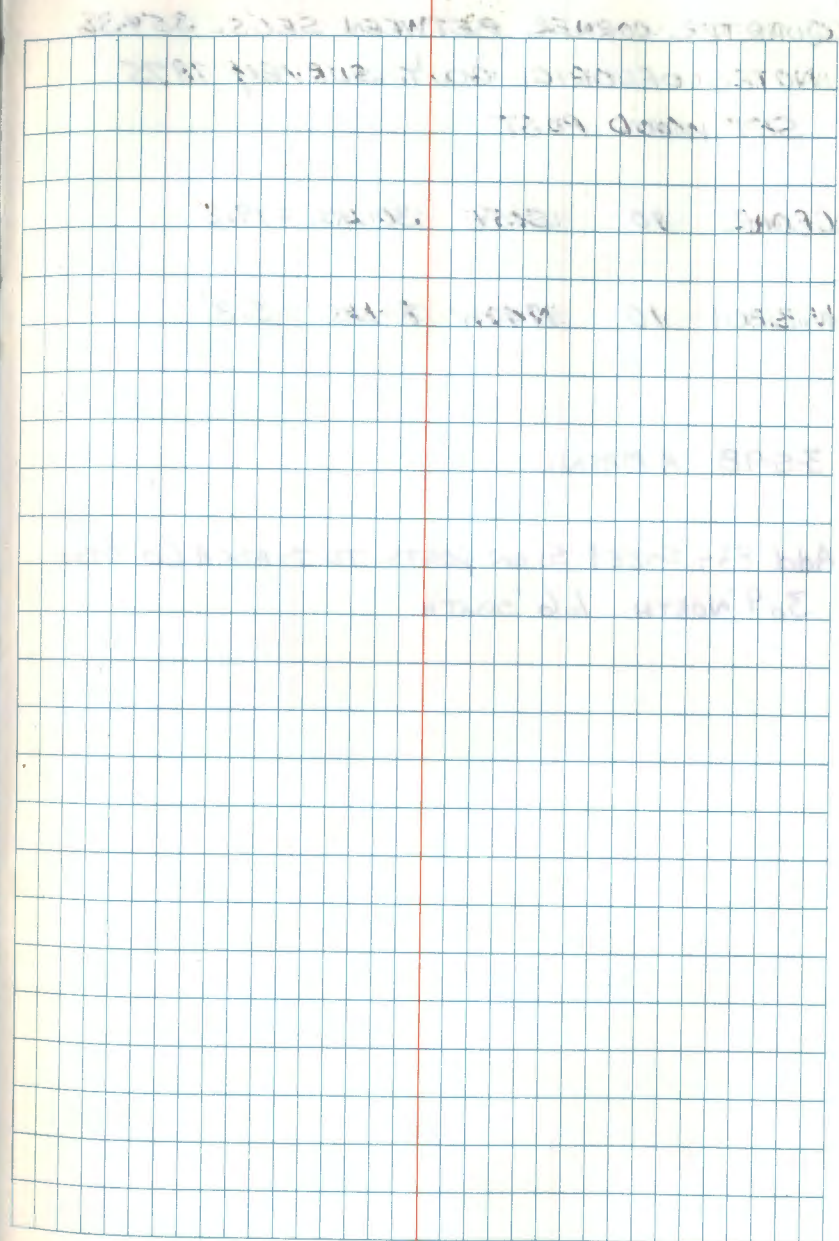



11  
QUARTER CORNER BETWEEN SEC'S. 35 & 36  
NOTES OF ORIG. GOVT. SURVEY 1875  
SET WOOD POST

CEDAR 10 SIDE 30 LKS. = 19.8'

W. BIRCH 10 N40W 8 LKS. 5.3'

3-5-98 R. MAIN.

Add 8 FT STEEL SIGN POSTS TO J. ASCA CO B.T.S.O.  
309' NORTH 106' SOUTH



QUARTER CORNER BETWEEN SEC'S. 29+30

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST

W. PINE 8 533W 48 LKS. = 31.7'

W. PINE 12 587- 161 LKS. 106.3'

6-17-80 CK-JS

CHAINED SOUTH FROM TAM. POST AT APPROX.  
SEC. COR. IN SPRUCE + TAM. SWP.

CHAINED '2665'S - SEARCH IN AREA, BUT  
NOTHING COULD BE FOUND AT THIS TIME

PUT FSLP ON SOUTH SIDE OF 7" W. OAK  
APPROX 1/4 COR. IS 15' SOUTH OF OAK

RAN SOUTH TO WOODS ROAD E+W - PUT  
FSLP ON 4" W. OAK (IN CLUMP) 200' N TO  
1/4 COR.



SECTION CORNER TO SECTIONS 29, 30, 31 & 32

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

BIRCH 7 N88W 18 LKS. = 11.9'

BIRCH 9 S14W 19 LKS. = 12.5'

BIRCH 8 S34E 46 LKS. = 30.4'

W. PINE 20 N89E 53 LKS. = 35.0'

2-12-80 FIRST CHAINED INTO CORNER

6-23-80 CK-JS

ESTABLISHED APPROX. SEC. COR.

PUT FSLP ON 11 W. SPRUCE ON SOUTH SIDE

APPROX. SEC. COR. IS 15' EAST OF TAG

NO ORIG. EVIDENCE COULD BE FOUND

POSITIONED FROM ORIG. LAND TIES

RAN SOUTH TO WOODS ROAD - PUT FSLP

ON 9" ASPEN ON NORTH SIDE - APPROX.

SEC. COR. IS 190' N OF TAG AT ROAD

CHAINED ALL DIRECTIONS FROM THIS COR.

5310' FROM EAST - 5203' TO WEST

5310' FROM NORTH - 5320' FROM SOUTH



QUARTER CORNER BET. SEGS. 30+31

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

BIRCH 8 S79E 116 LKS. = 76.6'

BIRCH 6 N63E 103 LKS. = 68.0'

6-4-80 CK-JS

SET 3" TAM. POST AS APPROX. 1/4 COR.

PUT FSLP ON 10" TAM. S49E-8.7'

FROM TAM. POST

NO TRACE OF ORIG. COR. COULD BE FOUND

2640' W OF APPROX. SEG. COR. 29-30-31-32



QUARTER CORNER BETWEEN SEC'S. 314-32

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

TAM. 7 WEST 6 LKS. = 410'

TAM. 9 N86E 71 LKS. = 4619'

2-12-80 CK-JS

CHAINED NORTH FROM F.S. BRASS-CAPPED IRON PIPE  
AT SEC. COR. - 2640'N - SEARCH IN AREA FOR

ANY EVIDENCE OF ORIG. COR. - NONE FOUND

CONTINUE NORTH TO SEC. COR.

WE WILL COME BACK WHEN WE KNOW HOW LINE

COMES OUT NORTH AT SEC. COR.

JUST ~~SEE~~ RIBBON ON BRUSH - MKD 2640'N



SECTION CORNER, TO SECTIONS 17, 18, 19 &amp; 20

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST (CEDAR)

CEDAR 7 S80W 290 LKS. = 191.4'

CEDAR 10 N74W 162 LKS. = 106.9'


CEDAR 14 N86E 67 LKS. = 44.2'

CEDAR 20 S89E 65 LKS. = 42.9'

QUARTER CORNER BETWEEN SEC'S. 18 & 19  
 NOTES OF ORIG. GOVT. SURVEY 1875  
 SET WOOD POST

SPRUCE 8 S 64 E 38 LKS. = 25.1'

SPRUCE 7 N 61 W 20 LKS. = 13.2'

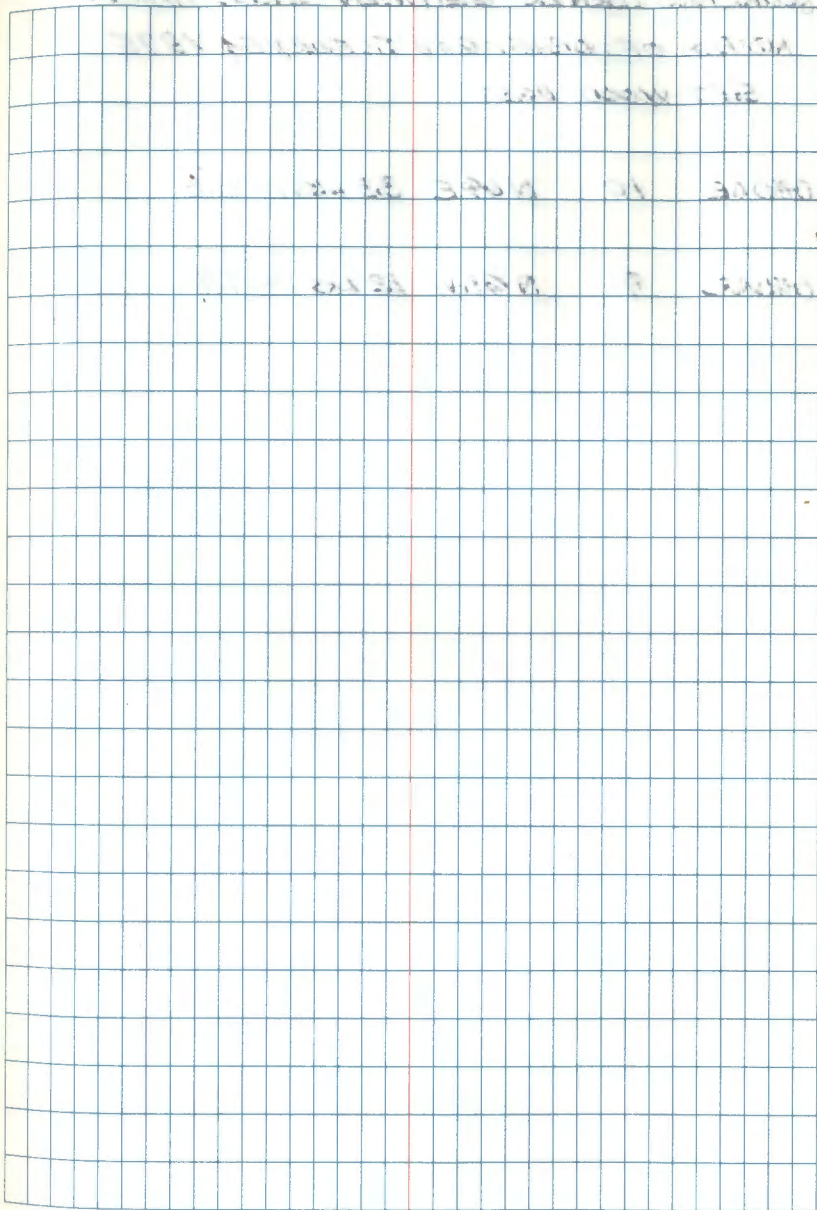




QUARTER CORNER BETWEEN SEC'S, 17+20  
 NOTES OF ORIG. CO. SURVEY 1875  
 SET WOOD POST

CEDAR 10 N69E 33 LKS. = 21.8'

CEDAR 9 S45W 12 LKS. = 7.9'

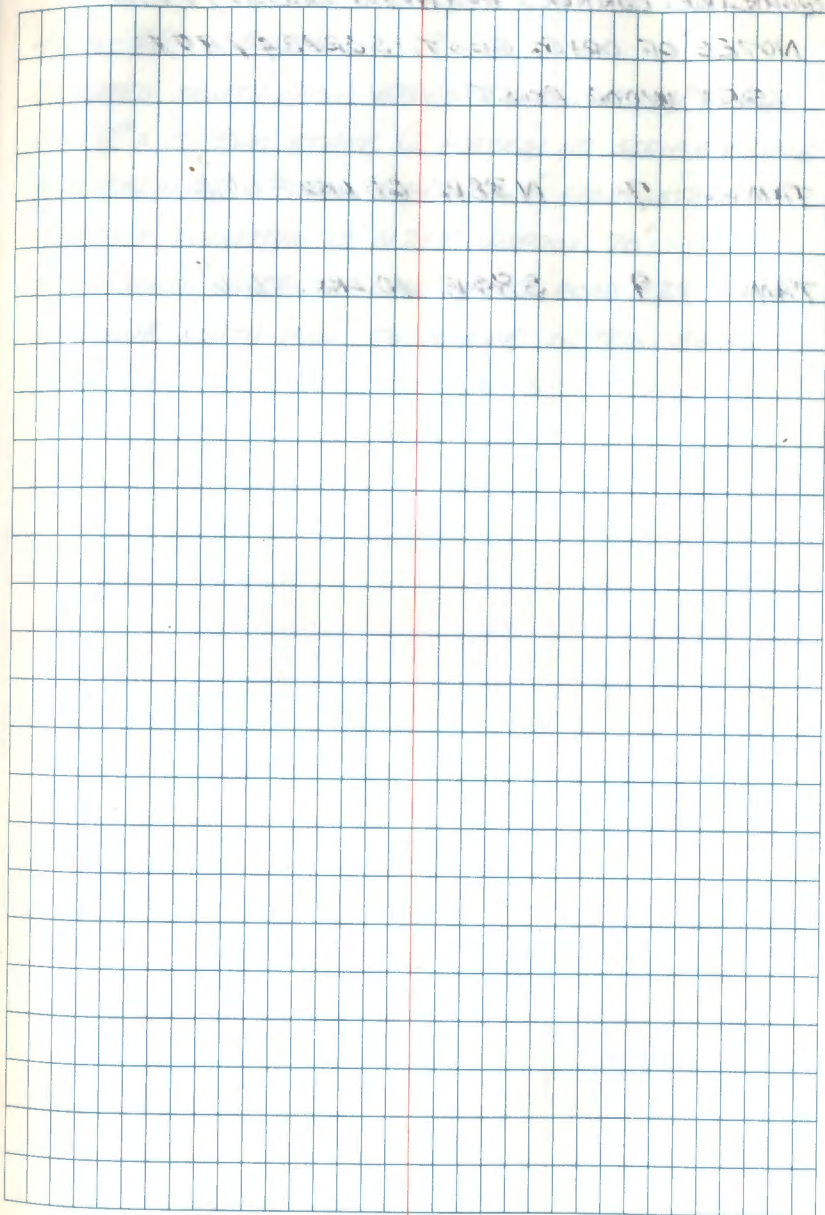

QUARTER CORNER BETWEEN SEC'S. 17 & 18

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

TAM. 7 N38W 61 LKS. = 40.3'

TAM. 9 S84E 10 LKS. = 6.6'

4-26-89 GB-CK

CHAINED SOUTH FROM APPROX. SE COR. TO NORTH  
ED. 2" x 5' TAM STAKE (2 PIECES) NO SCRIBE VISIBLE

PUT FSLP ON 6" TAM. SIDE 2.0' FROM STAKE

TARGET LOCATION IS N21E APPROX. 70'

1247' SOUTH IS CENTER LINE OF CO. ROAD # 29

CONTINUE SOUTH 1400' TO STAKE IN TAM. S&P.



## SECTION CORNER TO SECTIONS 7, 8, 17 &amp; 18

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST

SPRUCE 7 N80W 63 LKS. = 41.6'

TAM. 9 S32E 67 LKS. = 44.2'

TAM. 7 N86E 35 LKS. = 23.1'

TAM. 7 S44W 8 LKS. = 5.3'

Notes of Itasca Co. Survey

Mkd BT - Spruce 6" S56 $\frac{1}{2}$ ° E 55'

Notes of CCU's 9/12/40

Found spruce stake in fair condition 24" above ground. Found Spruce <sup>Snag</sup> 8" S38E at 33'. Location poster on this spruce on east side of road.

From  $\frac{1}{4}$  corner bet. sec's. 7/18 Itasca Co. has a road survey that shows a distance of 2664.4 to this <sup>section</sup> corner. ~~from~~

6/9/88 GB - used string machine and ran east down old swamp road. At 2664', I was in the center of a "T" intersection. Old swamp road runs N-S and west. Fd. no evidence of BT's on this date. Placed F.S.L.P. on 7" BIK Spruce, east 14.3' from approx. position.

6/16/88 CK-GB

CHAINED FROM POST AT S $\frac{1}{4}$  SEC. 7 EAST ALONG OLD SWAMP TRAIL 2667' TO 2" ASPEN STAKE - NOTHING MORE FOUND - CHAINED SOUTH 1247' TO E. OF DOBA LAKE - WIRT ROAD

QUARTER CORNER BETWEEN SEC'S. 8 & 17

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

TAM. 10 S79E 54 LKS. = 35.6'

TAM. 10 N13E 56 LKS. = 37.0'



CORNER TO SECTIONS 8, 9, 16 + 17  
NOTES OF ORIG. GOV'T. SURVEY 1875  
SET WOOD POST IN SWAMP

TAM. 6 S45E 21 LKS. = 13.9'

TAM. 5 N37W 17 LKS. = 11.2'

TAM. 6 S1W 3 LKS. = 2.0'

TAM. 4 N46E 21 LKS. = 13.9'

QUARTER CORNER BETWEEN SEC'S. 16 + 17

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST IN SWAMP

SPRUCE 6 N32E 34 LKS. = 22.4'

SPRUCE 5 N17W 51 LKS. = 33.7'



QUARTER CORNER BETWEEN SEC'S. 11 + 14

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

TAM. 10 N15W 8 LKS. = 5.3'

TAM. 8 S20E 25 LKS. = 16.5'

# CERTIFICATE FILED

1988 R. MAIN & ITASCA Co

Ed A POST WITH FOREST SERVICE LOCATION  
POSTER FORM # 458. POSTER SCRIBBLE INDICATES  
CORNER 34 INCHES SOUTH OF POST. INITIALED  
by JLS

QUARTER CORNER BETWEEN SEC'S. 9 & 16

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

ASH 8 N20E 460 LKS. = 303.6'

NO OTHER



WEST QUARTER CORNER TO SECTION 7

NOTES OF ORIG. GOVT. SURVEY 1875

SET CEDAR POST

CEDAR 7 N76W 33 LKS. = 21.78'

CEDAR 7 N44E 14 LKS. = 9.24'

CORNER TO SECTIONS 10-11-14+15

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST IN SWAMP

CEDAR 15 S33W 65 LKS. = 42.9'

CEDAR 12 N40W 15 LKS. = 9.9'

CEDAR 15 S56E 35 LKS. = 23.1'

NO OTHER



QUARTER CORNER BETWEEN SECTIONS 10+11

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST IN SWAMP

TAM. 6 S27E 405 HKS. = 267.3'

NO OTHER

CORNER TO SECTIONS 2-3-10411

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST IN SWAMP

SPRUCE 4 S88W 420 LKS. = 277.2'

SPRUCE 5 N84W 398 LKS. = 262.68'

TAM. 5 S86E 582 LKS. = 384.12'

NO OTHER



QUARTER CORNER BETWEEN SECTIONS 243  
NOTES OF ORIG. GOV'T. SURVEY 1875  
SET WOOD POST

ASPEN 8 S8E 15 LKS. = 9.9'

ASPEN 12 S31W 35 LKS. = 23.1'

QUARTER CORNER BETWEEN SECTION 3410  
NOTES OF ORIG. GOV'T. SURVEY 1875  
SET WOOD POST

BIRCH 10 NZIW 16 LKS. = 10.56'

BALMIE 8 S45W 6 LKS. = 40'



NORTH WEST CORNER TO SECTION 6

NOTES OF ORIG. GOV'T. SURVEY 1875

SET CEDAR POST

DEAD ASPEN 8 S26E 42 LKS. = 27.72'

DEAD TAM. 9 N78E 29 LKS. = 19.14'

DEAD ASPEN 10 S78W 106 LKS. = 69.96'

DEAD CEDAR 8 N47W 167 LKS. = 110.22'

TSW

WEST QUARTER CORNER TO SECTION 6  
 NOTES OF ORIG. GOVT. SURVEY 1875  
 SET SPRUCE POST

SPRUCE 6 SIZE 124 LKS. = 81.84'

SPRUCE 7 SIZE 130 LKS. = 85.8'

874 CCC NOTES By C. SHERMAN 1-16-34

FD. POST AND 1 BT

PINE 12 S40W 40 LKS. 26.40' SCRIBED

1/4 SI BT

PLACED FSLP ON SPRUCE 4" ON WEST SIDE  
 OF TREE - CORNER BRS. 20 LKS. = 13.2'

WEST QUARTER CORNER TO SECTION 6

NOTES OF ORIG. GOVT. SURVEY 1875

SET SPRUCE POST

SPRUCE 6 SIZE 124 LKS. = 81.84'

SPRUCE 7 SIZE 130 LKS. = 85.8'

874 CCC NOTES By C. SHERMAN 1-16-34

FD. POST AND 1 BT

PINE 12 S40W 40 LKS. 26.40' SCRIBED

1/4 SI BT

PLACED FSLP ON SPRUCE 4" ON WEST SIDE  
 OF TREE - CORNER BRS. 20 LKS. = 13.2'




NORTH QUARTER TO SECTION 6

NOTES OF ORIG. GOVT. SURVEY 1875

SET CEDAR POST

TAM. 7 N71E 20 LKS. = 1312'

NO OTHER LIVE TREE NEAR

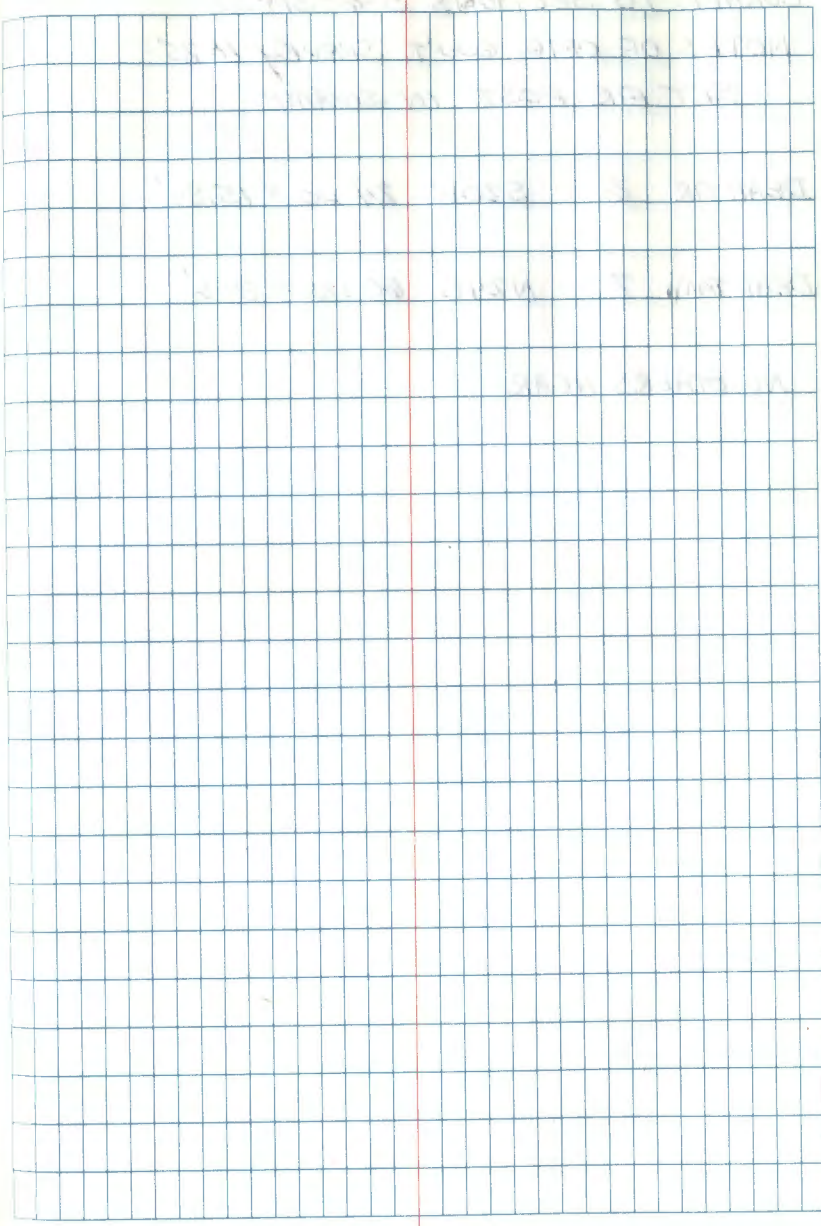

CORNER TO SECTIONS 5-6-31+32

NOTES OF ORIG. GOV'T. SURVEY 1875

SET FIR POST IN SWAMP

DEAD FIR 6 S20W 24 LKS. = 15.84'

DEAD TAMU 7 N24E 60 LKS. = 39.6'

NO OTHERS NEAR.



NORTH QUARTER TO SECTION 5  
NOTES OF ORIG. GOV'T. SURVEY 1875  
SET TAM. POST

TAM. 6 S39E 102 LKS. = 67.32'

NO OTHER NEAR

CORNER TO SECTIONS 1-6-7+12

NOTES OF ORIG. GOV'T. SURVEY 1875

SET TAM POST

TAM 7 N38E 58 LKS. = 38.28'

TAM 6 S64E 35 LKS. = 23.10'

ASPEN 12 S86W 360 LKS. = 237.6'

ASPEN 14 N81W 351 LKS. = 231.7'

5-27-88 CK+GB

FD. IRON PIPE 2" BELOW SWAMP ROAD

KSLP ON 7" ASH S10W - 45.8' FROM IRON  
SWAMP ROAD WEST + NORTH AND TRAIL SE



QUARTER CORNER BETWEEN SECTIONS 5+8

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST

TAM. 6 N 86 E 449 LKS. = 296.34'

TAM. 6 S 88 E 468 LKS. = 308.88'

CORNER TO SECTIONS 5-6-7+8

NOTES OF ORIG. GOVY. SURVEY 1875

SET WOOD POST IN SWAMP

SPRUCE 7 N55E 16 LKS. = 10.56'

SPRUCE 8 S29E 71 LKS. = 46.86'

SPRUCE 7 N38W 33 LKS. = 21.78'

TAM. 7 S12W 50 LKS. = 33.0'



QUARTER CORNER BETWEEN SECTIONS 5+6

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

TAM. 8 N75E 55 LKS. = 361.3'

TAM. 6 WEST 40 LKS. = 261.4'

QUARTER CORNER BETWEEN SECTIONS 5+6

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST


TAM. 8 N75E 55 LKS. = 361.3'

TAM. 6 WEST 40 LKS. = 261.4'

44  
QUARTER CORNER BETWEEN SECTION 6 & 7  
NOTES OF ORIG. GOV'T. SURVEY 1875  
SET WOOD POST

ASPEN 12 N15W 90 LKS. = 59.4'

CEDAR 8 S34W 110 LKS. = 72.6'

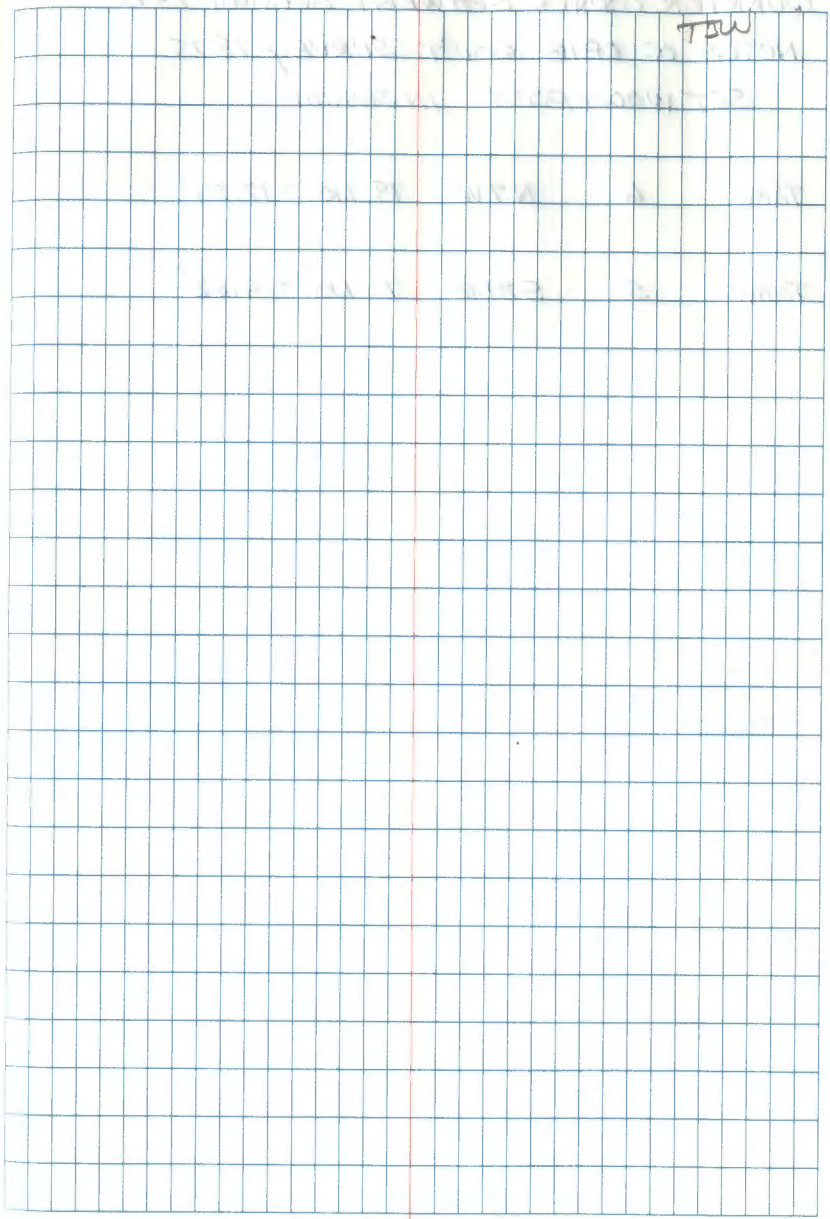



QUARTER CORNER BETWEEN SECTION 7 & 8

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST IN SWAMP

TAM. 6 N7W 19 LKS. = 12.54'

TAM. 5 S81E 7 LKS. = 4.62'


QUARTER CORNER BETWEEN SECTIONS 1+2

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

ASH 10 N24E 30 LKS. = 19.8'

ASH 12 N13W 25 LKS. = 16.5'

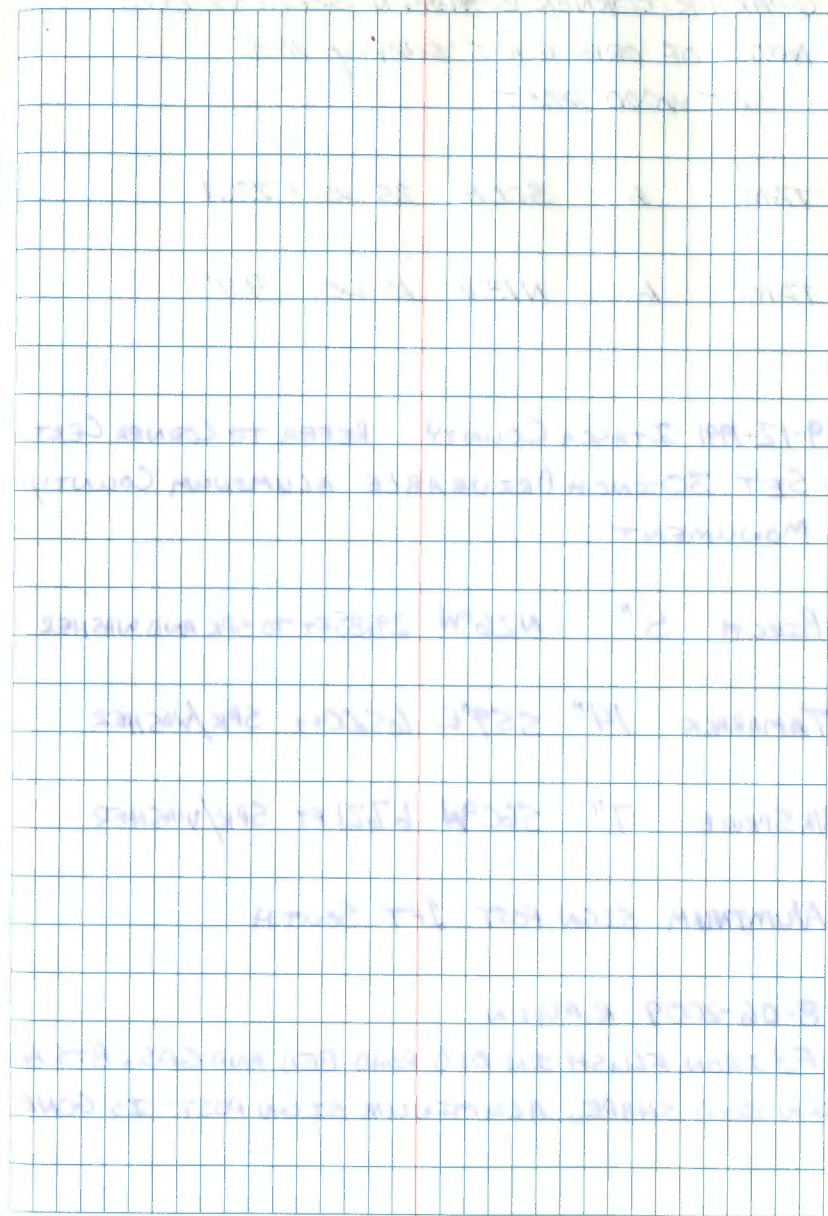



QUARTER CORNER BETWEEN SECTIONS 1412  
 NOTES OF ORIG. GOV'T. SURVEY 1875  
 SET WOOD POST

TAM. 6 S20E 35 LKS. = 23.1'

TAM. 6 N15W 15 LKS. = 9.9'

9-12-1991 ITASCA COUNTY REFER TO CORNER CERT  
 SET 30 INCH DRIVEABLE ALUMINUM COUNTY  
 MONUMENT

BIRCH 5" N26°W 29.85 FT TO SPK AND WASHER

TAMARACK 14" S59°E 65.00 FT SPK/WASHER

BLK SPRUCE 7" S60°W 67.21 FT SPK/WASHER

ALUMINUM SIGN POST 1 FT SOUTH

8-06-2009 R. MAIN

FD IRON FLUSH IN OLD ROAD BED AND GAS. B.TS ARE  
 IN GOOD SHAPE, ALUMINUM SIGN POST IS GONE.


QUARTER CORNER BETWEEN SECTIONS 2+11

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

TAM. 7 N7W 120 LKS = 79.2'

NO OTHER LIVE TREE NEAR

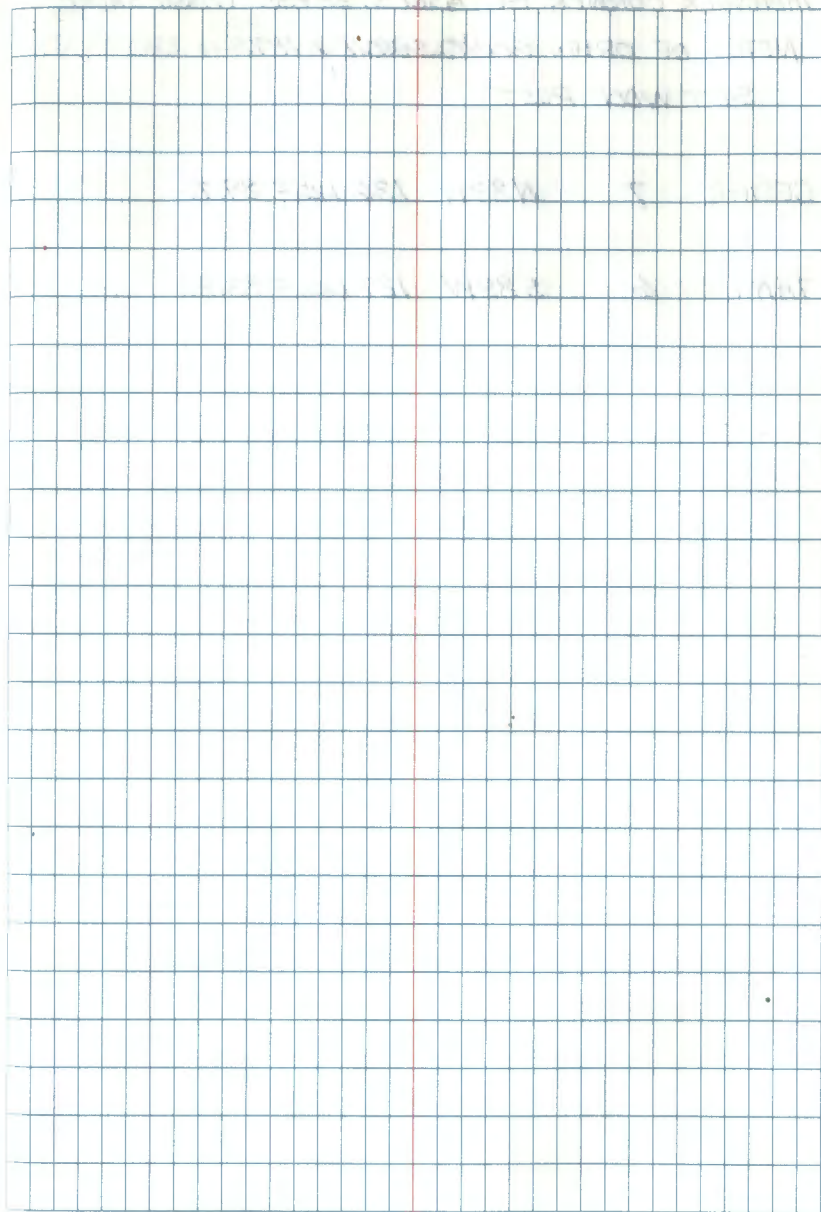



MEANDER CORNER, BET. SEC'S. 28+33 WEST SHORE

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST

CEDAR 7 N83W 136 LKS. = 89.76'

TAM. 6 S88W 127 LKS. = 83.82'

OR 3379.2'  
51.20 CHS. <sup>EAST</sup> ~~WEST~~ OF SEC. COR.

MEANDER CORNER BET. SEC'S. 27+34 EAST SHORE

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST

CEDAR 9 N75E 47 LKS. = 31.02'

NO OTHER NEAR

NOTES BY ITASCA COUNTY 1918 L.W. JOHNSON

SUBDIVISION OF SECTION 27

FOUND GOV'T. CEDAR STUMP - GOOD CONDITION

SET IRON PIPE

ASH 7 SITE 32.1'

CEDAR 20 N65E 36.6'

4-11-85 CK-GB-JA

CHAINED WEST FROM 1/4 POSITION IN CREEK - 420'

COUNTY DISTANCE - Fd. IRON PIPE - IN PLACE - LEANING

EAST - PUSHED BY ICE - Fd. ASH STUB LEANING

WEST IN LAKE

Fd. CEDAR WINDFALL AT N71E 36.6'

BLAZED 6" ELM 4' SE OF CORNER - PAINTED RED

ORIG. NOTES - WEST TRUE BET. SEC'S. 27+34

2475' 37.50 CHS. ENTER CEDAR SWP. N4S

2626.8' <sup>151.8'</sup> 39.80 CHS. CREEK 10 LKS. WIDE RUNS NORTH

2640' <sup>132'</sup> 40.00 CHS. 1/4 COR.

2659.8' <sup>19.8'</sup> 40.30 CHS. CREEK 10 LKS WIDE RUNS SW

2673' <sup>13.2'</sup> 40.50 CHS. ENT. WILLOW MARSH NE+SW

3069' <sup>396'</sup> 46.50 CHS. MARGIN OF LAKE SET M.C.



MEANDER CORNER BETWEEN SECTIONS 3 &amp; 10

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST

N. PINE 7 S72E 12 LKS. = 7.92' ✓

12' - scribiny visible "T149 26"

N. PINE 8 N35E 16 LKS. = 10.56'

14<sup>5</sup> "T149 R26" scribiny visible  
 REMAIN T. WOTZKA ITASCA CO  
 7/19/88 FOUND 1" (O.D.) I.P. 3 FT  
 EAST OF WATER'S EDGE

OTHER N. PINE WITH FACE BLAZE  
 AND SCRIBING OF NAME AND  
 STATE visible - DID NOT USE

REPLACED IRON PIPE WITH ITASCA CO MONUMENT

30" LONG ALUMINUM WITH 3" ALUMINUM CAP

MONUMENT IS FLUSH WITH THE GROUND AND

STAMPED;

ITASCA COUNTY

T149 R26W

MC/33

1988

R 25 14671

1" IRON PIPE ALONG SIDE NEW MONUMENT. PLACED  
 TIE NAILS IN BEARING TREES AT ORIGINAL  
 DISTANCE.

2-23-94 RM4CK

FD. BOTH ORIG. GOV'T. N. PINE - ALIVE -  
 AT BEARING + DISTANCE FROM 1" OD IRON  
 PIPE AT ORIG. E.M.C. CORNER

MEANDER CORNER BETWEEN SECTIONS 3+10

NOTES OF ORIG. GOVT. SURVEY 1875

SET WOOD POST

N. PINE 12 N 59W 30 LKS. = 19.8'

N. PINE 8 S 59W 52 LKS. = 34.32'

CERTIFICATE FILED

ORIG NOTES

EAST TRUE BET. SEC'S. 3+10

363.0' = 5.50 CHS. SET M.C.



CERTIFICATE FILED

END OF  
BOOK 3