

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 7, Township 141, Range 27, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 7/15/80 placed a 2" x 60" concrete filled galvanized iron pipe
DATE
with a marked brass cap from bearing trees.

SKETCH OF REFERENCE TIES

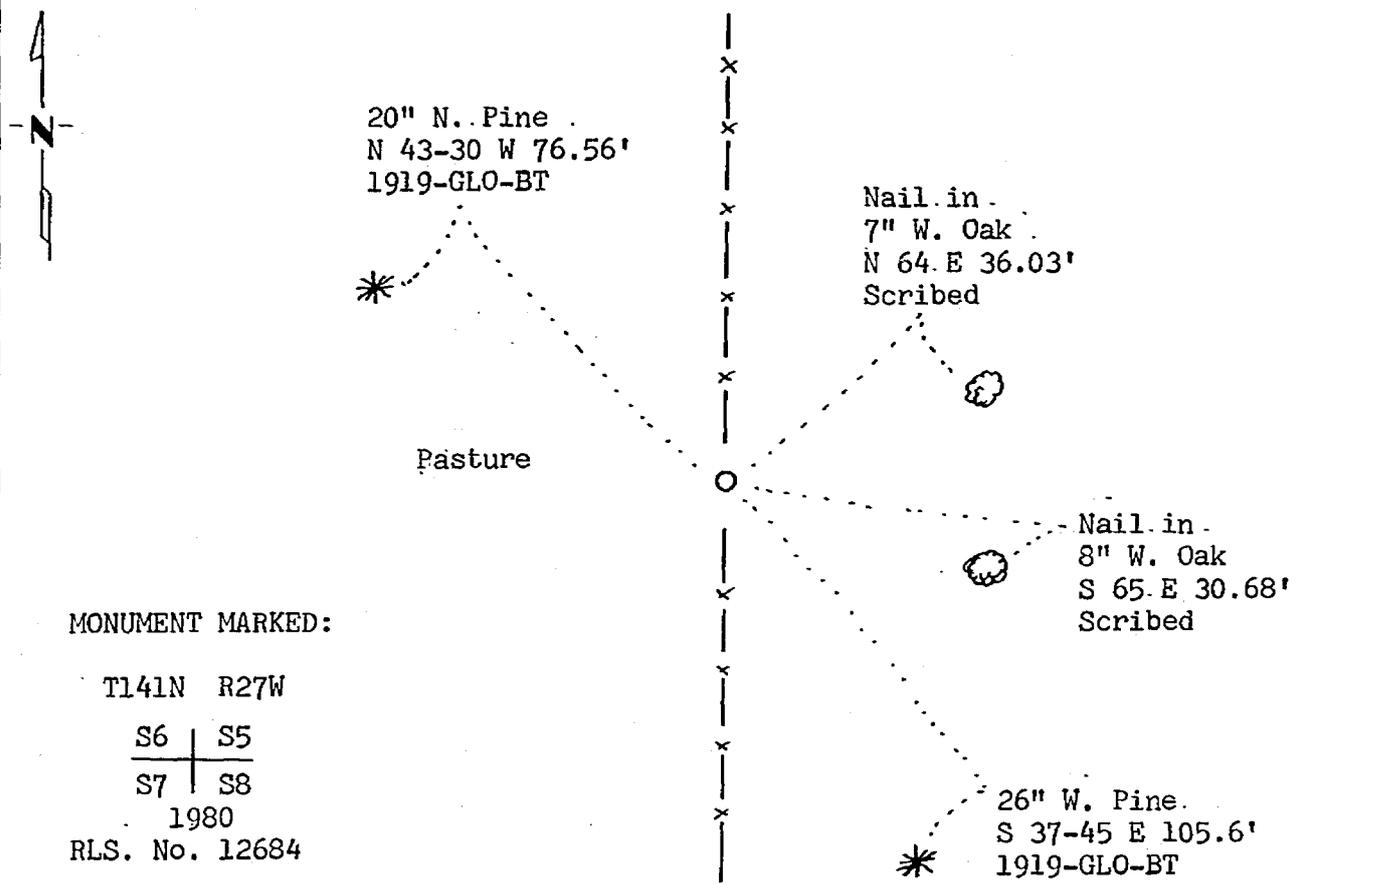

MONUMENT MARKED:

T141N R27W

S6	S5
S7	S8

 1980
 RLS. No. 12684

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Nay H. Stevenson 12-29-81
 SIGNATURE DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

260978
 OFFICE OF THE COUNTY RECORDER
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:00 A.M. on the 31 day of Dec. A.D., 1981

County Recorder Bertha Hendricks
 By MS, Deputy

DOCUMENT NO. 260978

Statement of Evidence:

- 1874 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 4" Poplar S 16 W 19 links, 30" W. Pine. N 11 W 126 links, 4" Tamarac N 20 E 36 links, and 4" Poplar S 19 E 20 links.
- 1919 U.S. General Land Office dependent resurvey reestablished this corner from the remains of a 36" Pine stump marked "BT" found N 11 W 126 links. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 8" W. Pine N 63-30 E 347 links, 8" W. Pine S 37-45 E 160 links, 8" Poplar S 62 W 130 links, and 5" N. Pine N 45-30 W 116 links.
- 1922 County Surveyor's Record Book D page 76 show survey by J.H. Flynn. Survey shows corner used for road on east line of Sec. 7. No mention is made as to type of monument found.
- 1980 USFS technician William Olson could not find the GLO brass cap monument. He did find the following evidence of the GLO bearing trees: Remains of original Pine stump N 11 W 83.0', 26" W. Pine S 37-45 E 105.6' with overgrown scar, and 20" N. Pine N 43-30 W 76.56' cut open and scribing found. From the two 1919 GLO bearing trees, a 2" x 60" concrete filled galvanized iron pipe with a marked brass cap was set to mark the corner. Two new bearing trees were marked and are shown on this certificate. A steel sign post was set 3.0' north of the corner.
- 1981 On Dec. 23, I visited this corner and found items as per 1980 USFS report. Accepted monument as perpetuation of original corner position.