

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 5, Township 137, Range 29; 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 9/7/83 found a 2" I.P. in road intersection down 0.75 feet with
DATE
large spike over
 left monument as found, lowered monument, removed monument (explain)
- On 9/7/83 placed a County Cast Iron Monument
DATE

SKETCH OF REFERENCE TIES

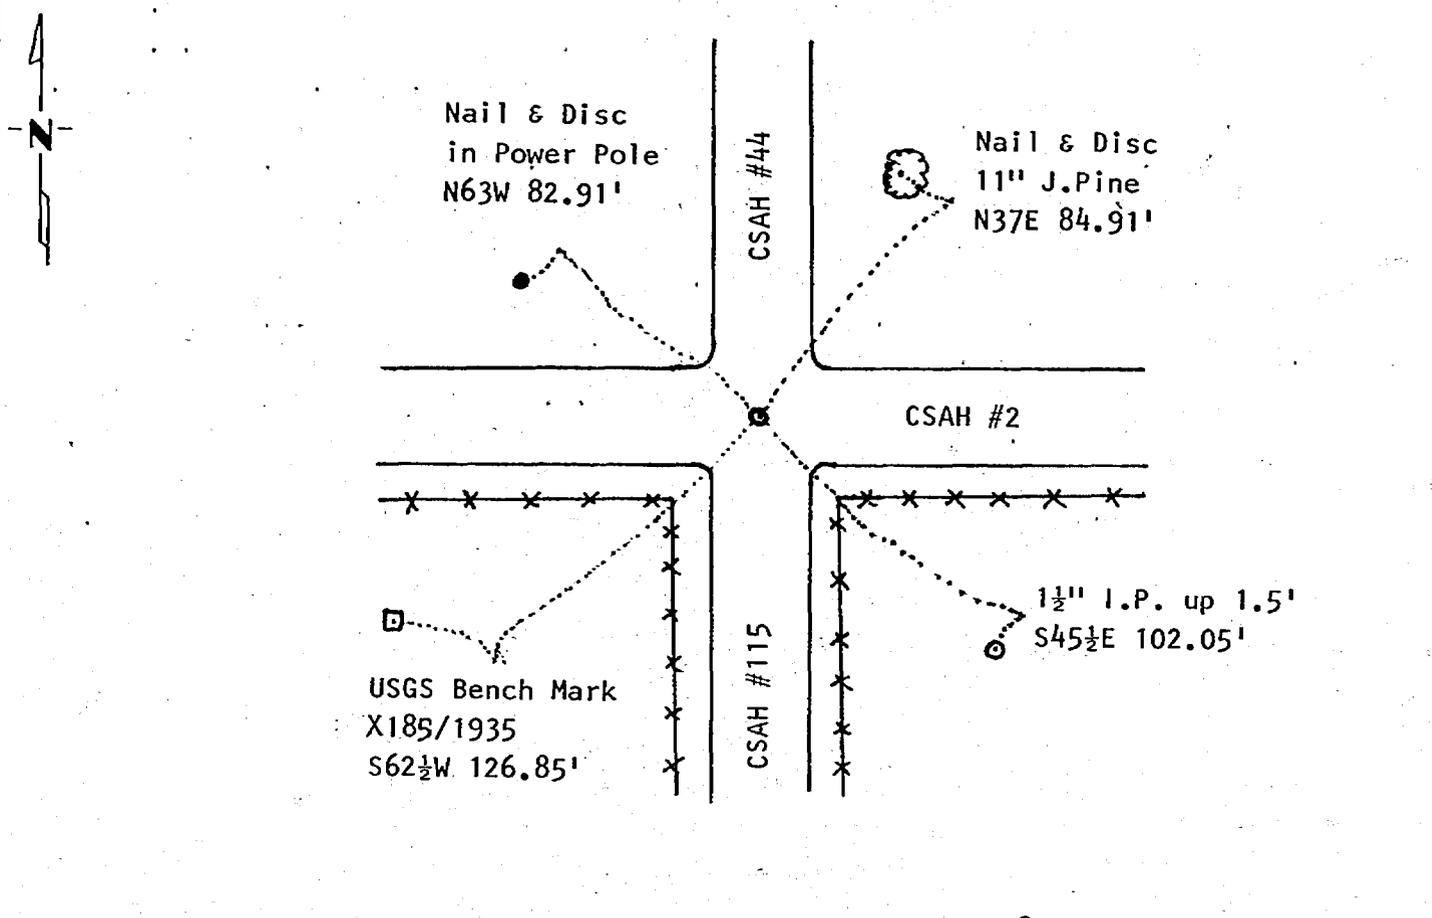

BEARINGS ASSUMED USING 6° DECLINATION

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Sam H. Stever 9/14/83
SIGNATURE DATE

Registration No. 12684

Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

271139
 OFFICE OF THE COUNTY RECORDER
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 10:15 A.M. on the 14 day of Sept. A.D., 1983

County Recorder Claudine Kayler
 By MS, Deputy
 DOCUMENT NO. 271139

Statement of Evidence:

- 1865- U.S. General Land Office Survey set a wood post for this corner and marked the following bearing trees: 20" N.Pine N77E 180 links, 4" Bl. Pine N23W 217 links, 20" N. Pine S43W 55 links, 20" N.Pine S24E 277 links.
- 1908- County Surveyor's Record Book A, Pages 318-328, shows a survey by John Curo. He set a post for the corner from all 4 GLO bearing trees.
- 1922- C.J.Bark, Assistant Highway Engineer, filed a Certificate of Location of Government Corner. He found the corner and ties: 8" J.Pine NE 31.7', fence post SE 41.9'. He set a 2" I.P. and 4 pipes 2"x42" for bearings: Pipe SE 41.0', Pipe SW 40.0', Pipes NE & NW 46.7'
- 1939- County Surveyor's Record Book D, page 210, shows a survey by John Curo. He found an iron set previously and his old ties. He set a new 2x36" I.P. and marked the following bearings: 12"x15" stone N45W 45', 8" J.Pine S45-45E 68.82', 15" J.Pine N49-18E 67.0', Corner of USGS Brass Cap S58-08W 40.16', Power pole N18-50W 79.90', Power pole S38-30W 47.0', 2½" J.Pine S22-13W 67.30', Corner of foundation of gas pumps S30-45E 77.20'.
- 1983- On Sept. 7, County Survey Technician T.Freeman and I found a large spike in the road intersection. Down 0.75' below surface, we found a 2" I.P. We also found J.Pine stumps S46E 69.2' and S41½W 121.5' Found USGS Bench Mark X185/1935, but it appears to have been moved. The 2" I.P. and spike were lowered to 1' below road surface. A Cass County Cast Iron Monument was set over the pipe. We searched for the other 1922 & 1939 ties, but due to the road intersection being changed,, these ties were destroyed and no evidence of them was found.