

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

WITNESS COR. TO M.C.#21 Corner of Section 33, Township 141 N, Range 31 W, 5th P.M.

STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

On \_\_\_\_\_ found a \_\_\_\_\_  
DATE

left monument as found,  lowered monument,  removed monument (explain)

On 9/20/84 placed a 2½ inch by 5 ft. long galvanized pipe with 3 inch  
DATE  
brass cap, stamped as shown, up 4 inches.

5½° East declination

### SKETCH OF REFERENCE TIES

not to scale

N 47° E, 120.89 ft. to SW cor. cabin foundation.




N 73° E, 109.96 ft. to SW corner garage.



iron mon. up 24 inches.

9.96'

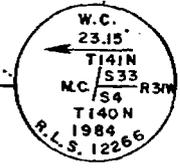

6'±



S 87° E, 101.75 ft. to NW corner cabin.

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Anthony E. Keich 12/12/84  
SIGNATURE DATE

Registration No. 12266

Land Surveyor,  Professional Engineer

County Surveyor,  County Engineer

280502  
OFFICE OF THE REGISTER OF DEEDS

County of Cass

I hereby certify that this document was filed in the Reg. of Deeds office at 10:35 A.M. on the 25 day of February A.D., 1985

Register of Deeds Clairine Kayler  
County Recorder  
By MS Deputy

DOCUMENT NO. 280502

Statement of Evidence:

WITNESS CORNER TO MEANDER CORNER No. 21, SECTION 33,  
TOWNSHIP 141 NORTH, RANGE 31 WEST OF THE 5th PRINCIPAL  
MERIDIAN. EAST SIDE OF TENMILE LAKE.

1864 - The original Public Land Survey was run by Johnson and Thornton. set a wood post to mark the corner and recorded two bearing trees as accessories:

10" W. Pine N 70°E 119 links (78.54')  
13" Aspen S 81°E 115 links (75.90')

1984 - Kerick Surveying, Inc., Bemidji, MN. ran the South line of Section 33 for the U.S. Forest Service. The only records available were the original survey. We found no trace of the original corner or its accessories. We found a 1-3/4" iron pipe up 30" to be off line and out of proportion for M.C. No.21. We did not accept this iron for the M.C. or for a witness corner. Contacted Walter Curo R.L.S. about this corner he stated he had no records regarding this corner and did not use it for establishing the South line for a survey he did in Section 32. A porportioned distance for the M.C. would place the corner about 17 ft. into Tenmile Lake. Set a Witness Corner to Meander Corner No. 21 on East side of Tenmile Lake 23.15 feet East of the porportioned distance for M.C. No.21. Set a U.S.F.S. 3 inch stamped brass capped monument and recorded new corner accessories that appear on this certificate. The corners used to determine the porportion and the South line of Section 33 was the South Quarter corner of Section 33 and the South Quarter corner of Section 32.