

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 8, Township 141N, Range 31W, 5th P.M.

STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

On 9-30-84 found a 2½ inch (O.D.) iron pipe with a 3 inch brass cap,
DATE stamped as shown, up 0.5 feet.


left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

Declination: 6° East

SKETCH OF REFERENCE TIES

NOT TO SCALE

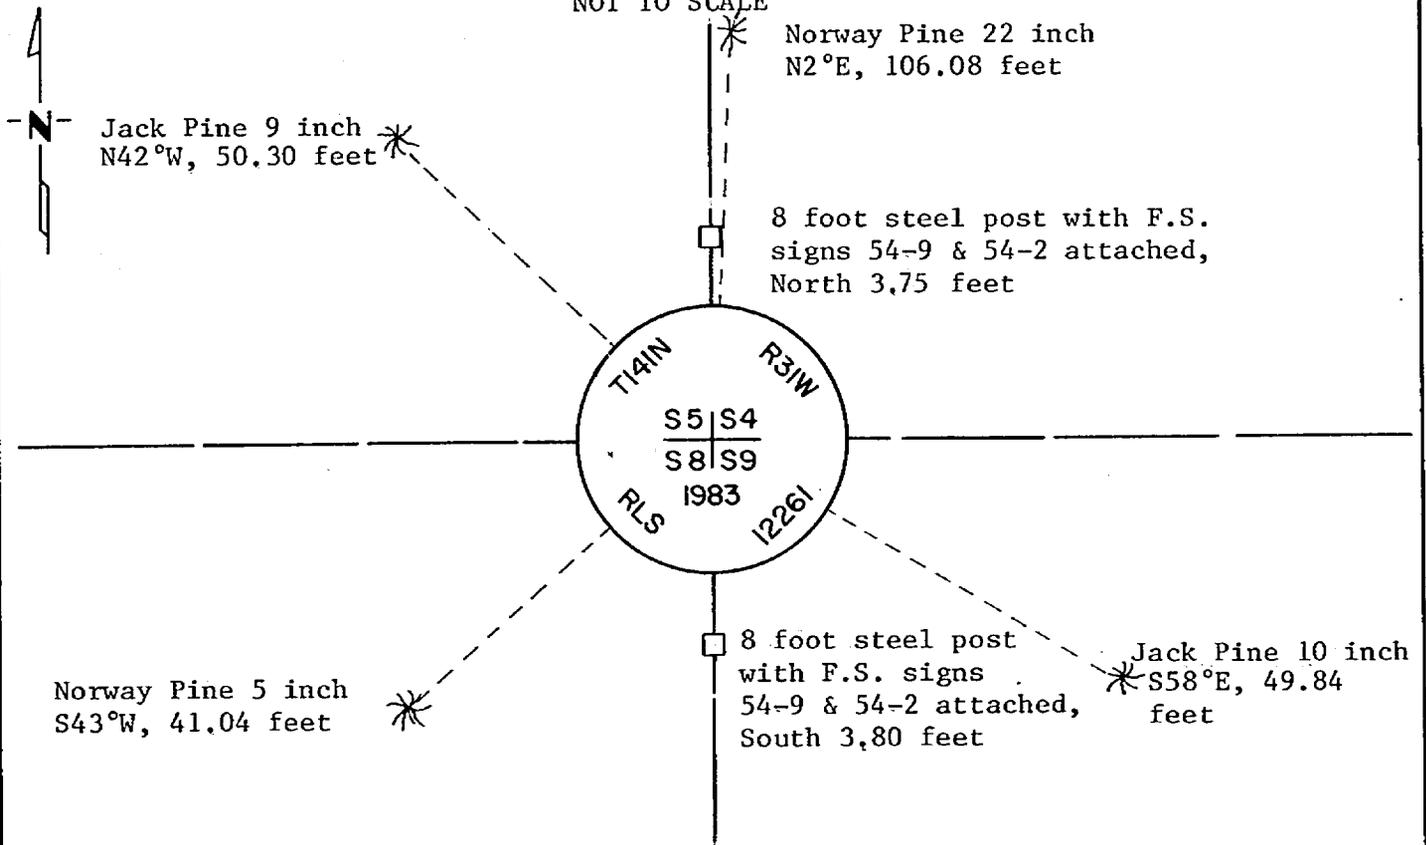

NOTE: All bearing trees are painted red and marked with F.S. sign No. 54-3 with a nail in base, double blazed and scribed.

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

William D. Oberman 2-1-85
SIGNATURE DATE

Registration No. 6807

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

280556
 OFFICE OF COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorder's office at 9:20 A.M. on the 27 day of February A.D., 1985

County Recorder Cloudine Kayler

By MS, Deputy

DOCUMENT NO. 280556

Statement of Evidence: Northeast corner of Section 8, Township 141 North, Range 31 West, 5th Principal Meridian.

- 1873 P.H. Conger, U.S. Deputy Surveyor, set a post for this Section Corner in his subdivision of the Township between August 5, 1873 and August 30, 1873. As references he scribed:
- | | | | |
|-----------|---------|-------|-----------------------|
| Jack Pine | 10 inch | N18°E | 28 links (18.48 feet) |
| Jack Pine | 6 inch | N24°W | 10 links (6.60 feet) |
| Jack Pine | 4 inch | S20°W | 6 links (3.96 feet) |
| Jack Pine | 4 inch | S16°E | 6 links (3.96 feet) |
- 1902 Army Corp of Engineers notes indicate the remains of marked stumps found at this corner during their survey for the Leech Lake Reservoir.
- 1917 E.B. Horst, Cass County Surveyor, found no evidence of original corner or BT's.
- 1924 J. Greene, Cass County Surveyor, established corner position while surveying in Section 4.
- 1929 Minnesota Highway Department found a 2 inch diameter iron pipe in place.
- 1962 U.S.F.S. Corner Restoration notes indicate no evidence of corner found.
- 1983 M. Hayes, U.S.F.S., made a thorough search for physical evidence of this corner on April 18, 1983, none was found. He returned on September 22, 1983 and established an obliterated position for the corner based on the original field notes, 1924 County Survey, and on old existing fence corner. He then set a monument 2½ inches (O.D.) x 3 feet long iron pipe with a 3 inch diameter brass cap up 0.5 feet and references as follows:
- | | | | |
|-----------------|---------|-------|-------------|
| Norway Pine | 22 inch | S2° E | 106.08 feet |
| Jack Pine | 10 inch | S58°E | 49.84 feet |
| Norway Pine | 5 inch | N43°W | 41.04 feet |
| Jack Pine | 9 inch | N42°W | 50.30 feet |
| 8 ft steel post | | North | 3.9 feet |
| 8 ft steel post | | South | 3.8 feet |
- 1984 Kelly M. Booge, under F.S. Contract No. 53-6392-4-00996, on August 30 fd. monument and references in good condition that were established by U.S.F.S. in 1983. The monument found and ties are shown on the sketch.

Kelly M. Booge is an employee of Okerman Surveying, Inc.