

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


Southeast Corner of Section 25, Township 143 N., Range 28 W., 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 7/23/86 found a broken 2" iron pipe 3' below surface of County Road #51, found the top lying in the ditch  
DATE  
 left monument as found,  lowered monument,  removed monument (explain)
- On 7/23/86 placed a 2"x36" galv. iron pipe with brass cap, over broken pipe, 8" below road surface, set R.R. spike on top  
DATE

### SKETCH OF REFERENCE TIES

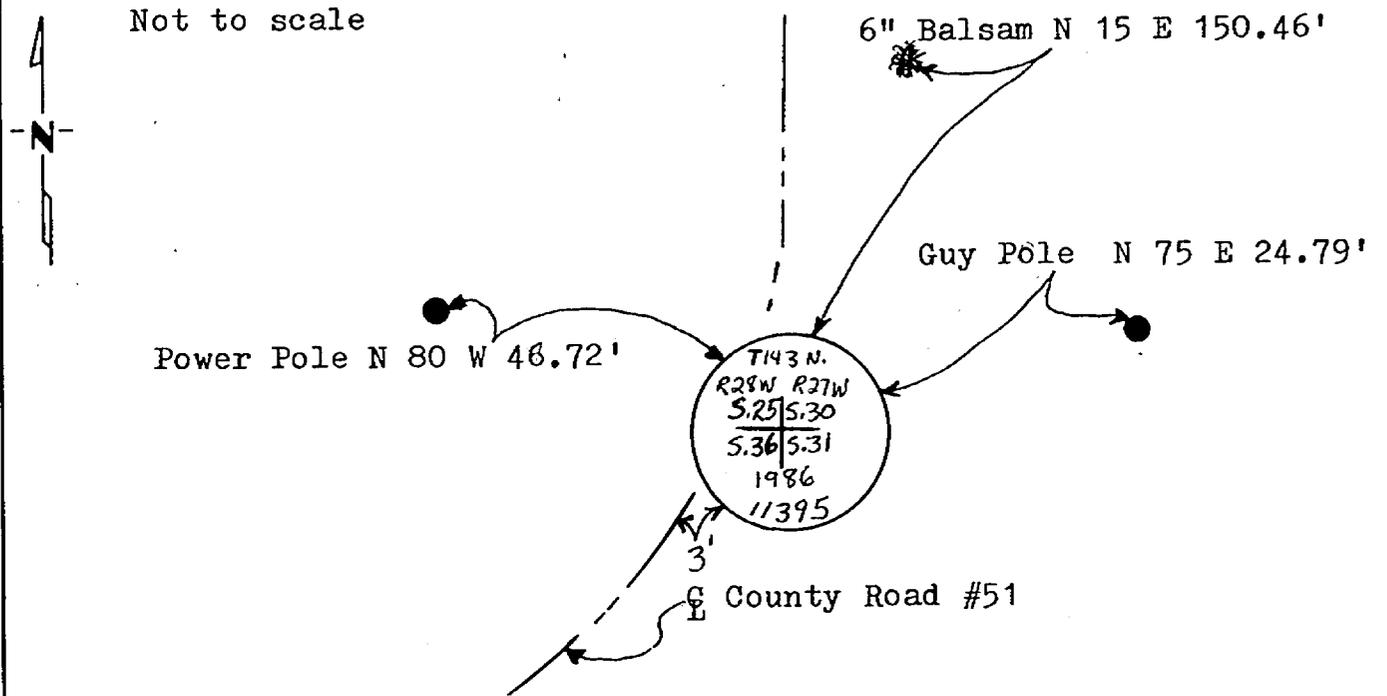

All measurements are to nail in side of object, trees are double blazed, scribed and painted red; with USFS 54-3 bearing tree tags attached.

Statement of evidence relative to this corner location is on back of page. 291488

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Walter E. Cross 9-4-86  
SIGNATURE DATE

Registration No. 11395

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

OFFICE OF THE REGISTER OF DEEDS  
 County of Cass

I hereby certify that this document was filed in the Reg. of Deeds office at 3:48 P. M. on the 5 day of Sept. A.D., 19 86

Register of Deeds Claudia K. Ogden  
 By MJ, Deputy

DOCUMENT NO. 291488

Statement of Evidence: Southeast Corner Section 25, T.143 N., R.28 W., 5th P.M.

- 1873 U.S. General Land Office survey set a wood post for this corner and marked the following bearing trees: 8" Tam N 40 E 16 lks., 5" Tam N 78 W 11 lks., 7" Tam S 30 W 20 lks., 8" Tam S 45 E 22 lks.
- 1916 County Survey Record Book "B", pages 220-242, show a survey by John Curo. He found the SE BT dead, and stumps of the SW, NW & NE BT's. He set a 4x72" Cedar post and marked a dead 6" Cedar N 75 W 1.50'
- 1920 County Survey Record Book "C", page 340, shows a survey by J.H. Flynn. He found the corner.
- 1928 U.S. General Land Office dependent resurvey shows local corner torn out by road construction. R.P. Brown showed gov't surveyors location of old post. They set a 2"x36" iron pipe with brass cap and set a 4x4x72" Cedar post alongside iron.
- 1986 On July 23, Walt Curo found the top 18" of the 1928 GLO iron with brass cap lying in the ditch and the bottom half down 3' in road bed, between corduroy logs on top of peat bog. Set a 2"x36" I.P. with brass cap, over found iron, down 8", set R.R. spike over I.P.