

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 34, Township 141 N, Range 28 W, 5th P.M.

STATE OF MINNESOTA, County of Cass

Latitude: 46° 59' 07.613"
 Longitude: 94° 12' 18.495"

At the corner location shown on the sketch:



On 11/1/88 found a 2" iron pipe with stamped brass cap.
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
 Not to Scale

All distances are horizontal to nail in side of tree.

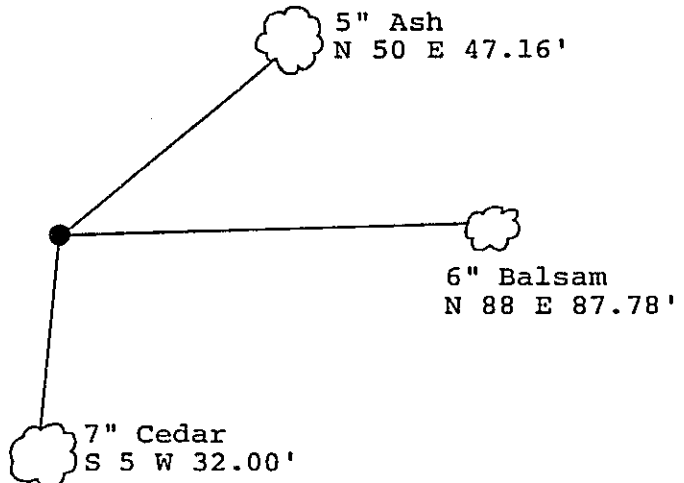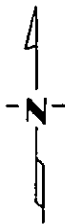

Monument is located 75'± Westerly of Easterly edge of Cedar, Spruce and Balsam swamp, and 500'± Easterly of RediMix plant. Monument is stabilized on Northerly side by 8' steel sign post. 8' steel sign post East 3.70'

Monument Stamped
 T 141 N R 28 W
^{1/2}
S34 | S35
 1987
 RLS 11946

All trees are painted with red enamel and marked with a 54-3 (bearing tree) tag.

Statement of evidence relative to this corner location is on back of page.

311945

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

David S. Landecker
 David S. Landecker

Date 5-1-89 Registration No. 17008

OFFICE OF THE COUNTY RECORDER
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:45 A.M. on the 9 day of May A.D., 1989

County Recorder Claudia Kaylor
 By MS Deputy

DOCUMENT NO. 311945

Statement of Evidence:

East Quarter Corner Section 34, Township 141
North, Range 28 West, Cass County, Minnesota

X-17 141-28
Bk.7 Pg.39

1874 P. H. Conger, U.S. Deputy Surveyor, originally established this corner position while subdividing Township 141 North, Range 28 West. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 5 inch Cedar North 50 degrees East a distance of 14 links; and a 4 inch Cedar North 45 degrees West a distance of 12 links.

1938 Civilian Conservation Corps found post in fair condition 18 inches above ground; a 6 inch Cedar North 31 and 1/2 degrees West a distance of 12 links; and an 8 inch North 62 and 1/2 degrees East a distance of 19 links.

1963 George Claydon plats AUDITOR'S PLAT OF LONGVILLE. Plat does not show monument in place. The plat does show, through mathematics, the Sixteenth lines necessary to reconstruct this corner position.

1986 U.S. Forest Service crews set an aerial target in the vicinity of this corner for the search and establishment of the true corner position. The target having coordinate values through the use of GPS on the Chippewa South Boundary Project Cadastral Survey U.S. Project Number 53-6392-8-219. This target allowed for the search and location of this corner.

1987 Roger Mustonen, Licensed Land Surveyor Number 11946, reestablishes this corner as obliterated from AUDITOR'S PLAT OF LONGVILLE. He sets a 2 inch stamped, brass capped iron pipe monument.

1988 a Landecker-Stevenson & Associates crew searched for the corner. The following information was found and noted: a 2 inch iron pipe with a brass cap stamped with Registered Land Surveyor Number 11946 (Roger Mustonen) in Cedar, Spruce and Balsam swamp; no evidence of bearing trees from 1874 or 1938 found. March 1 a Landecker-Stevenson & Associates crew take solar observation and tie monument set by Roger Mustonen in 1987 to U.S. Forest Service coordinate system. This corner mathematically fit the reconstruction as indicated on the AUDITOR'S PLAT OF LONGVILLE. This monument was accepted as monumented by Mustonen. His 1987 bearing trees were remarked as shown and a steel sign post is in place as noted on front of this certificate.