

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 33, Township 141 N, Range 29 W, 5th P.M.


STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch: Latitude: 46° 59' 42.371"
Longitude: 94° 20' 58.767"

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 3/23/89 placed a 3/4" by 5' aluminum rod with 3' fluted top
DATE and stamped aluminum cap.

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
Not to Scale.

All distances are horizontal to nail in side of tree.

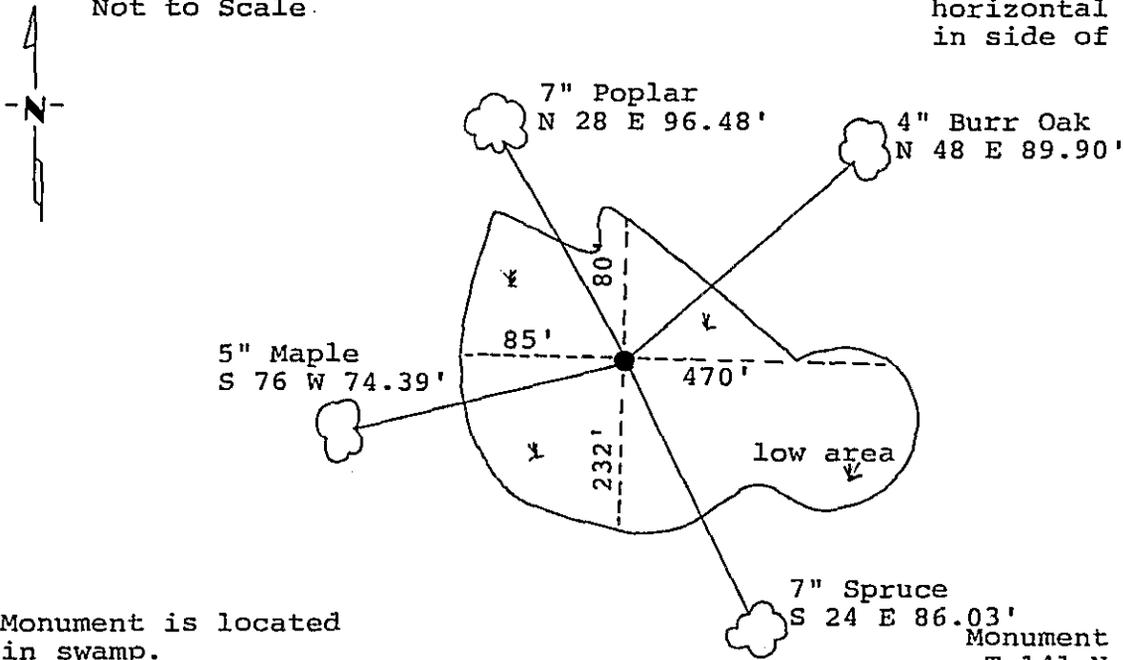

Monument is located in swamp.
8' steel sign post North 2.0'

Monument Stamped
T 141 N R 29 W
S28 | S27
S33 | S34
1989
RLS 17008

All trees are painted with red enamel and marked with a 54-3 (bearing tree) tag.

Statement of evidence relative to this corner location is on back of page.

312153

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

David S. Landecker
David S. Landecker
Date 5-12-89 Registration No. 17008

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 4:03 P.M. on the 15 day of May A.D., 1989

County Recorder Combine Kayler
By ms, Deputy

DOCUMENT NO. 312153

Statement of Evidence:

Northeast Corner Section 33, Township 141 North,
Range 29 West, Cass County, Minnesota

V-13 141-29
Bk.6 Pg.3

1873 P. H. Conger, U.S. Deputy Surveyor, originally established this corner position while subdividing Township 141 North, Range 29 West. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 4 inch Tamarack North 23 degrees West a distance of 23 links; a 3 inch Tamarack North 17 degrees East a distance of 19 links; a 3 inch Tamarack South 35 degrees West a distance of 16 links; and a 3 inch Tamarack South 22 degrees East a distance of 19 links. The field notes involving this corner indicate the edge of a Tamarack swamp is North 4 chains (264 feet), South 3 chains (198 feet), East 5.5 chains (363 feet).

In 1918 the U.S. General Land Office dependent resurvey of a portion of the sections within Township 141 North, Range 29 West found the original wooden stake and 4 bearing trees (now stumps) established by P.H. Conger at this corner location. No new stake or trees were marked at this time. This survey does show the mathematical position of all the Government corners established, recovered or reestablished in the section in which the corner falls (that being Section 27).

In the late 1970's Walt Curo, RLS Number 11395, established a position for this corner and set a 1 and 1/2 inch iron pipe. Curo has purported to have established his corner position by the use of the projection of the Southeast corner of Section 28 and a position established on the Easterly shore of Moccasin Lake together with the geographic calls noted in the original survey. His survey was made to establish the south line of Section 28.

1982 U.S. Forest Service crews searched for evidence, found none, but established a wood post for the approximate corner position for this corner. That being different than determined by Curo. 1986 U.S. Forest Service crews set a rerod and aerial target near the vicinity of their previously established approximate wood post and a separate aerial target over the Curo pipe. These targets then provided for the determination of coordinate values through the use of GPS on the Chippewa South Boundary Project Cadastral Survey, U.S. Project Number 53-6392-8-219. These targets have allowed for the search and location of this corner.

1988 on July 8 a Landecker-Stevenson & Associates, Inc. crew, David Landecker, RLS Number 17008, and Ken Metcalf searched for this corner in a position South 73 degrees West a distance of 35 feet from the target set by the Forest service near their approximate corner position. This position was established mathematically using the 1918 U.S. GLO resurvey record and the found corner along the north, east and west line of Section 27. The position falls in a Tamarack/Spruce swamp. No post or bearing stumps were found. Diggings in the swamp indicated that a fire had burned through the area in the past, charring the swamp peat to levels up to four feet deep. It is presumed these fires have destroyed the original post and its accessories.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner Section 33, Township 141
North, Range 29 West, Cass County, Minnesota

V-13 141-29
Bk.6 Pg.3

1988 on August 23 a Landecker-Stevenson & Associates Inc. crew visited the Curo pipe and searched for original evidence. None was found. It was noted that the distances to the swamp edges for comparison to the original notes were North 335 feet, South (island) 280 feet, East 225 feet. They also again visited their corner location established from the 1918 General Land Office resurvey and checked the distances to the swamp edges for comparison with the original notes. Their measurements were North 280, South 230, East 470. It was evident that this position fit both the original 1873 survey and the 1918 resurvey per their records.

1989 on March 23 a Landecker-Stevenson & Associates crew set a 3/4 inch by 5 foot aluminum rod with 3 feet of fluted top with stamped aluminum cap. New bearing trees were marked as shown and a steel sign post is in place as noted on front of this certificate.

This surveyor has therefore established the Northeast corner of said Section 33 at the obliterated computed position relocated from the 1918 resurvey notes of the General Land Office which at that time perpetuated the found original corner. This position also then fits in a physical location as witnessed by the original 1873 swamp calls. The Curo pipe falls South 14 degrees 30 minutes West a distance of 531 feet from this corner.