

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Standard Southeast Corner of Section 32, Township 141 N, Range 28 W, 5th P.M.

STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch: Latitude: 46° 58' 42.991"
Longitude: 94° 14' 21.491"


On 5/25/88 found a iron pipe in road.
DATE

left monument as found, lowered monument, removed monument (explain)

On 4/24/89 placed a 2 inch by 24 inch iron pipe with brass
cap and plastic base with magnet.
DATE

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
Not to Scale

All distances are horizontal to nail in side of tree.

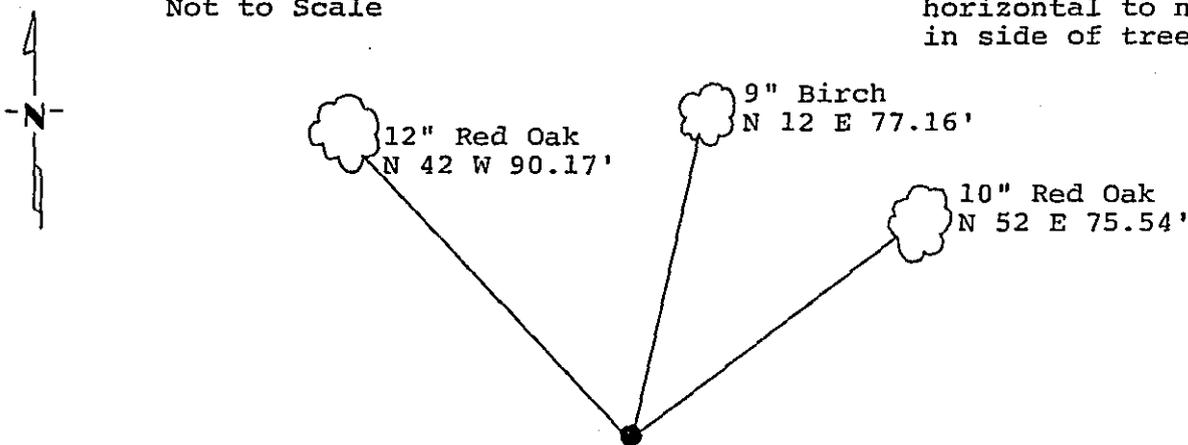

Monument is down 10" in centerline of road East-West.
8' steel sign post 33.3' North

All trees are painted with red enamel and marked with a 54-3 (bearing tree) tag.

Monument Stamped
R28W
SC
S32 | S33 T141N
1989 T140N
RLS 17008

Statement of evidence relative to this corner location is on back of page. 312350

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

David S. Landecker
David S. Landecker
Date 5-24-89 Registration No. 17008

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:10 A.M. on the 25 day of May A.D., 1989

County Recorder Claudine Kaylor

By MS, Deputy

DOCUMENT NO. 312350

Statement of Evidence:

Standard Southeast Corner Section 32, Township 141
North, Range 28 West, Cass County, Minnesota

Z-9 141-28
Bk.7 Pg.20

1863 Johnson and Thornton, U.S. Deputy Surveyors, originally established this corner position while running the 10th Standard Parallel. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 5 inch White Birch North 6 degrees West a distance of 37 links; and a 5 inch White Birch North 59 degrees East a distance of 28 links.

1912 County Survey Record Book B pages 265-269 shows survey by John Curo and Harry S. Todd, whereby Todd reestablished the section corners and monumented same along the 10th Standard Parallel for the entire South line of this township. These corner positions were determined proportionally between the Southeast and Southwest township corners.

1916 County Surveyor's Record Book B pages 384-390 show survey by E.B. Horst. He pulled found post, set a 2 and 1/2 by 48 inch iron pipe with cap in its place and marked the following bearing trees: an 8 inch Basswood South 71 degrees West a distance of 73.90 feet; and Oak posts Northeast and Northwest 46.70 feet.

1918 the U.S. General Land Office resurveyed portions of this township and in the process did not recover this corner. They used the Southwest and Southeast corners of the township to proportion along the South line of the township.

1925 John Greene found iron pipe as set by Horst.

1942 County Surveyor's Record Book D page 286 show survey by John Curo. He found the following evidence: a 7 inch Basswood North 24 degrees 15 minutes East a distance of 68.40 feet; a 4 inch White Oak North 47 degrees 43 minutes East a distance of 90.10 feet; and an iron monument South 25 feet, for witness to corner.

Numerous local surveyors have used the monument as established in 1912.

1986 U.S. Forest Service crews set an aerial target over this corner position for determination of coordinate values through the use of GPS on the Chippewa South Boundary Project Cadastral Survey U.S. Project Number 53-6392-8-219. This target allowed for the search and location of this corner.

1988 on October 17 a Landecker-Stevenson & Associates crew visited the corner and found the following information: 2 and 1/2 inch iron pipe in road, bent with rerod set over base, no evidence of bearing trees.

1989 on April 24 a Landecker-Stevenson & Associates crew set a 2 inch by 24 inch iron pipe with brass cap and plastic base with magnet in place of found rerod and bent 2 and 1/2 inch iron pipe. This monument was verified as being that same pipe as established and used by Curo and the other surveyors noted above. New bearing trees were marked as shown and a steel sign post set as noted on front of this certificate.