

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


**EAST QUARTER** Corner of Section 34, Township 139 N., Range 26 W., 5TH P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 5/29/90 found a 1 1/4" IRON PIPE, UP 0.6
- left monument as found,  lowered monument,  removed monument (explain)
- On \_\_\_\_\_ placed a \_\_\_\_\_

### SKETCH OF REFERENCE TIES

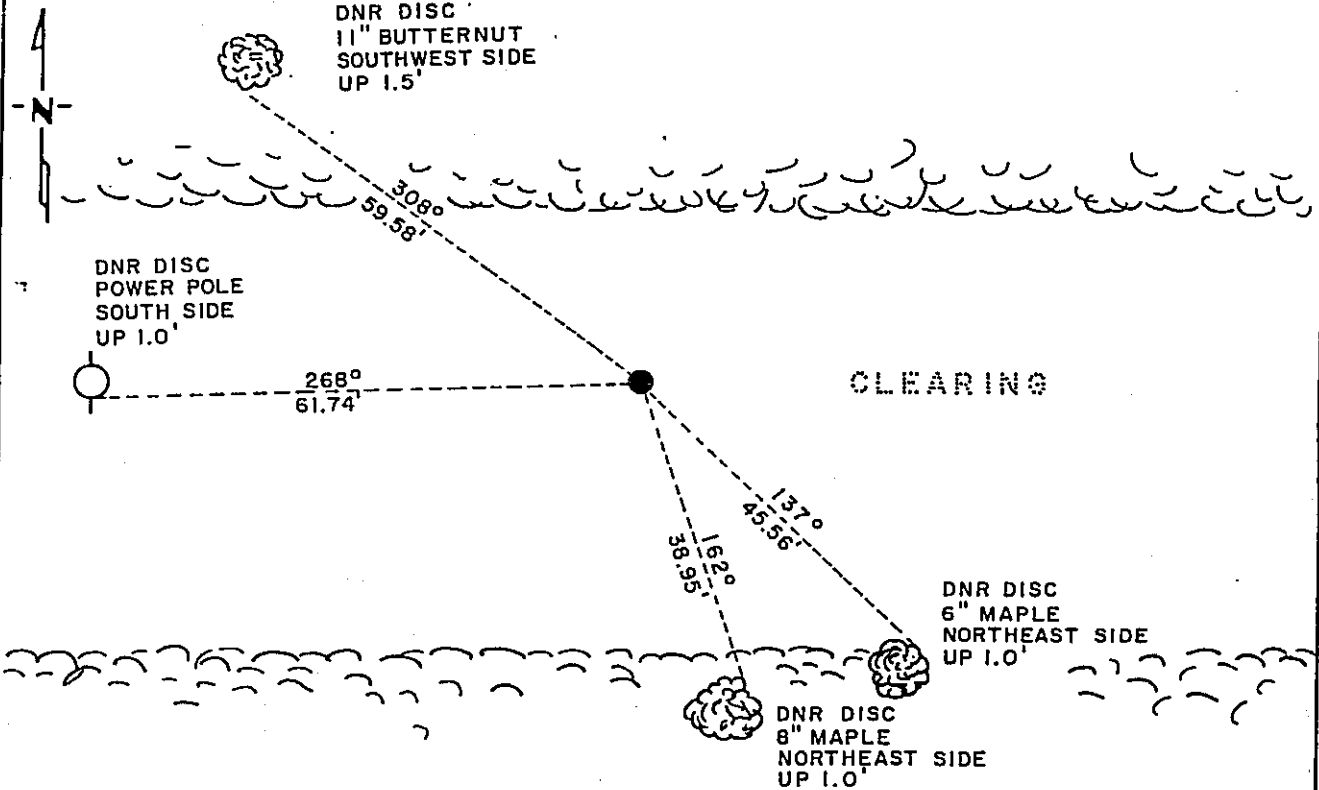

AZIMUTHS OBSERVED WITH A COMPASS.

Statement of evidence relative to this corner location is on back of page.

WAS-1289  
SVF 7/18/90

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

John D. Walker 9-28-90  
SIGNATURE DATE

- Registration No. 16098
- Land Surveyor,  Professional Engineer
  - County Surveyor,  County Engineer

324960  
OFFICE OF THE COUNTY RECORDER  
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 1:40 P.M. on the 14 day of November A.D., 19 90  
County Recorder Claudia Kaylor  
By MS, Deputy  
DOCUMENT NO. 324960

East Quarter Corner Section 34, Township 139 North, Range 26 West

The following offices were contacted for information regarding this corner:

Minnesota Secretary of States Office  
Landecker-Stevenson & Assoc. Inc, Private Surveyors  
Cass County Surveyors Office  
Cass County Recorders Office  
MN/DOT  
Crow Wing County Surveyors Office  
Widseth, Smith, & Nolting, Private Surveyors

- 1863 The United States Government Land Office established this corner. A post was set and two tie trees marked.
- 1908 John Curo located an original bearing tree. Set a stake to mark the corner using the original bearing tree. No ties noted.
- 1941 Jack Curo surveyed parts of Government Lot 4 and records this corner. His survey notes that there are monuments 651.46' and 1301.46' south of the East 1/4 Corner along the east line of Government Lot 4.
- 1951 MN/DOT located an iron pipe at the corner. They recorded a distance to the centerline of State Highway #6 as 1102.4' as measured along the 1/4 line, with an angle of 54°28' measured between the centerline and the 1/4 line.
- 1989 The DNR Bureau of Engineering found a 1 1/4" iron pipe in the area of the corner. No original evidence was located. The pipe is on an East-West power line and on a North-South cut line. The BOE recovered iron pipes 650.99' and 1300.99' south of the possible East 1/4 corner. The found iron pipe is 1103.20' east of the centerline of State Highway 6 and the angle made by the highway CL and the 1/4 line is 54°21'38".

After reviewing the available evidence the DNR chose to accept the iron pipe as the perpetuation of the corners location.