

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E 1/4 Corner of Section 28, Township 143, Range 25, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:


On 1990 found a 2 1/2" x 28" ALUM. BLM MONUMENT  
DATE

left monument as found,  lowered monument,  removed monument (explain)

On \_\_\_\_\_ placed a \_\_\_\_\_  
DATE

NOT TO SCALE

## SKETCH OF REFERENCE TIES

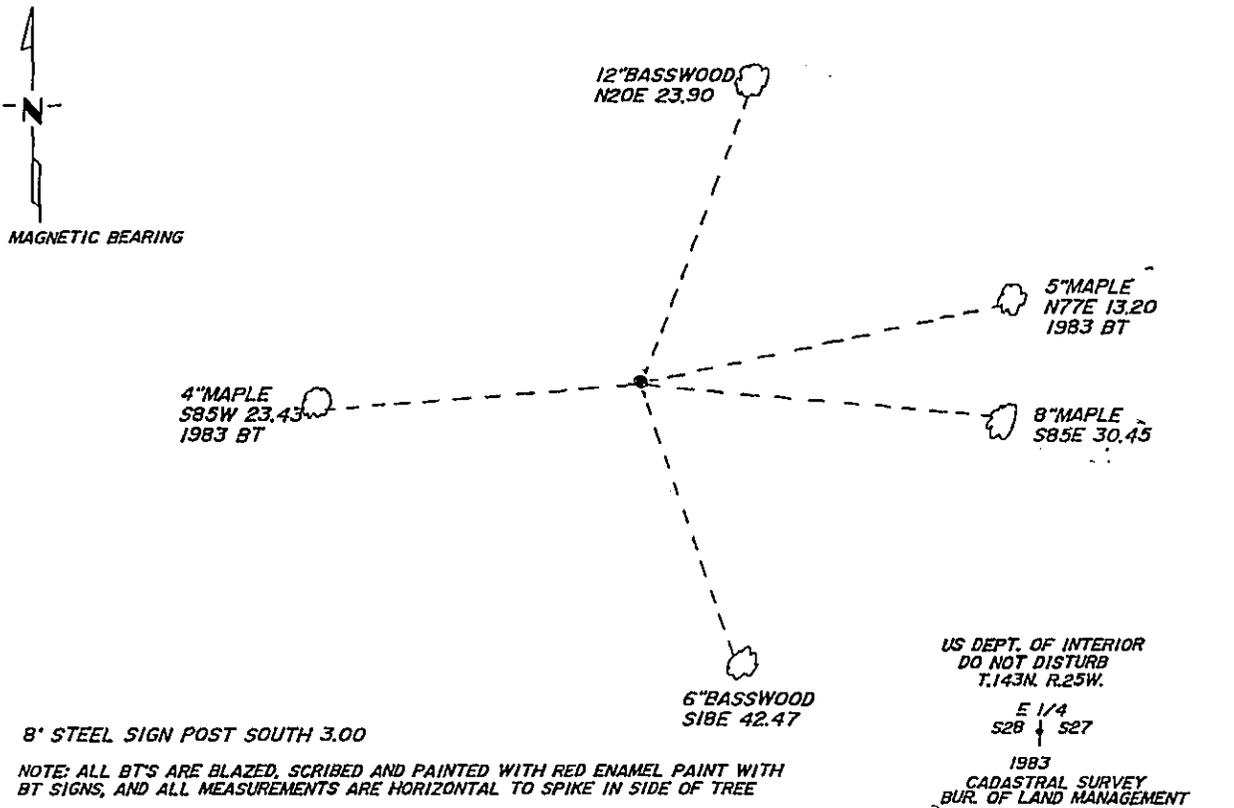

NOTE: ALL BT'S ARE BLAZED, SCRIBED AND PAINTED WITH RED ENAMEL PAINT WITH BT SIGNS, AND ALL MEASUREMENTS ARE HORIZONTAL TO SPIKE IN SIDE OF TREE

Statement of evidence relative to this corner location is on back of page. 326343

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Walter E. Laro 1-22-91  
SIGNATURE DATE

Registration No. 11395

- Land Surveyor
- County Surveyor

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:40 A. .M. on the 25 day of January A.D., 19 91

County Recorder Claudia Kogler  
By ms, Deputy

DOCUMENT NO. 326343

Statement of Evidence:

T-13 E 1/4 Cor. of Sec. 28, T. 143 N. R. 25 W.

1872 Original survey by Hayward and Griffin, set a wood post and marked bt's as follows:

8" Sugar	S67E	17 lks
6" Birch	S17E	16 lks

1925 Curo survey field book number 152, pages 56-57 show a traverse line (probably by J.H. Flynn) was run from the southeast corner of section 33 north. They tied to the meander corner on the south line of section 28 on the west shore of Sugar Lake, they continued north and searched for the meander corner on the east line of section 28, of which they found nothing. They continued north and found the original bearing tree for the east quarter corner of section 28 ( a dead 10" Sugar S67E 17lks ) and tied to a point for the corner. They didn't set a post or mark new bearing trees so it was not preserved. Due to the ambiguity of these field notes, it would be virtually impossible to restore any of these points to their original position. However, using their traverse information and applying it to the corners in place, the 1925 survey tends to support the position of the B.L.M. monuments.

1976 B.L.M. made a dependent resurvey of part of the township and found a 1" pipe of unknown origin and set a 2 1/2" x 28" aluminum pipe with cap in place of the 1" pipe for the northeast corner of sec. 28. From this point they go south on record bearing, the record distance and set a monument for the E 1/4 corner .

1979-1983 B.L.M. was made aware of a 1900 survey by the Corp. of engineers which gave a new position for the NE corner of the section. B.L.M. then made a corrective dependent resurvey and made a new determination for the location of the section line. They moved the monument to the newly computed position on this line. No evidence of the original corner was found.

1989 The USFS used this monument as part of a traverse around section 28.

1990 Walt Curo accepts the B.L.M. monument for the corner as this position was monumented and accepted by B.L.M. as the true position for this corner. No evidence remains for the original corner.