

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 33, Township 140, Range 27, 5th P.M.

STATE OF MINNESOTA, County of Cass


At the corner location shown on the sketch:

On 4/8/91 found a 2 inch square wood post up 12 inches
DATE

left monument as found, lowered monument, removed monument (explain)

On 4/9/91 placed a (2) 5' rods with 3' stabilizer and aluminum
DATE
cap inplace of wood post

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
 Not to Scale

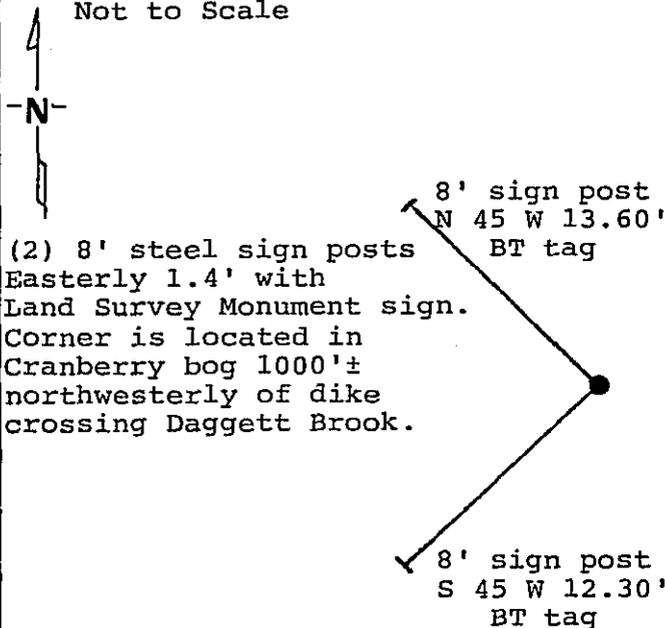

Statement of evidence relative to this corner location is on back of page. 329225

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[Signature] SIGNATURE 6/10/91 DATE

Registration No. 17008

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

OFFICE OF THE REGISTER OF DEEDS

County of Cass

I hereby certify that this document was filed in the Reg. of Deeds office at 3:50 P. M. on the 11 day of June A.D., 1991

Register of Deeds Claudia Kayler

By [Signature], Deputy

DOCUMENT NO. 329225

Northeast corner of Section 33, Township 140
North, Range 27 West, Cass County, Minnesota

V - 13

1873 Fendall G. Winston, U.S. Deputy Surveyor, originally established this corner position while subdividing Township 140 North, Range 27 West. The following bearing trees were marked: 14 inch Tamarack South 20 degrees 50 minutes East a distance of 49 links; a 5 inch Spruce South 51 degrees 20 minutes West a distance of 155 links; a 4 inch Spruce North 67 degrees 15 minutes West a distance of 182 links; and a 5 inch Spruce North 56 degrees 40 minutes East a distance of 177 links.

1938 Civilian Conservation Corps notes for Department of Natural Resources Washburn Lake Forestry Office Book 9, page 11. They found a 2 inch square Spruce stake in place.

1991 on April 8, a Landecker & Associates of Walker, Inc. survey crew found 2 inch squared post up 21 inches in bog as found by the Civilian Conservation Corps in 1938 as a perpetuation of the original corner position. No evidence remains of original bearing trees. Original distance calls to North and East to edge of bog fit very well. On April 9, they set (2) 5 foot aluminum rods with 3 foot stabilizer and stamped aluminum cap in place of wood post. No trees near for bearing trees. *Set sign posts as noted on front of this certificate.

NOTE: See subdivision map on Sheet 2 of 2 of STEVENS LAKE HOMESITES plat of record.