


CERTIFICATE OF LOCATION OF GOVERNMENT CORNERNortheast Corner of Section 26, Township 141, Range 27, 5th P.M.STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On 12/11/93 found a 2 inch by 5 foot galvanized steel pipe filled with concrete and capped with a 3 inch stamped brass tablet (tipped)
DATE
 left monument as found, ~~towered~~ monument, removed monument (explain) straightened
- On 12/11/93 placed a monument upright up 22 inches with an 8 foot steel sign post alongside.
DATE

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
Not to Scale

All distances are horizontal to nail in side of tree

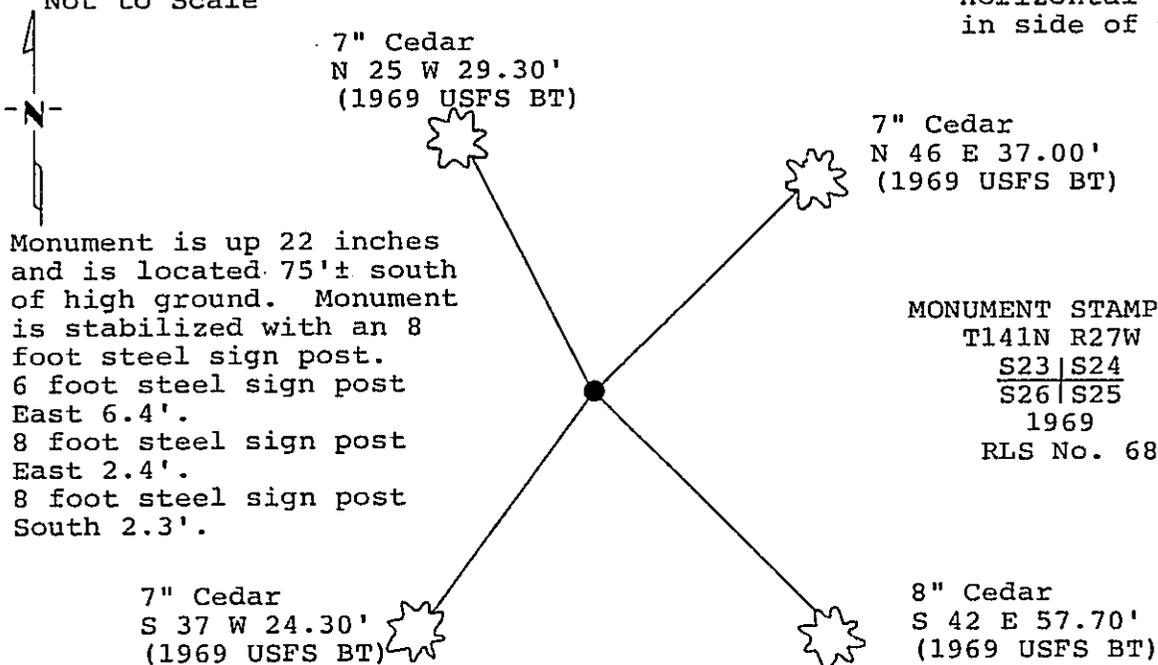

All bearing trees are scribed, painted with red enamel and marked with a 54-3 (bearing tree) tag.

Statement of evidence relative to this corner location is on back of page.

357309

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

Terry L. Freeman
 Terry L. Freeman
 Date 5/4/94 Registration No. 21367

OFFICE OF THE COUNTY RECORDER

County of CASS

I hereby certify that this document was filed in the Co. Recorders office at 9:50 A. M. on the 4th day of MAY A.D., 19 94

County Recorder Claudine KaylarBy N.B. MICROTIEM, DeputyDOCUMENT NO. 357309

Statement of Evidence:

Northeast corner, Section 26, Township 141 North,
Range 27 West, Cass County, Minnesota

R-21

1874 P.H. Conger, U.S. Deputy Surveyor, originally established this corner position while subdividing Township 141 North, Range 27 West. The notes indicate that he set a wood post and marked the following bearing trees: a 6 inch Cedar North 52 degrees West a distance of 14 links (9.24 feet); a 6 inch Cedar North 48 degrees East a distance of 24 links (15.84 feet); a 10 inch Cedar South 45 degrees East a distance of 30 links (19.80 feet); and an 8 inch Cedar South 45 degrees West a distance of 9 links (5.94 feet).

1920 Cass County Surveyor's Office Record Book "C", Page 378, shows a survey by Lincoln Mackey. The notes indicate that he found the original corner wood post and a 7 inch Cedar South 53 degrees East a distance of 18.5 feet. He marked the following new bearing trees: a 12 inch Cedar South 56 degrees 15 minutes East a distance of 41.3 feet; and a 4 inch Cedar North 28 degrees 15 minutes West a distance of 30.0 feet.

1940 Civilian Conservation Corps on Form 874 on file in the United States Forest Service office in Cass Lake, Minnesota, shows a survey by R.T. DeFant. The notes indicate that he found a pipe up 6 inches in good condition and marked the following bearing trees: a 6 inch Cedar South 40 degrees East a distance of 28 links (18.48 feet); and a 4 inch Cedar North 39 degrees West a distance of 42 links (27.72 feet). He placed a Forest Service Location Foster on a 4 inch Cedar South 30 degrees East a distance of 4 links (2.64 feet).

1969 United States Forest Service notes for Township 141 North, Range 27 West, on file in United States Forest Service office in Cass Lake, Minnesota, in Book 2, Page 10, show that United States Forest Service Technicians found a 2 inch capped pipe and the following bearing trees: a 12 inch Cedar South 56 degrees 15 minutes East a distance of 41.3 feet, now 16 inches; and a 4 inch Cedar North 28 degrees 15 minutes West a distance of 30 feet (downed). They set a 2 inch by 5 foot galvanized steel pipe filled with concrete and capped with a 3 inch stamped brass tablet and marked the following new bearing trees: a 6 inch Cedar North 46 degrees East a distance of 37.00 feet; a 6 inch Cedar North 25 degrees West a distance of 39.3 feet; a 6 inch Cedar South 37 degrees West a distance of 24.3 feet; and a 7 inch Cedar South 42 degrees East a distance of 57.7 feet. They also set a 6 foot steel sign post East a distance of 6.4 feet.

1971 William Okerman, Registered Land Surveyor Number 6807, filed an "Affidavit As To Location Of Government Corner" showing the 1969 United States Forest Service information.

1977 United States Forest Service notes for Township 141 North, Range 27 West, in Book 2, Page 10, show that United States Forest Service Technicians found the 1969 monument, bearing trees and sign post standing in good condition.

1993 December 11, a Landecker & Associates, Inc. survey crew found an iron pipe tipped. They reset the tipped monument from the four 1969 bearing trees: the 6 inch Cedar, now 7 inches, North 46 degrees East a distance of 37.00 feet; the 6 inch Cedar, now 7 inches, North 25 degrees West a distance of 29.30 feet; the 7 inch Cedar, now 8 inches, South 42 degrees East a distance of 57.70 feet; and the 6 inch Cedar, now 7 inches, South 37 degrees West a distance of 24.30 feet. The 1920 Southeast 12 inch Cedar is tipped out.

Landecker & Associates, Inc. accepts the monument as a perpetuation of the original corner.