
## CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Witness Corner to the Meander Corner on the east side of a peninsula of Upper Milton Lake, common to Sections 2 and 11, Township 142 North, Range 26 West, of the Fifth Principal Meridian, Cass County, Minnesota.

November, 1997, Northern Lights Surveying and Mapping Inc. witnessed the meander corner position (proportioned between the Section corner common to Sections 2, 3, 10, and 11 and a theoretical quarter corner common to Sections 2 and 11) with a brass capped monument.

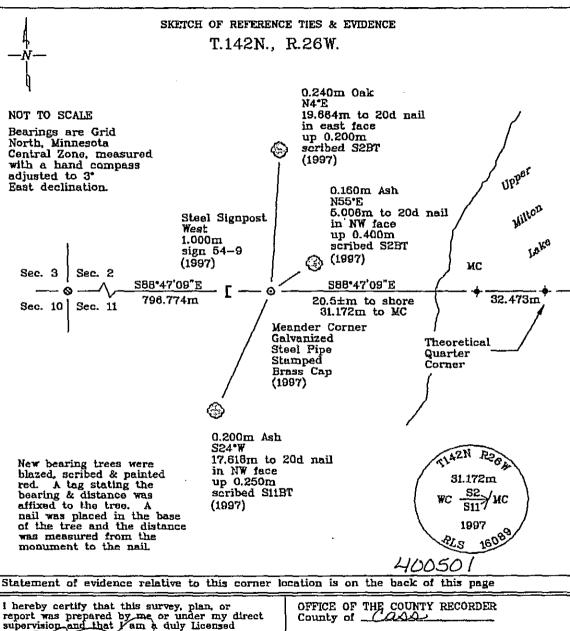

report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesote.

La∀erne Leuelling

Registered Land Surveyor No. 16089 NORTHERN LIGHTS SURVEYING & MAPPING I hereby certify that this document was filed in the Recorder's office.

Time: 1:50 P.M. Date: Glune 1st, 1998
Recorder Claudine Kaulor

Recorder Claudine Kariot

DOCUMENT NO. 400501

Statement of Evidence

Witness Corner to the Meander Corner on the east side of a peninsula of Upper Milton Lake, common to Sections 2 and 11, Township 142 North, Range 26 West, of the Fifth Principal Meridian, Cass County, Minnesota.

1871; General Land Office (G.L.O.) survey notes; Deputy Surveyor E.W. Griffin set a wooden post for the meander corner and referenced it with the following:

6" Tamarack (0.152m)

6" Tamarack (0.152m)

S79'W 20 Links (4.023m) N55°W 39 Links (7.846m)

Said records are on file with the Secretary of State, St. Paul, Minnesota; copies of these records are on file with the Cass County Surveyor's Office, Walker, Minnesota.

1979; United States Department of Agriculture - Forest Service (U.S.D.A.-F.S.) Field Book #3, p5: U.S.D.A.-F.S. crew conducted a search for the corner, but found no evidence. They noted an old beaver lodge near the area (Krause/Hayes).

July 18 1997; Northern Lights Surveying and Mapping, Inc. crew of Foster, Smith, and Gerving set a 1.219m long, 0.015m diameter galvanized steel pipe with a 0.083m diameter brass cap at the proportioned meander corner position between the Sastion corner common to Sections 2, 3, 10, and 11, and the meander corner common to Sections 2 and 11, up 0.240m, and established references (see note November 21, below).

November 21, 1997; Bob Ruuhela and Brian Johnson of Kovanen Surveying, Inc., at the behest of Northern Lights Surveying and Mapping, Inc. moved the above monument and changed its stamping to that of a witness corner, and obliterated the witness marked in July. The meander corner position was proportioned between the aforementioned southwest corner of Section 2 and at the theoretical quarter corner common to Sections 2 and 11. For a description of the methodology, refer to the corner certificate E-18,19 filed by Northern Lights Surveying and Mapping, Inc. The following references were established:

0.240m Oak N4°E 19.664m to 20d nail in east face up 0.200m scribed S2BT

0.160m Ash N55°E in NW face up 0.400m scribed S2BT

0.200m Ash S24°W 5.008m to 20d nail 17.618m to 20d nail in NW face up 0.250m

scribed S11BT

Steel Signpost West 1.000msign 54-9

Northern Lights Surveying and Mapping, Inc. Slater Township Field Book #2, p.41.

Coordinates:

Itasca County North

Northing = 67,493.011 meters Easting = 173,743.171 meters

State Plane Coordinate System Minnesota Central Zone NAD 83

Northing = 337,487.507 meters Easting = 823,870,786 meters

Latitude = 47°08'10.25922" North Longitude = 93°56'07.25022" West