
## CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter Corner, Section 36, Township 143 North, Range 27 West, of the Fifth Principal Meridian, Cass County, Minnesota.

November 20, 1998; Northern Lights Surveying and Mapping, Inc. set a brass capped Steel pipe in County Road 4 as a perpetuation of the original General Land Office corner

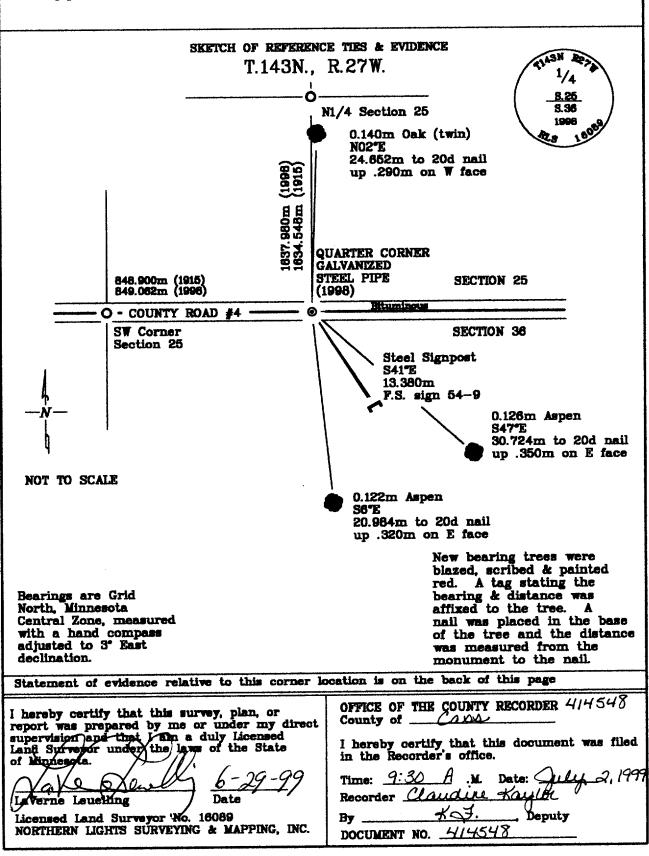

## Statement of Evidence

North Quarter Corner, Section 36, Township 143 North, Range 27 West, of the Fifth Principal Meridian, Cass County, Minnesota.

September, 1873; General Land Office (G.L.O.) survey notes; Deputy Surveyor William Allen set a wooden post and referenced it with the following:

10" (0.254m) Elm 6" (0.152m) Birch N6"W S66"W 14 Links (2.816m) 13 Links (2.615m)

Said records are on file with the Secretary of State, St. Paul, Minnesota. Copies of these records are on file with the Cass County Surveyor's Office, Walker, Minnesota.

February, 1915; Cass County Survey Record #328, Book "B", pp.456-482; Curo and Donner found the G.L.O. birch down with a scribe visible; they set a 80d spike for the corner and referenced it with the following:

8" (0.203m) Birch 16" (0.406m) Birch 10" (0.254m) White Pine Stump N69"35'W S50"15'E N51"E 15.80 Feet (5.816m) 55.05 feet (16.780m) 52.35 Feet (15.956m)

Their distance to the N1/4 of Section 25 was 5362.68 feet (1634.548m) and their distance to the Southwest corner of Section 25 was 2765.10 feet (848.900m).

October, 1969; United States Department of Agriculture - Forest Service (U.S.D.A.-F.S.) Field Book #1, p. 5; Curt Krause searched for a half hour, but found no evidence of the corner or its witnesses.

August, 1997; U.S.D.A.-F.S. Field Book #1, p. 5; Rob Main and Curt Krause occuppied a pin at the intersection of the centerline of County Road #4 and an old fence line running north, and used it as a resource grade GPS position.

September 1998: Northern Lights Surveying & Mapping, Inc. crew of Heinle & Carlson occupied the 1997 USDA-FS pin with GPS and defined it's position.

November, 1998; Northern Lights Surveying and Mapping, Inc., and Cass County crews excavated a 4'x 20' search area 1 1/2' down to natural soil. Nothing was found.

November 20, 1998; NLSM crew of Heinle and Carlson returned to site and set a 0.015m diameter galvanized steel pipe 0.610m long, with a brass cap, below the bituminous for the quarter corner. The following references were then established:

 0.126m Aspen
 0.122m Aspen
 0.140m Oak (twin)

 S47E
 S6E
 N02E

 30.724m to 20d nail
 20.984m to 20d nail
 24.652m to 20d nail

 up .350m on E face
 up .320m on E face
 up .290m on W face

Steel Signpost S41°E 13.380m F.S. sign 54-9

The corner was set to reproduce the position tied into by Donner & Curo in the 1915 Cass County road survey. The resultant corner was 849.062 meters east of the SW of Section 25 and 1637.920 meters south of the N1/4 of Section 25.

Northern Lights Surveying and Mapping, Inc., Boy River Township Field Book #4, p. 20. This certificate corrects Document #412865 Coordinates:

Cass County North

Northing = 70943.630 meters Easting = 165803.167 meters State Plane Coordinate System Minnesota Central Zone NAD 83

Northing = 340934.951 meters Easting = 815929.739 meters

Latitude = 47"10'02.74197" North Longitude = 94"02'23.64306" West