

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

MC #1 _____ of Section 30, Township 146 N., Range 29 W., 5th P.M.
State of Minnesota, County of Cass

At the corner location shown on the sketch:


On 03-16-2011 found a 1" iron pipe with a brass cap, 20" above surface grade,
leaning southerly 15 degrees, located pipe at surface grade.

left monument as found lowered monument removed monument (explain)

On _____ placed _____



SKETCH OF REFERENCE TIES (NOT TO SCALE)

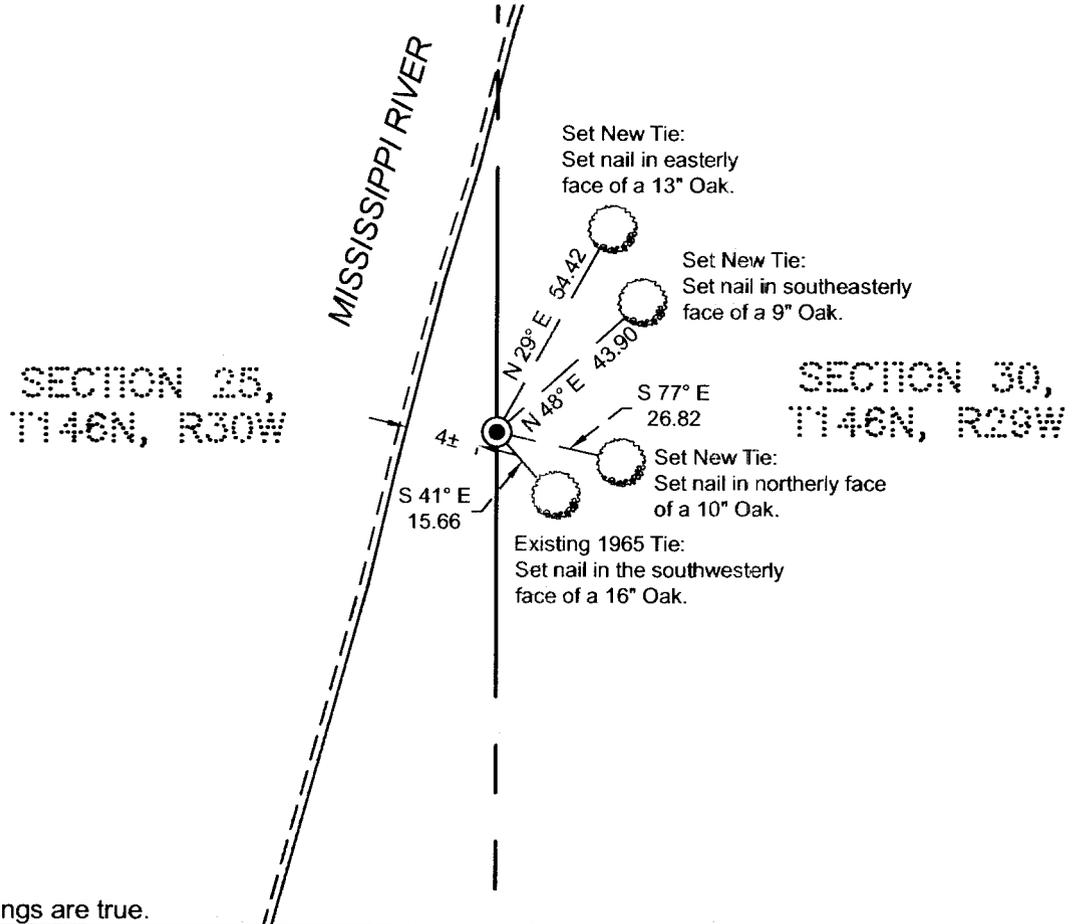

NOTE: All bearings are true.

Statement of evidence relative to this corner location is on the back of this page.

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed land Surveyor under the laws of the State of Minnesota. I further certify that this United States public land survey monument record is correct and complete to the best of my knowledge and belief.

Terry L. Freeman, Land Surveyor

Date 12/9/11

MN License No. 21367

A000578271
OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON
03/01/2012 2:29:07 PM
AS DOC #: A000578271
PAGES: 2 REC FEES: 0.00
KATHRYN M. NORBY
COUNTY RECORDER

Index No. R2 - 1.0

STATEMENT ON EVIDENCE

Meander Corner #1 of Section 30, Township 146 North, Range 29 West of the 5th Principal Meridian.

In **1873**, P.H. Conger, U.S. Deputy Surveyor, set a wood post in place to mark the location of this corner and established bearing trees as follows: a 14" Burr Oak, S19°E 37 links; a 3" Birch, S31°W 15 links.

In **1933**, H. Craig, United States Cadastral Engineer, made a dependent resurvey of Section 25, T146N, R30W., and found no remains of the original monument or BTs. He set a 1" x 36" iron pipe with a brass cap, and established two new bearing trees as follows: a 3" Burr Oak, N74-3/4°E, 11 links; a 16" Burr Oak, S5-3/4°W, 105 links. (Running notes on file in Cass County Survey Department)

On **November 03, 1965**, J. Ekstrom, a U.S. Forest Surveyor, found the 1" iron pipe with brass cap in place, up 14", 4 feet from the river bank. He also found the bearing trees as recorded by Craig in 1933: a 10" Oak N75°E, 7.25; a 20" Oak S6°W, 69.3'. He recordered two new bearing trees: a 6" Oak N84°E, 5.6; a 10" Oak S41°E, 15.7'. Notes on file in the USFS Cass Lake office in T146N-R30W Book 1, Page 24.

On **March 16, 2011**, a Northern Engineering & Consulting survey crew found a 1" iron pipe, 20" above surface grade, leaning southerly 15 degrees. They located the iron pipe at surface grade. One existing tie was found and three new ties were set as shown on the front of this certificate. Brass cap monument is accepted as the corner position as set in 1933 by the GLO.

Minnesota State Plane (Central Zone)

Northing 1218775.833
Easting 2583519.119

County Coordinates (Cass County North)

Northing 333018.881
Easting 450604.465

