

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter corner of Section 06, Township 145 N., Range 29 W., 5th P.M.
State of Minnesota, County of Cass

At the corner location shown on the sketch:

On 03-25-2011 found a 2" iron pipe with a 2.5" diameter GLO brass cap, leaning 45 degrees
northerly flush with the surface grade, located where it would be if straightened.

left monument as found lowered monument removed monument (explain)



On _____ placed _____



SKETCH OF REFERENCE TIES (NOT TO SCALE)



SECTION 31,
T146N, R29W

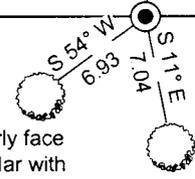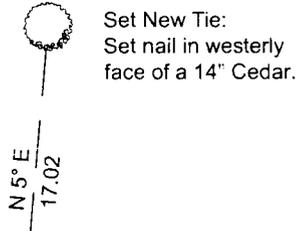

Existing 1935 Tie:
Set nail in southerly face
of a 10" dead Cedar with
an existing BT tag.

Set New Tie:
Set nail in easterly
face of a 9" Cedar.

SECTION 6,
T145N, R29W

NOTE: All bearings are true.

Statement of evidence relative to this corner location is on the back of this page.

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed land Surveyor under the laws of the State of Minnesota. I further certify that this United States public land survey monument record is correct and complete to the best of my knowledge and belief.

Terry L. Freeman, Land Surveyor

Date 2/28/12 MN License No. 21367

A000578279
OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON
03/01/2012 2:29:15 PM
AS DOC #: A000578279
PAGES: 2 REC FEES: 0.00
KATHRYN M. NORBY
COUNTY RECORDER

Index No. A.0 - 3.0

STATEMENT ON EVIDENCE

North Quarter Corner of Section 06, Township 145 North, Range 29 West of the 5th Principal Meridian.

In 1873, P.H. Conger, U.S. Deputy Surveyor, set the original wood post and bearing trees as follows: a 6" Tamarack, N54°E 4 links; a 5" Tamarack, S40°W 9 links.

1900 and 1903, U.S. Army Corp of Engineers maps for the Leech Lake and Lake Winnibigoshish Reservoirs show corner found by surveyors T. Milton Fowble, Horace Dunaway, and W.C. Lemen.

In 1935, H. Craig and A. Berger, United States Cadastral Engineers, found remains of the 2 original BTs: a 8" Tamarack stub, N54 1/2°E 4 links; a Tamarack stump (rotten), S37 3/4°W 9 links. He set a 2" x 36" iron post with a brass cap, and established new BTs as follows: a 8" Tamarack, N22 1/2°E 60 links; a 5" Cedar, S54 1/2°W 10 1/2 links.

On March 25, 2011, a Northern Engineering & Consulting survey crew found a 2" iron pipe with a 2.5" diameter GLO brass cap, leaning 45 degrees northerly flush with the surface grade. They dug down along the pipe and located it's position where it would be if straightened up. One existing tie was found and two new ties were set as shown on the front of this certificate. The brass cap is accepted as a perpetuation of the original corner.

Minnesota State Plane (Central Zone)

Northing 1208025.210
Easting 2586358.487

County Coordinates (Cass County North)

Northing 322267.280
Easting 453438.888