



8 0 3 7 2 7 7

Tx:4026798

A000581281

**OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON**

06/12/2012 11:25:19 AM

AS DOC #: A000581281

PAGES: 2 REC FEES: 0.00

**KATHRYN M. NORBY
COUNTY RECORDER**

Index No. J-1

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHWEST Corner of Section 18, Township 135, Range 32
5TH Principal Meridian, State of Minnesota, County of CASS

At the corner location shown on the sketch:

On _____ found a _____
DATE

left monument as found, lowered monument, removed monument (explain)

On 4/10/12 Placed a 1" X 48" IRON PIPE WITH PLASTIC CAP STAMPED "MN DNR LS 47461"
DATE
UP 1.5' ON NORTH-SOUTH FENCE LINE AND EASTERLY EXTENSION OF FENCE WEST

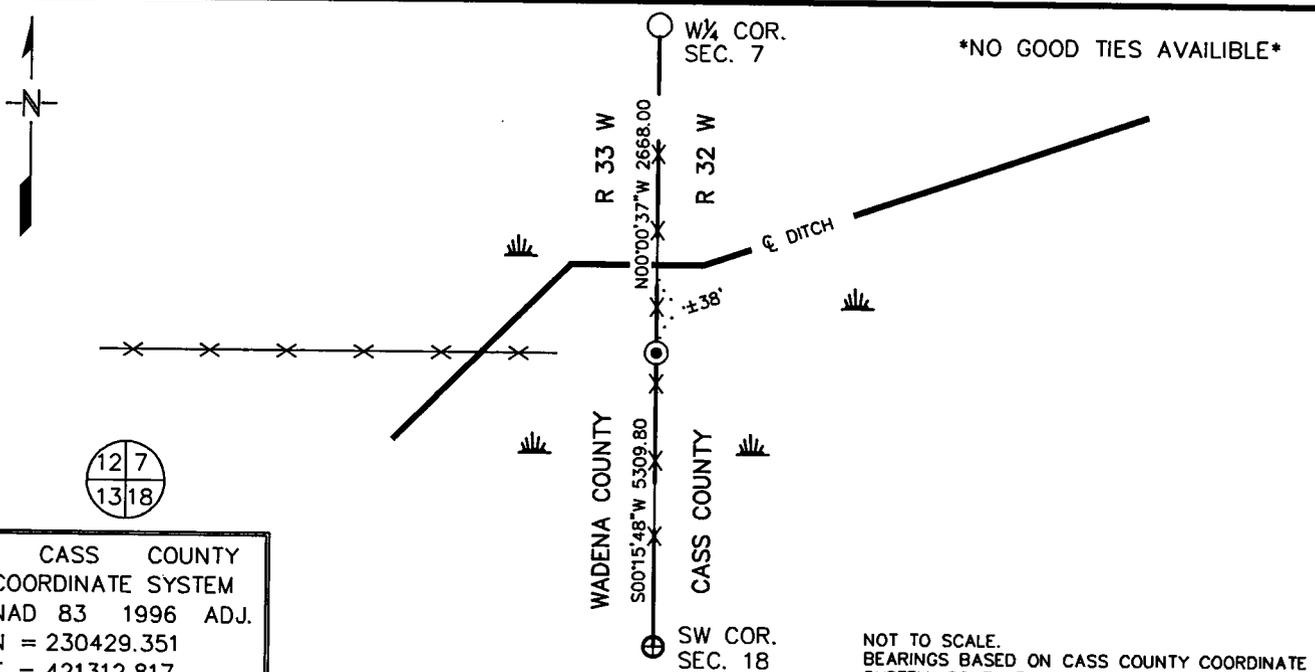

NO GOOD TIES AVAILABLE



CASS COUNTY
COORDINATE SYSTEM
NAD 83 1996 ADJ.
N = 230429.351
E = 421312.817

NOT TO SCALE.
BEARINGS BASED ON CASS COUNTY COORDINATE
SYSTEM, SOUTH ZONE, NAD83, 1996 ADJUSTMENT.

Statement of evidence for this corner location is on back of this page.

RAL APRIL 2012
WMA01870.00.00.01

I certify that this document was researched and prepared by me or under my direct supervision.

SIGNATURE [Signature] DATE 5/15/12 License Number 47461

Title: Land Surveyor County Surveyor

PAGE 1 OF 2 PAGES

STATEMENT OF EVIDENCE**Northwest Corner of Section 18, Township 135 North, Range 32 West, 5th P.M.**

The Department of Natural Resources, Division of Lands and Minerals, contacted the following offices for information regarding this corner:

MN History Center
 Wadena County Highway Department
 Cass County Surveyor
 Wadena County Recorder
 Nyberg Surveying

1858 The US General Land Office field notes, on file at the History Center, show this corner to be marked with a post and the following bearing trees:

| | | |
|------------|----------|----------------------|
| Y Pine 18" | S 6 ½° W | 8.65 chains (570.9') |
| Y Pine 18" | S ¾° E | 8.25 chains (544.5') |

Circa

1900 Judicial Ditch No. 7 map found at the Cass County Surveyor's Office shows a bend in the ditch at the county line with the corner being south of the ditch.

1924 Wadena County Highway Department plan for Cass-Wadena judicial road list this section corner as station 53+32 and the East Quarter Corner of Section 12 as station as 26+64. No stationing is given for the east line of Section 13. Unspecified ties are shown 42.43' southeast and southwest.

2001 In June, the Department of Natural Resources survey crew searched for evidence of Government corners along the township line during survey work for the Dry Sand Lake Wildlife Management Area. The northeast corner of Section 1 and northeast corner of Section 24 were located.

2012 In March, the DNR survey crew searched for evidence of the corner and located an old north-south fence, a northeast-southwest ditch, and an old downed east-west fence line to the west. A temporary corner position was computed at a distance of 2668.00 feet southerly of the quarter corner common to Sections 7 and 12 per the 1924 judicial road survey and on the north-south fence line. After analysis, it was determined that the temporary position for the corner was on line with the easterly extension of the fence line west and was accepted as the original corner location. In April, the DNR survey crew placed an iron monument at the corner as shown on the face of this document. The following measurements were taken:

| | | |
|---|-------------|----------|
| North Quarter Corner of Section 18 bears | S89°01'26"E | 2133.34' |
| West Quarter Corner of Section 7 bears | N00°00'37"W | 2668.00' |
| Southwest Corner of Section 18 bears | S00°15'48"W | 5309.80' |
| Northwest Corner of Section 13, T135, R33 bears | N89°52'57"W | 5397.26' |

For information on our survey in this area, please contact the MN DNR, Division of Lands and Minerals, Survey Section, 1601 Minnesota Drive, Brainerd, MN 56401