

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter corner of Section 9, Township 133 N., Range 29 W., 5th P.M.

State of Minnesota, County of Cass


At the corner location shown on the sketch:

On 1 Aug. 2008 found a 1.25 inch outside diameter iron pipe, down 0.2 foot,  
at edge of bituminous driveway, 3 feet± west and 2 feet± north of centerline Pl.

left monument as found     lowered monument     removed monument (explain)

On \_\_\_\_\_ placed \_\_\_\_\_

Page 1 of 2    A000594823

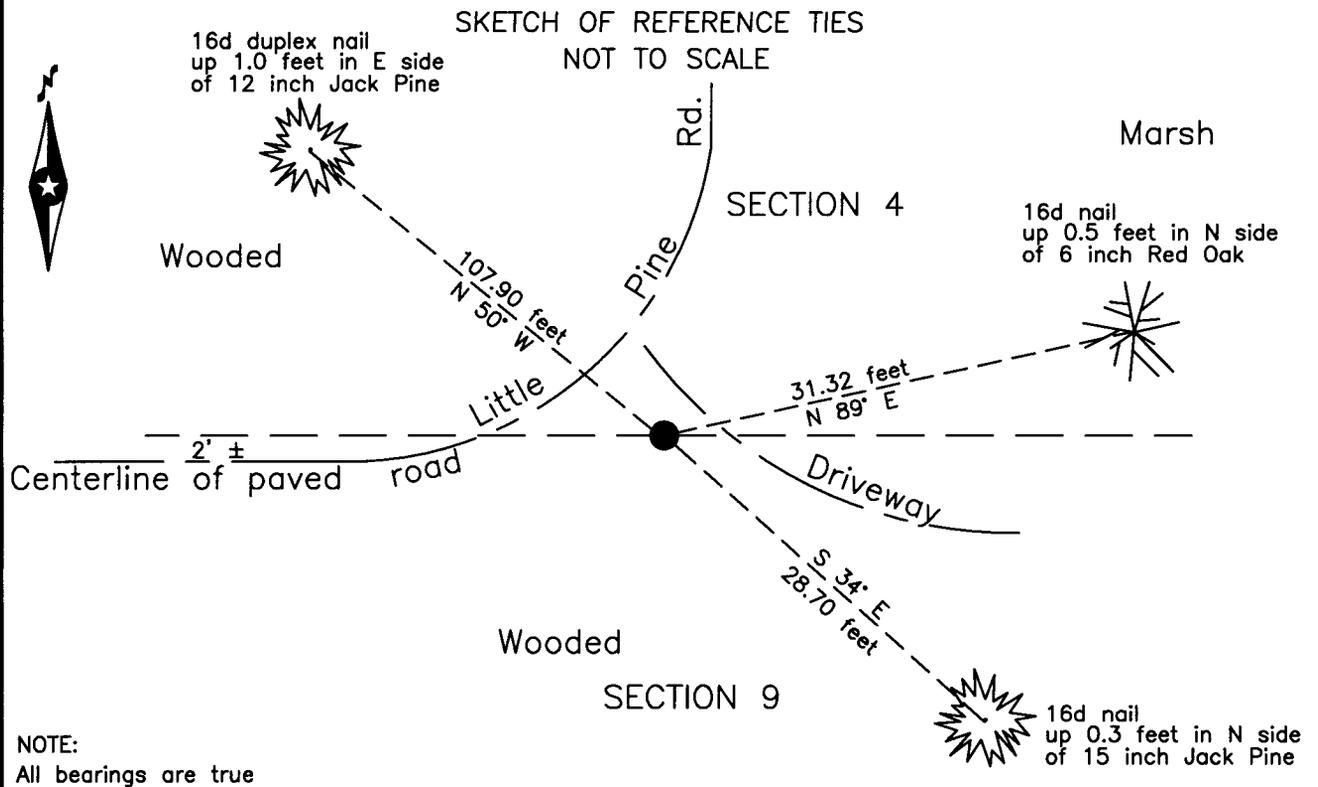

Statement of evidence relative to this corner location is on the back of this page.

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

I further certify that this United States public land survey monument record is correct and complete to the best of my knowledge and belief.

*Terry L. Freeman*

Terry L. Freeman, Cass County Surveyor

Date 7/24/13 MN License No. 21367



**A000594823**

**OFFICE OF THE COUNTY RECORDER  
 CASS COUNTY, MINNESOTA  
 CERTIFIED, FILED, AND/OR  
 RECORDED ON**

**7/25/2013 3:07:38 PM**

**AS DOC #: A000594823**

**PAGES: 2**

**REC FEES: 0.00**

**KATHRYN M. NORBY  
 CASS COUNTY RECORDER**

BY SR Dep



**Index No. 13329E.0-11.0**

Statement of Evidence

**North Quarter corner Section 9, Township 133 North, Range 29 West, 5th Principal Meridian.**

- Oct. 1870 Walker, Allen & Putnam, General Land Office (GLO) Deputy Surveyors in the subdivision of this township set a post for the original corner which was referenced as follows:  
10" Black Pine S 8° E 100 lks (66.00 feet) 8" Black Pine S 11° E 98 lks (64.68 feet)  
Said records are on file with the Secretary of State, St. Paul, Minnesota, copies are filed with the Cass County Surveyor's Office (CCSO).
  
- June 1922 E.B.Horst, Deputy County Surveyor, Curo Book 153, page 81, on file in the CCSO, township road survey, set a ¾" x 24" iron pipe.
  
- 1925 Minnesota Power & Light Co., Sylvan – Pillager H.E Development, Land and Flowage Survey, on file in the CCSO, by symbol indicates the subject corner to be existing.
  
- May 1926 J.M. Greene, County Surveyor, County Record Book of Survey D, No.544, page 175, on file in the CCSO, survey for Anderson Cartway, Sylvan Township, states "We then go to the south ¼ cor. Sec. 4 and run north on line".
  
- June 2001 B.Hippen, technician, CCSO, notes on file in the CCSO, found a 1.25" outside diameter iron pipe, flush, 3 feet, more or less, west of centerline of Little Pine Road to north and 2 feet, more or less, north of centerline of Little Pine Road to west and witnessed as follows:  
12" J. Pine N 50° W 107.90 feet 15" J. Pine S 34° E 28.70 feet  
6" R. Oak N 89° E 31.32 feet
  
- April 2002 J.W. Nielsen, LS 11865, Certificate of Survey, a copy on file in the CCSO, indicates a monument found.
  
- May 2004 J.W. Nielsen, LS 11865, Certificate of Survey, a copy on file in the CCSO, indicates a monument found.
  
- Aug. 2008 B.Hippen, technician, CCSO, notes on file in the CCSO, found a 1.25" outside diameter iron pipe, down 0.2 foot, at edge of bituminous driveway, 3 feet, more or less, west of centerline of Little Pine Road to north and located with Global Positioning System.
  
- July 2013 B.Hippen, technician, CCSO, records of the CCSO, found monument and witnesses from 2008. The monument together with the recovered and established references for the position are shown on the face of this document.

Analysis of the recovered record data, field evidence and survey measurements, indicates that the position recovered and witnessed by the CCSO in 2001 is the accepted location of this corner.