



## A000615454


OFFICE OF THE COUNTY RECORDER CASS COUNTY, MINNESOTA CERTIFIED, FILED, AND/OR RECORDED ON

9/17/2015 10:38:58 AM

AS DOC #: A000615454 PAGES: 2 REC FEES: 0.00

KATHRYN M. NORBY CASS COUNTY RECORDER

BY\_SR\_\_\_Dep TX#: 125756

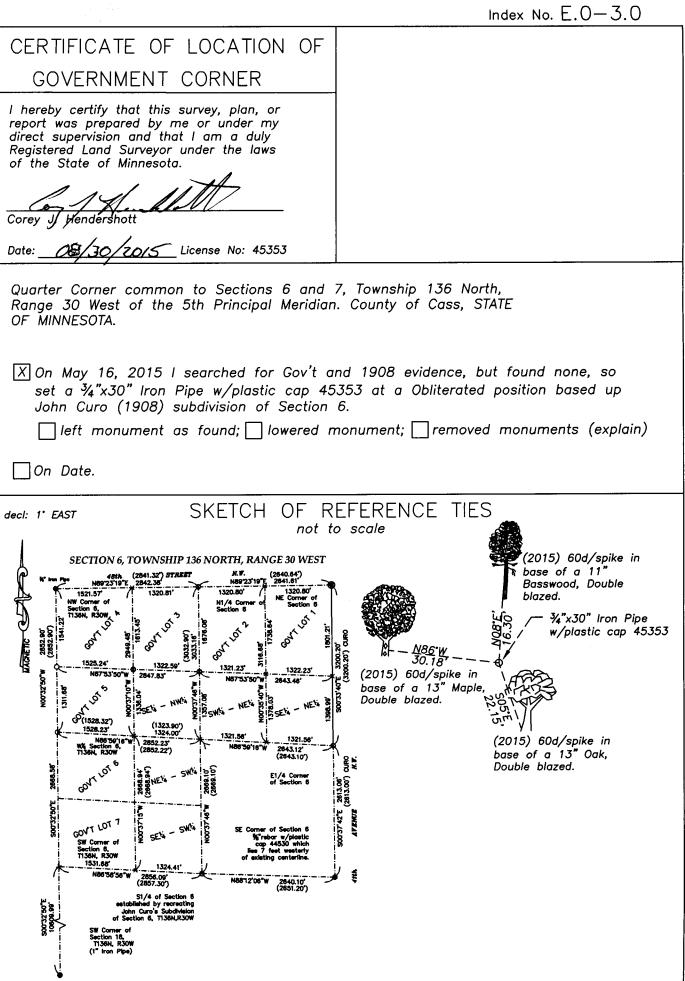

Statement of evidence for this corner position is on the back of this page



A000615454

E.0-3.0

**STATEMENT OF EVIDENCE**: Quarter Corner common to Sections 6 and 7, Township 136 North, Range 30 West, of the 5th Principal Meridian.

1870; This corner was originally established by Richard Cronk, Deputy Surveyor under contract to the General Land Office (GLO), now the Bureau of Land Management (BLM). A copy of the plat of this township and hand copied field notes are on file in the Cass County Surveyor's Office. These Field notes indicate a wood post was set to mark this corner position, which was witnessed by:

W. Birch, 8", N50°E, 25 lks., 16.50 feet; W. Birch, 9", S10°E, 12 lks., 7.92 feet:

1908; (Dec.) Cass County Survey Record Book "B", Pages 140 – 157, these note states that John W. Curo, Licensed Surveyor. While performing a Subdivision 6 for a private party, John W. Curo recovers both Government BT Birches still standing and set a new post. This corner position was witnessed by the following:

Gov't, W. Birch, 8", N50°E, 25 lks., 16.50 feet; Gov't, W. Birch, 9", S10°E, 12 lks., 7.92 feet:

1908; (Dec.) Curo's Field Book 85, page 260. These note states the same information as what is stated in the County Survey Record "B", pages 140-157, notes.

1911; Township Road Order show no survey.

2014; (Nov) I Corey J. Hendershott, L.S. 45353, Eagle Eye Data Services search for 1.5 hours for the remains of the Gov't Birches and John W. Curo's 1908 post with no luck. So I set a 3/4"x 30" Iron Pipe with plastic cap 45353 at an "Obliterated Position", at John W. Curo's record distance of 5702.00 feet southerly on the N-S Quarter line of Section 6 for Latitudinal control and using the previously established West and East Quarter corner of Section 6 for Longitudinal control. This corner position was witnessed as shown on the face of this document.

I feel this is best method of reestablishing the GLO position.

Cass County South Zone N 267501.751 E 489418.281