



A000618374

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

12/24/2015 10:45:45 AM

AS DOC #: A000618374

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY MW Dep TX#: 128046

Page 1 of 2 A000618374

Twp 142 Rge 26 Index No. N.0-09.0

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


Northeast corner of Section 20, Township 142 N., Range 26 W., 5th P.M.
State of Minnesota, County of Cass

At the corner location shown on the sketch:

On 2 June 2015 found a square vertical area of peat in blue clay, down 3 feet,
9 feet east of edge of bituminous County Road #4.

left monument as found lowered monument removed monument (explain)

On 13 Nov 2015 placed a 1 inch by 30 inch aluminum tube with aluminum cap,
down 0.3 foot, 21± feet east of new centerline County Road #4.

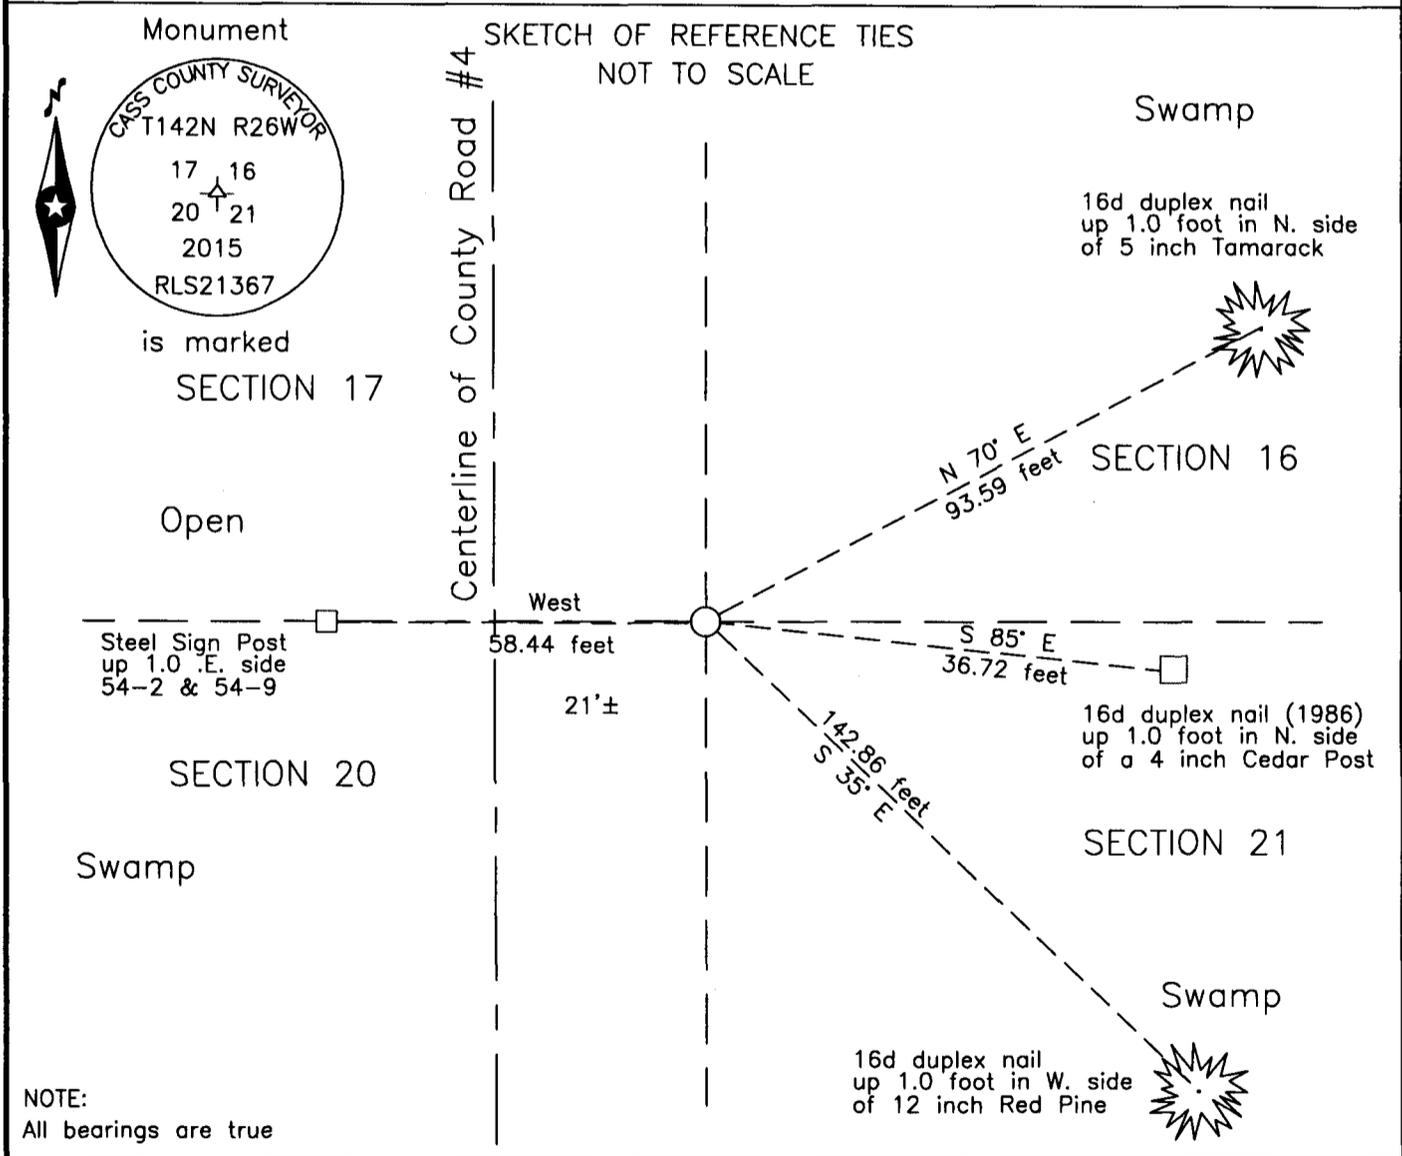

Statement of evidence relative to this corner location is on the back of this page.

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

Terry L. Freeman, Cass County Surveyor
Date 12/23/15 MN License No. 21367



Index No. N.0-09.0

Statement of Evidence

Northeast corner of Section 20, Township 142 North, Range 26 West, 5th Principal Meridian.

- Nov. 1872 Eli W. Griffin, General Land Office (GLO) Deputy Surveyor, in the notes of the subdivision of Township 142 North, Range 26 West, set a post for the original corner and referenced it as follows:

3" Tamarack	S 61° E	11 links (7.26 feet)	4" Tamarack	S 3° W	19 links(12.54 feet)
5" Tamarack	N 12° W	6 links (3.96 feet)	3" Tamarack	N 66° E	48 links(31.68 feet)

The above record is on file with the Minnesota Historical Society in St. Paul, Minnesota, copies are filed with the Cass County Highway Department, Surveyor's Office (CCHD/SO).
- Feb. 1935 O.G. Fuanrud, Engineer, Civilian Conservation Corp. (CCC), Form 874-9, on file at the U.S. Department of Agriculture Forest Service, (USFS) Cass Lake Office, found a 3"x 3" Tam. Post, 24" above ground, solid. The form indicates he believes this to be a county corner. He notes a fence corner 4.08 chains (269.28 feet) west of the subject corner. Post on E, W. fence line, Road 4.08 chains (269.28 feet) west of post.
- March 1958 D. Cole, LS 1286, Cass County Engineer, County State Aid Highway No. 4 (CSAH #4), State Project No.11-617-01, plan on file in the CCHD, indicates the subject corner to be assumed on centerline P.O.T. Station 330+36. The road profile at this location indicates the proposed new grade to be close to 2 feet higher than existing ground which would have been swamp.
- June 1966 J. Ekstrom, USFS, Township Book #1, page 40, on file at the USFS Cass Lake Office, states "No evidence of orig. corner found. Blue line runs east from where I figure cor should be."
- Dec. 1976 C. Krause, USFS, Township Book #1, page 40, on file at the USFS Cass Lake Office, states "Found F.S. poster from which corner is 4.36 chs. (287.8') East – Corner falls on E. shoulder 10+,- from bituminous mat." Also states "Fd. Old fence line run west from County Road #4 Found 8" post on East side of old Road with FSLP marked East 4.36 CHS. – 287.76' – to Sec. Cor. Placed 4x 4 post 58' from center of County Rd #4 with FSLP."
- 1982 Land Corner Record, records of the CCHD/SO, indicates CCHD Surveyor found nothing at the subject corner and no B.T. in place.
- March 2004 B. Hippen, technician, records of the CCHD/SO, made a Global Positioning System (GPS) observation at a position 38 feet west of USFS location post which is 20 feet, more or less East of the center line of CSAH #4.
- May 2013 B. Hippen, technician, records of the CCHD/SO, found Forest Service location poster, as noted in USFS 1976 notes, 287 feet west, badly rusted, buried 0.1 foot, with remains of charred post, made a GPS observation at poster and post by USFS in 1976.
- June 2015 B. Hippen, technician and P. Swentkofske, CCHD equipment operator, records of the CCHD/SO, prior to reconstruction of CSAH #4, excavated a 6 foot east-west by 10 foot north-south area based on record dimensions from recovered posts. The dig was 3 feet deep to peat soil. A square, vertical hole, of peat, in blue clay layer, agrees very well with distances from recovered posts.
- Nov. 2015 B. Hippen, technician, records of the CCHD/SO, set a 1 inch diameter aluminum tube with aluminum cap, at the square, vertical hole, of peat, in blue clay layer, position, down 0.3 feet, 21 feet, more or less, east of the new centerline of CSAH #4 and witnessed as follows:

5" Tamarack	N 70° E	93.59 feet	4" Post	S 85° E	36.72 feet
12" Red Pine	S 35° E	142.86 feet	Steel Sign Post	West	58.44 feet

The recovered and established references for the position are shown on the face of this document.

Analysis of the recovered record data, field evidence and survey measurements, indicates that the monument set in 2015 by the CCHD/SO, is the correct perpetuation of this corner.

County Coordinates (Cass County North)

Northing 210764.35

Easting 557251.99