



A000652985

OFFICE OF THE COUNTY RECORDER  
CASS COUNTY, MINNESOTA  
CERTIFIED, FILED, AND/OR  
RECORDED ON

9/4/2019 10:45:01 AM

AS DOC #: A000652985

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY  
CASS COUNTY RECORDER

BY NG Dep TX#: 156113

Page 1 of 2  
A000652985


### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 8, Township 142 N, Range 25 W, 5th P.M.  
County of Cass, State of Minnesota

At the corner location shown on the sketch :

- On \_\_\_\_\_ found \_\_\_\_\_
- left monument as found     lowered monument     removed monument (explain)
- On June 19, 2019 set 2.5" x 60" concrete-filled iron pipe with flared end  
and 3.25" bronze cap stamped as shown, top 1.6' above ground level.

#### SKETCH OF REFERENCE TIES (NOT TO SCALE)

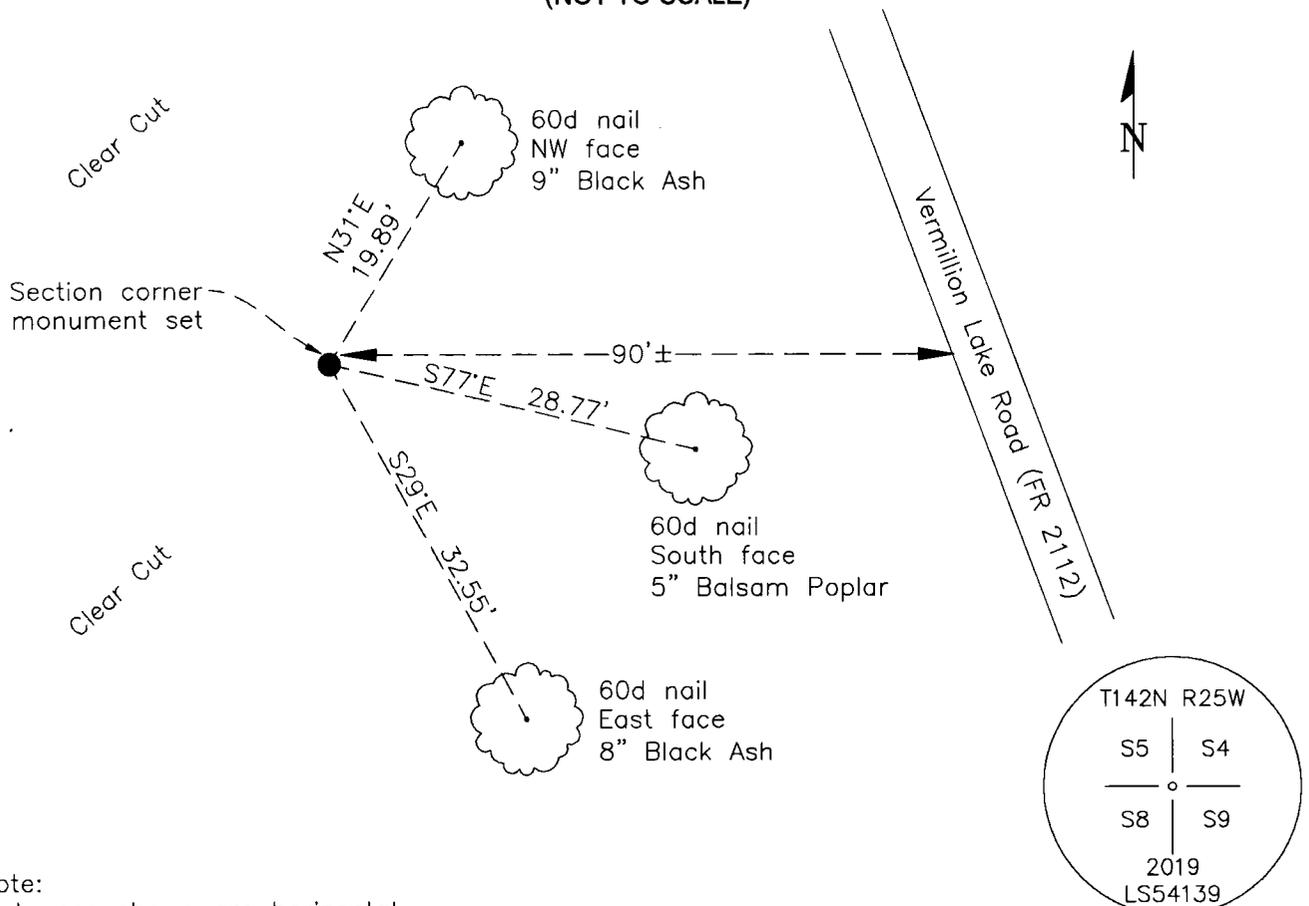

Note:  
Distances shown are horizontal  
Bearings shown are geodetic

Cap Stamping Detail

Statement of evidence relative to this corner location is on the back of this page

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the state of Minnesota.

Aaron J. Skattum  
MN License No. 54139

7/18/2019  
Date

Cass County Coordinates  
(North Zone, 2011 Adj.)  
N: 221,551.161  
E: 588,928.428

GCDB ID No. 300600  
Corner Index No. E.0-9.0



Corner Index No. E.0-9.0

**STATEMENT OF EVIDENCE**

Northeast Corner of Sec. 8, T.142N., R.25W., 5th P.M., Cass County, MN

1871 W.P. Allen & E.P. Putnam, U.S. General Land Office, originally established this corner while surveying the subdivision lines of this township, and set wood post to mark the corner position with the following witnesses:

10" Birch	S60°W	28 links	(18.48')
10" Tamarack	N53°W	35 links	(23.10')
6" Tamarack	S53°E	27 links	(17.82')
10" Spruce	N51°E	31 links	(20.46')

Information on file at the MN Historical Society, St. Paul, MN. Copies filed with the Cass County Highway Department/Surveyors Office (CCHD/SO)

1922 J.H. Flynn, County Surveyor, County Survey Record Book D, Page 52, and Curo Book 152, Page 170, set 1.5"x44" iron flue pipe from remains of GLO bearing trees. The following ties were noted:

Birch	S60°W	18.48'	GLO BT (stub)
Tamarack	S53°E	17.82'	GLO BT (down)
4" Rim Ash	N85°E	40'	new BT
12" Black Ash	S37°E	38.5'	new BT
Balm of Gilead	S62°W	47'	new BT

Information on file at CCHD/SO

1936 A.H. Jager, chief of party, U.S. Forest Service, (Form 874-9, USFS records) found cedar post in poor condition, 30" above the ground in fair condition, believed to be a county corner. No mention was made of the 1922 Flynn monument. A metal location poster (FSLP) was placed on NW side of snag as noted:

Elm snag	S36°E	0.58 chains	
----------	-------	-------------	--

USFS records cited herein are on file at the Chippewa National Forest Supervisor's Office

1963 W. Okerman, U.S. Forest Service, (Corner Restoration Book 1, Page 9, USFS records) attempted to locate corner by chaining south from approximate 1/4 corner location, but noted that all evidence appeared to be destroyed, and existing trees were not old enough to trace back to the Flynn survey.

1993 R. Main & C. Krause, U.S. Forest Service (Corner Restoration Book 1, Page 9, USFS records) searched the area and found no evidence of any previous survey.

2019 A. Skattum, U.S. Forest Service, (Land Line Book 30, Page 72, USFS records) found no existing monument and no evidence of previous bearing trees. The corner position was determined longitudinally on a line between E1/4 corner Sec. 5 and E1/4 corner Sec. 8 (being perpetuations of Flynn's survey), and latitudinally by measuring south 2,617' from the E1/4 corner of Sec. 5, per Flynn's survey. Established the following references:

8" Ash	S29°E	32.55'	new BT
5" Balsam Pop.	S77°E	28.77'	new BT
9" Ash	N31°E	19.89'	new BT
USFS Sign	West	3.5'	to nearest edge of sign post
USFS Sign	North	3.7'	to nearest edge of sign post