



A000668746

OFFICE OF THE COUNTY RECORDER  
CASS COUNTY, MINNESOTA  
CERTIFIED, FILED, AND/OR  
RECORDED ON

1/28/2021 10:33:27 AM

AS DOC #: A000668746

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY  
CASS COUNTY RECORDER

BY SF Dep TX#: 168663


### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North 1/4 Corner of Section 22, Township 141 N., Range 25 W., 5th P.M.  
County of Cass, State of Minnesota

At the corner location shown on the sketch :

- On \_\_\_\_\_ found \_\_\_\_\_
- left monument as found     lowered monument     removed monument (explain)
- On Sept. 15, 2020 set 3/4" x 48" aluminum rod with 3 1/4" aluminum cap & magnet, stamped as shown, up 0.4' in grass marsh.

#### SKETCH OF REFERENCE TIES (NOT TO SCALE)

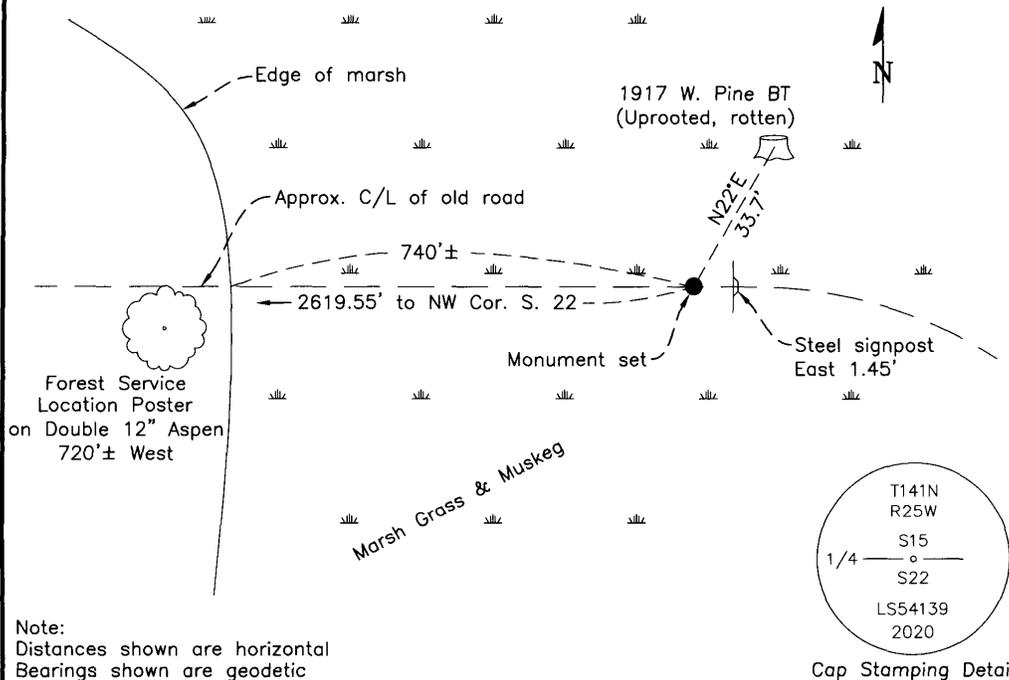

Statement of evidence relative to this corner location is on the back of this page

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the state of Minnesota.

*Aaron J. Skattum*  
Aaron J. Skattum  
MN License No. 54139

12-14-2020  
Date

Corner Index No. N.0-15.0  
GCDB ID No. 440400

Cass County Coordinates  
North Zone, NAD83 2011 Adj.  
N: 179,098.679  
E: 596,915.950





Corner Index No. N.0-15.0

STATEMENT OF EVIDENCE

North 1/4 Corner of Sec. 22, T.141N., R.25W., 5th P.M., Cass County, MN

1871 Walker, Allen & Putnam, U.S. General Land Office, originally established this corner while surveying the subdivision lines of this township, and set wood post to mark the corner position with the following witnesses:

8" Tamarack	S20°W	16 links (10.56')
7" Tamarack	N15°W	7 links (4.62')

Information on file at the MN Historical Society, St. Paul, MN. Copies filed with the Cass County Highway Department/Surveyors Office (CCHD/SO)

1917 J. Flynn, Cass County Surveyor, (Survey Record No. 377, Survey Record Book "C", Page 32) while surveying for Saylor Road, found both original GLO bearing trees, and a "quarter post", but does not specify if the post was an original monument or not. He noted the following bearing trees:

8" Tamarack	S20°W	10.56'	1871 BT, now 9" stub
7" Tamarack	N15°W	4.62'	1871 BT, now 7" burnt stump
10" White Pine	N22°E	33.7'	new BT marked
15" Tamarack Stump	S32°W	27.4'	new BT marked

Information on file at CCHD/SO

2020 A. Skattum, U.S. Forest Service, (Corner Restoration Book 1, Page 41, USFS Records) found Flynn's 1917 white pine bearing tree, laying flat and uprooted, but with blaze and partial scribe visible and facing upward. No evidence of any other bearing trees was found. The corner location was reestablished at the record bearing and distance from this tree, and a monument was set as shown on the face of this document. No suitable bearing trees were available for new witnesses.

USFS Records cited herein are on file at the Chippewa National Forest Supervisor's Office.