



A000676175

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

8/27/2021 11:47:02 AM

AS DOC #: A000676175

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY KF Dep TX#: 174777

I HEREBY CERTIFY THAT THIS DOCUMENT AND THE DATA
CONTAINED HEREIN WAS PREPARED BY ME OR UNDER
MY DIRECT SUPERVISION.

Guy T. Carlson 6/10/2021
GUY T. CARLSON DATE

LICENSE NO. 40991

- LAND SURVEYOR PROFESSIONAL ENGINEER
- COUNTY SURVEYOR COUNTY ENGINEER

NAD 1983 (1996 HARN) CASS COUNTY NORTH ZONE COORDINATES
N= 303745.581 E= 513221.286 US SURVEY FT
(COORDINATES ARE SHOWN AS INFORMATION ONLY, SUBJECT TO VERIFICATION)

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

INDEX NO. P-25, EAST QUARTER CORNER OF SECTION 24, TOWNSHIP 145, RANGE 28, 5TH P.M.
STATE OF MINNESOTA, COUNTY OF CASS

AT THE CORNER LOCATION SHOWN ON THE SKETCH:

- ON 06/2/2021 FOUND A(N) A FOREST SERVICE LOCATION POSTER ON A 9' TAMARACK, ALONG WITH REMNANTS OF A POST SHOWING A HEWN MARK.
DATE
- LEFT MONUMENT AS FOUND, LOWERED MONUMENT, REMOVED MONUMENT (EXPLAIN)
- ON 06/2/2021 PLACED A(N) 4 FOOT BY 5/8 INCH REBAR WITH STAMPED ALUMINUM CAP IN PLACE OF THE RECOVERED POST.
DATE

SKETCH OF REFERENCE TIES

DECLINATION 0°
SKETCH NOT TO SCALE



MONUMENT MARKED:




Capped Rebar

T145-R28-S24



4 FOOT STEEL FENCE POST

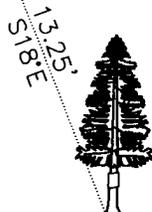

T145-R27-S19

DISTANCES ARE TO A 60D SPIKE AND WASHER

STATEMENT OF EVIDENCE RELATIVE TO THIS CORNER LOCATION IS ON BACK OF PAGE



STATEMENT OF EVIDENCE: East Corner of Section 24, Township 145 North, Range 28 West, of the 5th Principal Meridian.

1873; This corner was originally established by P.H. Conger, Deputy Surveyor under contract to the General Land Office (GLO), now the Bureau of Land Management (BLM). A copy of the plat of this township and hand copied field notes are on file in the Itasca County Surveyor's Office. These Field notes indicate a wood post was set to mark this corner position, which was witnessed by:

Tamarack,	6",	North 83° West,	18 links,	11.88 feet:
Tamarack,	6",	North 63° East,	22 links,	14.52 feet:

1900; (May) C.A. Swift of the United States Army Corps of Engineer's recovered the GLO post along with a GLO witness tree (not specified). This corner position was tied into their stadia traverse while performing reservoir surveys in the area.

1912; (Dec.) J.W. Curo, LS 1428 performed a survey which is found in the Survey Record #222, Book A, page 548. Mr. Curo recovered the GLO post standing and well preserved. He noted that both of the GLO bearing trees were down. He recovered two bearing trees that appeared to have been marked with a jack knife. He does not give bearings and distances to these trees.

1928; (Feb.) United States Forest Service Form 874-9 was filed by Dana F. Kirkmire of the Civilian Conservation Corps. Mr. Kirkmire recovered a 1½" post, 4" high in the edge of a Tamarack swamp. This corner position was witnessed by:

Tamarack,	4",	South 60° East,	14 links,	9.24 feet;
Tamarack,	6",	North 76° West,	20 links,	13.20 feet:

A Forest Service Location Poster (FSLP) was placed on this second witness.

1933; (Dec.) United States Forest Service Form 874-9 was filed by Z.A. Zasada, Tech Foreman for the Civilian Conservation Corps. Mr. Zasada notes this corner was marked by a post that was loose and rotten at the butt. He recovered the FSLP that was placed in 1928. He added the following witnesses with catfaces:

Tamarack,	4",	South,	5 feet;
Tamarack,	4",	North,	10 feet:

2021; (June) Itasca County Township 145-27 Field Book 1, page23. Itasca County personnel searched for and found the 1928 FSLP on a standing 9" Tamarack. Excavation at record bearing and distance from the recovered FSLP revealed the remains of a post with hewn marks visible. A 4' by 5/8" rebar with a stamped aluminum cap was set at the location of the post remains. Further search failed to recover any conclusive evidence of any other historic witnesses. The recovered and established witnesses are as shown on the face of this certificate.

