


T. 136 R. 29 M. 5th Coordinates: X _____ Y _____
NE 18 Corner common to sections 7, 8, 17, 18

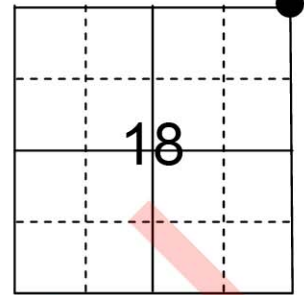

EXISTING SURVEYS

Original Government Survey

Year surveyed 1870
Original monument Post

Original Evidence Found

Year of search 1900 by Canfield
Monument found _____
Surv Rec #300, Book B, pg. 307

Bearing Trees

Species	Norway Pine	Black Pine	Aspen	Aspen
Diameter	16"	6"	6"	5"
Bearing	N 24° E	S 38° E	S 3 1/2° W	N 76° W
Distance	143 links	30 links	51 links	100 links

Original Bearing Trees Found

Species	Norway Pine	Black Pine	Aspen	Aspen
Diameter	16"	6"	6"	5"
Bearing	N 24° E	S 38° E	S 3 1/2° W	N 76° W
Distance	143 links	30 links	51 links	100 links

Subsequent Corner Restoration

Year surveyed Circ 1900 By J.M Canfield, County Surveyor
Location filed: Survey Record #300, Book B, page 307
Monument: Set Rock
From GLO witnesses.

Evidence of Subsequent Corner Restoration

Year of search 12/1913 By H.S Todd, Deputy Co. Surveyor
Location filed: Survey Record #300, Book B, page 307
Monument: Set a 2 inch by 48 inch galvanized iron pipe
I used the fences for line as to E & W and set the corner
S 24° W, 94.38' from the remaining Norway Pine stump.

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Bearing Trees, Reference Objects

Species	Cherry	Tele. Pole	Light Pole	Red Oak
Diameter	4"	8"	8"	6"
Bearing	S 26°16' W	N 76°07' W	N 32°20' E	S 56°37' E
Distance	34.10'	125.20'	48.60'	57.05'

Subsequent Corner Restoration

Year surveyed 12/1913 By H.S Todd
Location filed: Loon Lake Township Road Order #15
Monument: Indicates an iron pipe

1/1917, E.B. Horst, LS 376
Curo Book 64, pages 75 and 77
sent a man to I.M. at cor. of secs 7-8-17-18.

3/1917, E.B. Horst, LS 376
Survey Record #338, Book B, page 503 and Curo Book 62,
image 214, states at 5297.6 South I.M. at corner to section.

10/1918, J.D. Middleton, Deputy County Surveyor
Survey Rec. #402, Book C, page 138
Iron Monument at the corner of sections 7, 8, 17, 18.

3/1919, J.H. Flynn, Cass County Surveyor
Subdivision Section 8
Indicates 2 1/2 x 48" Iron Monument known corner established
from Gov't bearing trees.

7/1940, J.W. Curo, LS 1428
Curo file 110, worksheet
Indicates this corner and a distance of 2645.7', W. to N. 1/4
corner section 18 and 2639.8', E. to N. 1/4 corner section 17.

Evidence of Subsequent Corner Restoration Found

Year of search 3/1951 By D. Cole, Cass County Engineer
Location filed: Project S.P. 11-509-01
Monument: Assumed at intersection.
Indicates corner assumed at PI station 157+62.1, witnesses.
Power Pole, NW, 56.0' Nail and disc
Tele Pole, SW, 44.0' Nail and disc

5/2004, B. Grivna, LS 17253
Certificate of Location for E 1/4 corner, Section 7
Found Monument

3/2014, CCHD/SO
#2014.003
Found 3/4" ODIP, down 0.4 foot, on centerline Twp. Rds, N. and
S., on centerline CSAH #17.

9/2019, CCHD/SO
#2014.003
Dug 2'x 2' hole to 2.5" ODIP, top 1' bent, locate base, remove
and witnessed as follows:
6" Red Pine, N 52° E, 85.70' duplex nail, up 1.0', N. side
Tele Ped Post, S 26° E, 56.17' duplex nail, up 1.0', W. side
6" Red Pine, S 37° W, 72.02' duplex nail, up 1.0', W. side
Power Pole, N 26° W, 49.57' duplex nail, up 1.0', W. side

Subsequent Corner Restoration

Evidence of Subsequent Corner Restoration Found

Year surveyed 4/2020 By CCHD/SO

Year of search _____ By _____

Location filed: #2018.019

Location filed:

Monument: Set a 1"x 32" alum. Co. mon.

Monument:

After reconstruction of CSAH #17, in place of the recovered iron pipe, down 0.05', 2'+/-, W. of centerline 17th Ave., on new centerline of CSAH #17.

