


T. 136 R. 29 M. 5th Coordinates: X _____ Y _____
N 1/4 17 Corner common to sections 8, 17

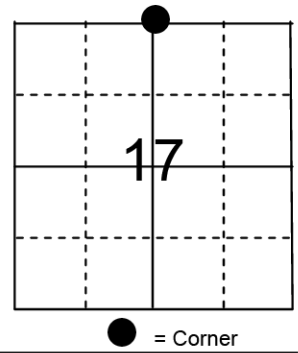

EXISTING SURVEYS

Original Government Survey

Year surveyed 1870
Original monument Post

Original Evidence Found

Year of search 1917 by Horst
Monument found _____
Survey Rec #404, Bk C, pg 147

Bearing Trees

Species Black Pine Black Pine
Diameter 8" 8"
Bearing S 20° W N 36° E
Distance 18 links 7 links

Original Bearing Trees Found

Species Black Pine
Diameter stump
Bearing S 20° W
Distance 11.88'

Subsequent Corner Restoration

Year surveyed 1/1917 By E.B. Horst, LS 376
Location filed: Survey Rec. #404, Bk C, pg 147-148 and Curo
Monument: Set Spike
Curo Book 64, pages 75-77 and 82. From GLO witness
identified by local residents. Later sets I.M. at corner.

Evidence of Subsequent Corner Restoration

Year of search 10/1918 By J.D. Middleton, Deputy Co. Surv
Location filed: Survey Record #402, Book C, page 138-139
Monument: Found Iron Mon.

Bearing Trees, Reference Objects

Species Jack Pine Fence Post
Diameter 5"
Bearing S 5° E North
Distance 28.5' 36.0'

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 3/1919 By J.H. Flynn, Cass Co. Surveyor
Location filed: Subdivision Section 8, E-22
Monument: 2 x 48" I.M.
Indicates Known corner established from Gov't bearing trees.

7/1940, J.W. Curo, LS 1428
Curo file 110, worksheet
Indicates a crook at this corner and a distance of 2639.8', W.
to NE corner section 18 and 2631.0', E. to NE corner section
17. These distances noted by Horst in Curo Book 64, page 77.

3/1951, D. Cole, Cass County Engineer
Project S.P. 11-509-01
Indicates corner assumed at intersection of old rd. to W. and
centerline of CSAH #17 to the N.

Evidence of Subsequent Corner Restoration Found

Year of search 3/2014 By CCHD/SO
Location filed: #2014.003
Monument: Found 7/8" ODIP, RLS 17253
flush, on S. shoulder of 56th St. and witnessed as follows.
12" Jack Pine, S 10° E, 41.00'(2004) 60d spike, up 0.9', N. side
12" Red Pine, N 32° E, 76.09' duplex nail, up 1.0', E. side
16" Spruce, N 34° W, 105.13' duplex nail, up 1.0', E. side

8/2018, CCHD/SO
#2018.019 prior to reconstruction of CSAH #17, found 7/8"
ODIP, RLS 17253, flush, on S. shoulder 56th St., remove pipe
and witnessed as follows:
12" Jack Pine, S 10° E, 41.00'(2004) 60d spike, up 0.9', N. side
12" Red Pine, N 32° E, 76.09'(2014) duplex nail, up 1.0', E. side
16" Spruce, N 34° W, 105.13'(2014) duplex nail, up 1.0', E. side


4/2020, CCHD/SO
#2018.019
After reconstruction of CSAH #17, set a 1"x 22" alum. Co. mon.
in place of the recovered iron pipe, down 0.05', on centerline of
56th St.

5/2020, T.L. Freeman, LS 21367
Filed a Certificate of Location, Doc. #A000659272 on the above
information.

Index No. J 7

CASS COUNTY LAND CORNER RECORD

T. 136 R. 29 M. 5TH Coordinates: X _____ Y _____
N/4 17 Corner common to sections 8, 17

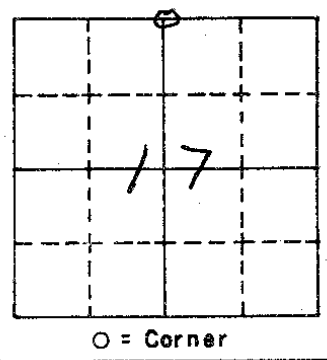

EXISTING SURVEYS

Original Government Survey
 Year surveyed 1870
 Original monument Post

Original Evidence Found
 Year of search _____ By _____
 Monument found _____

Bearing Trees
 Species B. Pine B. Pine
 Diameter 8" 8"
 Bearing S 70 W N 36 E
 Distance 181KS 71KS

Original Bearing Trees Found
 Species _____
 Diameter _____
 Bearing _____
 Distance _____

Subsequent Corner Restoration
 Year surveyed 1918 By J. H. FLYNN
 Location filed COUNTY RESURVEY "E-22"
 Monument 2x4x8" IRON MONUMENT
1918, J.H. FLYNN, COUNTY BOOK "C" P 138 FND J.M.
1917- E.B. HORST COUNTY BOOK "C" P 147, 148 SW. CORN.
BIT. SET J.M. also on microfilm - roll 1105 BX64

Evidence of Subsequent Corner Restoration
 Year of search 5-13-04 By R. Bruna # 17253
CCRO # A000488020
1/2" iron pipe capped RLS # 17253

Bearing Trees, Reference Objects
 Species J. PINE FENCE POST
 Diameter 5"
 Bearing SSE N
 Distance 28.5' 36.0'
1917 ties

Bearing Trees, Reference Objects
 J. PINE J. PINE SPRUCE
 9" 12" 15"
 N 30° E S 30° E N 55° W
 62.66' 41.00' 75.24'

Subsequent Corner Restoration
 Year surveyed _____ By _____
 Location filed _____
 Monument _____

Evidence of Subsequent Corner Restoration Found
 Year of search _____ By _____

Remonumentation certificate prepared _____ By _____
 Filed at _____ Date _____