


T. 136 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 14 Corner common to sections 11, 14

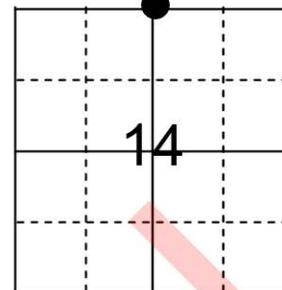

14

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1870  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ by \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees

Species Spruce W. Pine  
Diameter 6" 12"  
Bearing S 58° W N 42° W  
Distance 5 links 45 links

Original Bearing Trees Found

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Subsequent Corner Restoration

Year surveyed 10/1929 By A.W. Prudlo  
Location filed: C.A.R. #14, Ditch Shelf 3, Book 164, page 2  
Monument: No Mon. indicates 1/4 Cor. At Station 27+22.6

Evidence of Subsequent Corner Restoration

Year of search 3/1951 By D. Cole, Cass County Engineer  
Location filed: Project S.P. 11-509-01  
Monument: corner assumed  
Indicates station 26+08 at intersection of centerline and fence line to N.

Bearing Trees, Reference Objects

Species Poplar Pine  
Diameter 6" 8"  
Bearing NE NW  
Distance 55.6' 44.0'

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Subsequent Corner Restoration

Year surveyed 5/2012 By CCHD/SO  
Location filed: #2012.010  
Monument:  
Searched for corner on centerline of CSAH #17 at 1929 stationing, 1951 project stationing and the lost position, no evidence of corner was found.  
  
8/2019, C.M. Hidde, LS 44881  
#2014.003  
Survey crew searched for corner on centerline of CSAH #17 at the lost position, got a magnetic reading, deep, no evidence.  
  
9/2019, CCHD/SO  
#2014.003  
Dug 6'x 6' hole, 2' deep to natural ground, no evidence of a corner was found, fence line is within a few feet of 1951 CCHD location and fits occupation lines all the way to N 1/4 sec. 11, fence line intersection with sec. line is determined as corner.  
8" Red Oak, N 18° E, 14.99' duplex nail, up 1.0', E. side  
15" White Oak, S 32° W, 140.76' duplex nail, up 1.0', W. side  
12" Tri Burr Oak, N 39° W, 118.69' duplex nail, up 1.0', E. side  
  
4/2020, CCHD/SO  
#2018.019  
After reconstruction CSAH #17, set a 1"x 19" alum. Co. mon. from witnesses, down 0.05', 8.5', N. of centerline CSAH #17.

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Location filed: \_\_\_\_\_  
Monument: \_\_\_\_\_

