


T. 136 R. 31 M. 5th Coordinates: X _____ Y _____
NE 35 Corner common to sections 25, 26, 35, 36

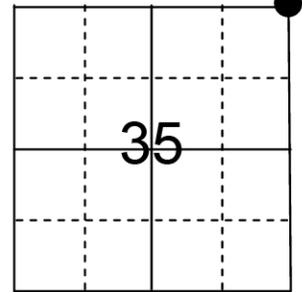

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 9/1870, R. Cronk
Original monument Post

Original Evidence Found

Year of search 1910 by Moulster
Monument found _____
Survey Rec #191, Bk A, pg 457

Bearing Trees

Species	Spruce	Balsam	Balsam	Aspen
Diameter	8"	7"	6"	5"
Bearing	S 50° W	N 64° W	S 41° E	N 65° E
Distance	25 links	12 links	20 links	22 links

Original Bearing Trees Found

Species	Spruce	Balsam		
Diameter				
Bearing	S 50° W	S 41° E		
Distance	25 links	20 links		

Subsequent Corner Restoration

Year surveyed 6/1910 By A.W. Moulster, LS 967
Location filed: Survey Record #191, Book A, page 457 and Curo Monument: Found rotted Aspen stump Curo Book Misc 005, page 31, states cor sets W. 44.5', found GLO remains, Wenholz remembers marks on SE tree 4 years ago, chopped into SW tree found B.T. I set the corner from SE and SW witnesses.

Evidence of Subsequent Corner Restoration

Year of search 10/1911 By A.W. Moulster, LS 967
Location filed: Survey Record #191, Book A, page 463 and Curo Monument: Set 2"x 48" galvanized iron pipe capped on top Curo Book 50-1, page 127, states take up wood stake and put in place iron pipe with rod trough bottom, set in a bed of concrete for the true corner.

Bearing Trees, Reference Objects

Species			
Diameter			
Bearing			
Distance			

Bearing Trees, Reference Objects

Species			
Diameter			
Bearing			
Distance			

Subsequent Corner Restoration

Year surveyed Circ 1930 By J.W. Curo, LS 1428
Location filed: Township 136 North, Range 31 West Map, #4562
Monument: Indicates corner compiled from record information, indicates monument and 1910 distances between section corners.

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

5/2014, P.A. Trottier, LS 41002
Certificate of Location
Found 3" cap on pipe, down 0.4', on center of trail, remnants of concrete around base, and witnessed as follows.
12" Twin Oak, N 31° W, 52.09' duplex nail, E. side
12" Oak, N 67° E, 25.27' duplex nail, S. side
16" Oak, S 53° E, 22.91' duplex nail, N. side


6/2014, P.A. Trottier, LS 41002
Certificate of Survey for Cass Co. #7431
Indicates a found monument at corner.

5/2020, CCHD/SO
#2020.007
Found 2.25" ODIP, top damaged, down 0.4', on centerline of trail and witnessed as follows.
12" Twin Burr Oak, N 31° W, 52.09'(2014) duplex nail, up 1.0', E
12" Burr Oak, N 67° E, 25.27'(2014) duplex nail, up 1.0', S. side
16" Burr Oak, S 53° E, 22.91'(2014) duplex nail, up 1.0', N. side

Index No. VR1

CASS COUNTY LAND CORNER RECORD

T. 136 R. 31 M. 5TH Coordinates: X _____ Y _____
NE 35 Corner common to sections 25, 26, 35, 36

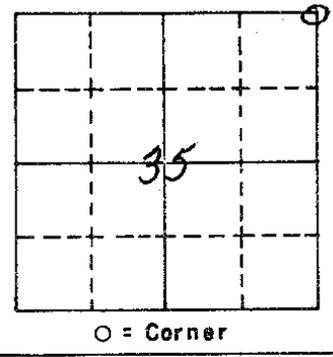

EXISTING SURVEYS

Original Government Survey
 Year surveyed 1870
 Original monument POST

Original Evidence Found
 Year of search _____ By _____
 Monument found _____

Species	Bearing	Trees	Distance
<u>SPRUCE</u>	<u>BALSAM</u>	<u>BALSAM</u>	<u>ASPEN</u>
<u>8"</u>	<u>7"</u>	<u>6"</u>	<u>5"</u>
<u>S50W</u>	<u>N64W</u>	<u>S41E</u>	<u>N65E</u>
<u>25 LKS</u>	<u>12 LKS</u>	<u>20 LKS</u>	<u>22 LKS</u>

Original Bearing Trees Found
 Species _____
 Diameter _____
 Bearing _____
 Distance _____

Subsequent Corner Restoration
 Year surveyed 1910 By A. W. MAULSTRE
 Location filed COUNTY SURVEY RECORD BOOK "A" P. 436-464
 Monument FIN. OLD GOVT B.T.S. SE & SW SET CORNER
IN 1911 SET 2x4x8" CAPDOL GALV. L.P. IN CONCRETE
also on microfilm - roll 105 BK 50 P. 127

Evidence of Subsequent Corner Restoration
 Year of search _____ By _____

Bearing Trees, Reference Objects
 Species _____
 Diameter _____
 Bearing _____
 Distance _____

Bearing Trees, Reference Objects

Subsequent Corner Restoration
 Year surveyed _____ By _____
 Location filed _____
 Monument _____

Evidence of Subsequent Corner Restoration Found
 Year of search _____ By _____

Remonumentation certificate prepared _____ By _____
 Filed at _____ Date _____